CATEGORY 1

يە بەر بە تو

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

FACIL:50 50 50 50 50 50 50 50)-251 Turkey Point)-269 Oconee Nucles)-270 Oconee Nucles)-272 Salem Nucles)-311 Salem Nucles)-311 Duane Arnold)-354 Hope Creek N AME AUTHOR S	Plant, Plant, ar Stat ar Stat r Genen r Genen Energy uclear AFFILI	Unit Unit Unit Unit Unit Unit Unit Unit	98/09/09 NOTARIZED 3, Florida Power a 4, Florida Power a Unit 1, Duke Power Unit 2, Duke Power Station, Unit 1, Pu Station, Unit 2, P er, Iowa Electric L on, Unit 1, Public	nd Light nd Light Co. Co. blic Serv ublic Serv ight & Pc	C 05000251 05000269 05000270 vi 05000272 vv 05000311 vw 05000331			
SUBJECT: Part 21 rept re possible machining defect in certain one inch stainless steel Swagelok front ferrules, part number SS-1613-1.Caused by tubing slipping out of fitting at three times working pressure of tubing.Notified affected utils. DISTRIBUTION CODE: IE19T COPIES RECEIVED:LTR 1 ENCL 1 SIZE: 4 R TITLE: Part 21 Rept (50 DKT)									
' NOTES : AI	Pplication for perm RECIPIENT ID CODE/NAME PD2-3 PD PD1-2 PD JABBOUR,K	mit rer COPII LTTR 1 1 1	ES	filed. RECIPIENT ID CODE/NAME PD2-2 PD PD3-3 PD LABARGE,D	COPIES LTTR EN 1 1 1 1 1 1				
INTERNAL:	MILANO, P ENNIS, R FILE_CENTER-01 NRR/DRPM/PECB/B RES/DET/EIB RGN2 RGN4		1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	LAUFER, R NRR/DRPM/PECB PDR WARD, M. RGN1 RGN3		. 0 			
EXTERNAL:	INPO RECORD CTR NRC PDR	1 1	1 1	NOAC SILVER,E NUDOCS FULL TXT	1 1 1 1				

THIS DOCUMENT HAS BEEN SCANNED

.

T

NOTE TO ALL "RIDS" RECIPIENTS: PLEASE HELP US TO REDUCE WASTE. TO HAVE YOUR NAME OR ORGANIZATION REMOVED FROM DISTRIBUTION LISTS OR REDUCE THE NUMBER OF COPIES RECEIVED BY YOU OR YOUR ORGANIZATION, CONTACT THE DOCUMENT CONTROL DESK (DCD) ON EXTENSION 415-2083

FULL TEXT CONVERSION REQUIRED TOTAL NUMBER OF COPIES REQUIRED: LTTR 22 ENCL 22



** * ±... • ٠..

•

s,

٠

1979 - Bray

••••

.

٠,

Swagelok

SWAGELOK COMPANY 29500 Solon Road, Solon, Ohio 44139-3492 U.S.A.

September 9, 1998

Document Control Desk Office of Reactor Regulation Nuclear Regulatory Commission Washington, DC 20555

Subject: Defects Potentially Reportable Under 10CFR21

We are writing to inform you about a possible machining defect in certain one inch stainless steel Swagelok front ferrules, part number SS-1613-1.

The front ferrule is shipped as a component in a Swagelok tube fitting, or sold separately as a replacement part.

A list containing the part numbers of assembled fittings and nuclear safety related certifications under which these ferrules have been sold is enclosed. All of these customers have already been notified by us about this possible problem. Only front ferrules with the heat codes ILA, JVA and JYL stamped on the part are affected; and only one inch ferrules are involved.

The possible defect is that the 45 degree chamfer on the trailing edge of the ferrule may not be correct. A drawing is enclosed that shows this dimension, along with a drawing that illustrates the front ferrules' position in the Swagelok tube fitting. When these ferrules were machined, an improper set-up allowed a few pieces to be manufactured with an inappropriate dimension. Our inspection of the lots involved shows that about 0.019 per cent of the ferrules manufactured in these lots were affected.

Laboratory testing of these parts with this incorrect dimension had the tubing slip out of the fitting at three times working pressure of the tubing.

Our corrective action includes doubling our sample size on these parts and implementing a long term project to 100 per cent inspect using automation.

If there are any questions, please do not hesitate to contact us.

1/26/20

980909 05000250

Sincerely.

ennán J. Malec Vice President & General Manager

TEIqU

Telephone: 440-248-4600 Fax: 440-349-5970

· ·

、 、 、

,

• .

SS-1613-1

.

Company	Purchase Order	Part Number	QTY	Product ID
Florida Power & Light (Turkey	00032839	SS-1610-1-16	5	R18G20183
Point)				
Public Service Electric & Gas	P2 0957644 1850	SS-1610-1-16	10	R18FJ0055B
Mechanical Engineering Workshop	SF/CRX/198/433	SS-1613-1	50	R17IC0521B
IES Utilities (Duane Arnold)	T30228	SS-1613-1	4	R17IC0521B
Duke Power (Oconee)	ON33500007310100	SS-1610-1-16	24	R17GX0505B
Westinghouse Savannah River	AC04139A #8	SS-1610-1-16	1	R17GX0505

• • •

ī.

.


Swagelok Body SWAGELOK

Swagelok Front Ferrule Swagelok Back Ferrule Swagelok Back Ferrule Swagelok Back Ferrule Swagelok Back Ferrule



•

.

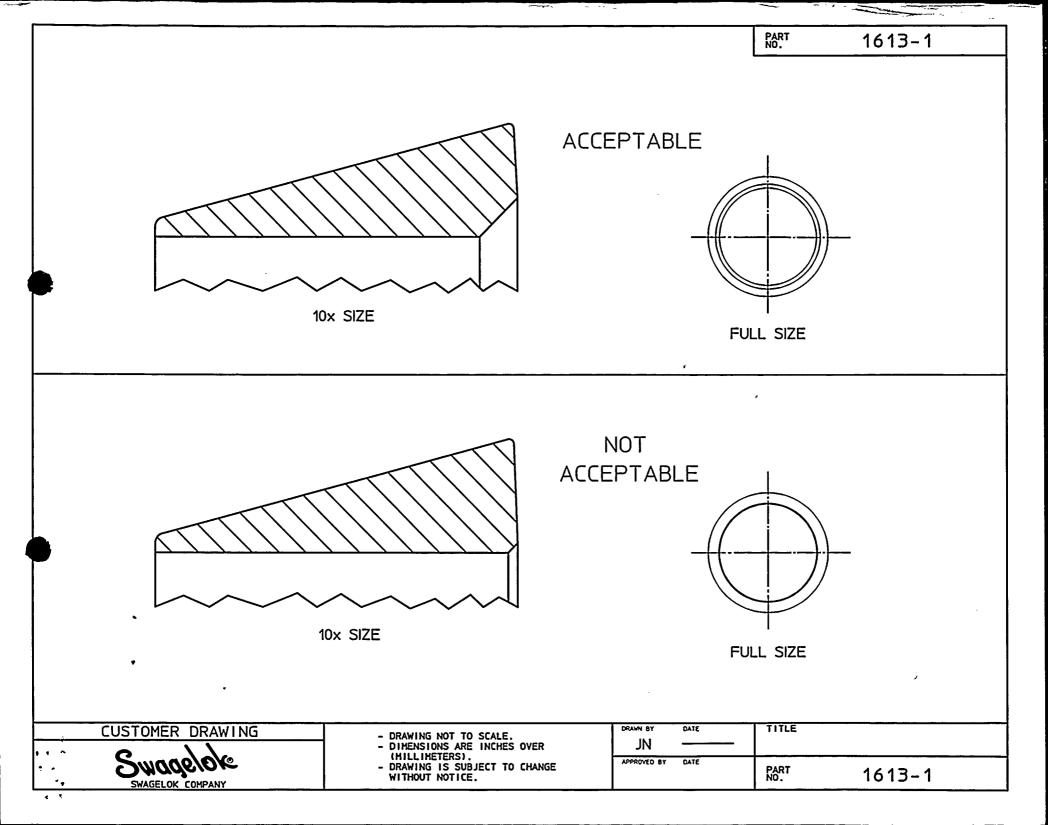



*

. .

.

•

.

50-250	
GENERAL INFORMATION or OTHER	EVENT NUMBER: 34761
LICENSEE: SWAGELOK CITY: SOLON REGION: 3 COUNTY: CUYAHOGA STATE: OH LICENSE#: AGREEMENT: N DOCKET:	NOTIFICATION DATE: 09/11/98 NOTIFICATION TIME: 08:11 [ET] EVENT DATE: 09/11/98 EVENT TIME: 08:11[EDT] LAST UPDATE DATE: 09/11/98
·	NOTIFICATIONS
	JIM GAVULA, REG 3 RDO
NRC NOTIFIED BY: BRUCE FLUSCHE HQ OPS OFFICER: JOHN MacKINNON	JOHN ZEILER, REG 2 FEMA VERN HODGE, PCEB NRR
EMERGENCY CLASS: NOT APPLICABLE 10 CFR SECTION: CDEG 21.21(c)(3)(i) DEFECTS/NONCOMPLIANCE	•
· · · · · · · · · · · · · · · · · · ·	

EVENT TEXT

Swagelok submitted the following Part 21 about a possible machining defect in certain one inch stainless steel Swagelok front ferrules

"We are writing to inform you about a possible machining defect in certain one inch stainless steel Swagelok front ferrules, part number SS-1613-1.

"The front ferrule is shipped as a component in a Swagelok tube fitting, or sold separately as a replacement part.

"A list containing the part numbers of assembled fittings and nuclear safety related certifications under which these ferrules have been sold is enclosed. All of these customers have already been notified by us about this possible problem. Only front ferrules with the heat codes ILA, JVA and JYL stamped on the part are affected; and only one inch ferrules are involved.

"The possible defect is that the 45 degree chamfer on the trailing edge of the ferrule may not be correct. A drawing is enclosed that shows this dimension, along with a drawing that illustrates the front ferrules' position in the Swagelok tube fitting. When these ferrules were machined, an improper set-up allowed a few pieces to be manufactured with an inappropriate dimension. Our inspection of the lots involved shows that about 0.019 per cent of the ferrules manufactured in these lots were affected.

"Laboratory testing of these parts with this incorrect dimension had the tubing slip out of the fitting at three times working pressure of the

(Continued on next page)

· · · ·

.

,

.

, , , • •

2 2 2

tubing.

"Our corrective action includes doubling our sample size on these parts and implementing a long term project to 100 per cent inspect using automation."

Turkey Point, Oconee, and Duane Arnold were contacted by Swagelok of the Part 21 submitted by Swagelok.

• . •

•

*

4

• ٩ .

 
. . .

-4 . , . · · · •

• • ¥ •

• • . .

•, , *



Swagelok Company 29500 Solon Road, Solon, OH 44139 Phone: 440-248-4600 Fax: 440-349-5970

FACSIMILE COVER SHEET

Date: September 11, 1998

'To: Document Control Desk/ NRC

From: Bruce Flusche

5

Total 5 Pages:

Subject: Potential 10cfr21 notification

Original to follow by certified mail

CONFIDENTIALITY NOTE: This cover sheet and the documents accompanying it contain confidential information that belongs to the sender and is legally privileged. The information is intended only for use by the recipient named above. If you are not the intended recipient, be aware that any disclosure, copying, distribution, or use of its contents is prohibited. If you have received this communication in error, please contact the sender immediately. •

· •

• •

*

.