

San Onofre Replacement Steam Generator Tube Wear February 7, 2013

Peter T. Dietrich, Senior Vice President and Chief Nuclear Officer

San Onofre Nuclear Generating Station


Types of Tube Wear in SONGS Units 2 and 3 Replacement Steam Generators (RSG)


- Tube-to-Tube Wear (TTW)
- Wear in U-bend region caused by contact with adjacent tubes

Other Tube Wear

- Tube wear at Anti-Vibration Bar (AVB) intersections
- Tube wear at Tube Support Plate (TSP) intersections
- Tube wear caused by vibration of adjacent retainer bar

SG89 Tube-To-Tube Wear

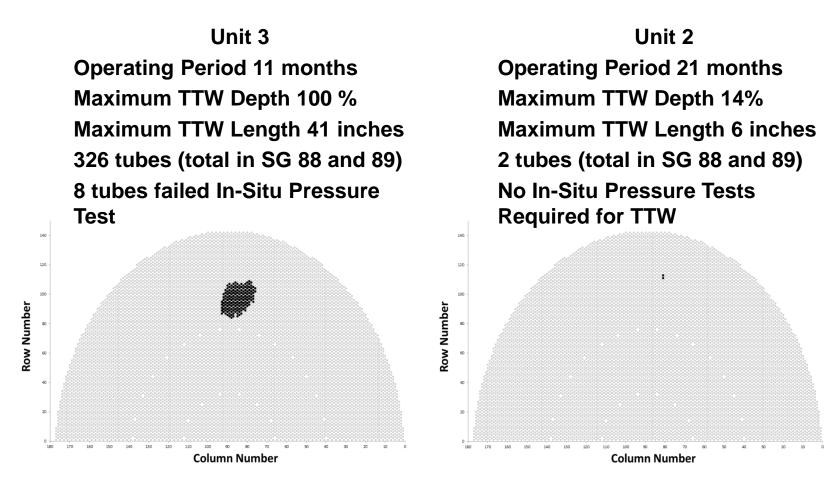

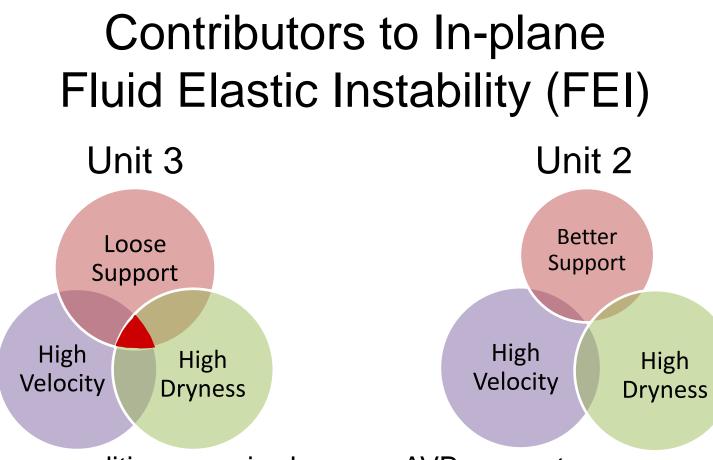

All three conditions required for FEI existed concurrently for many tubes AVB supports are more effective in Unit 2, reducing potential for in-plane FEI

Differences Between Unit 2 and Unit 3

- Deep TTW in multiple tubes only in Unit 3 after 11 months (approximately 7,000 full power hours); AVB wear also more extensive in Unit 3 than Unit 2
- Fabrication differences during manufacture of SONGS RSGs
 - Unit 3 AVB have greater flatness due to greater pressing force
 - Confirmed by 20 times more signals indicative of contact in Unit 2 in pre-service inspections
 - Unit 3 tube roundness is more controlled
 - Confirmed by pre-service measurements


Differences Between Unit 2 and Unit 3

- Detailed tube bundle model shows that differences in fabrication result in substantially increased contact forces (reduced looseness) between tubes and AVBs for Unit 2
- More effective AVB support conditions allowed Unit 2 to operate at 100% power for 21 months (approximately 12,500 full power hours) with minimal TTW and less extensive AVB wear

Resolution of In-plane FEI Concerns Achievable with Multiple Layers of Margin

- Assure adequate support
- Reduce velocity
- Increase damping by decreasing dryness (insure adequate moisture levels in bundle)
- Demonstrate acceptable in-plane FEI stability ratios based on conservative assumptions
- Compare and justify the operating conditions based on those of satisfactory service in existing steam generators

In-plane FEI can be Precluded

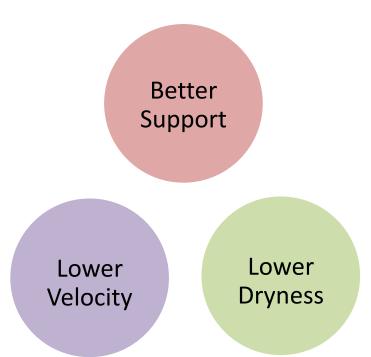

Eliminating the concurrent combination of high velocities, high dryness and inadequate support can preclude FEI

Insights from SONGS Experience

- In-plane FEI was unexpected but industry and plant specific measures worked as designed to detect the resulting tube leak and safely shutdown the plant
- Existing Industry requirements and criteria are strong and have been applied effectively to address tube-to-tube wear and other wear mechanisms
- Significant independent expert participation has been instrumental in developing conclusions
- Operating experience is being shared