January 5, 2000

Mr. L. W. Myers Senior Vice President Beaver Valley Power Station Post Office Box 4 Shippingport, PA 15077

SUBJECT: BEAVER VALLEY 1 AND 2 - SITE - SPECIFIC WORKSHEETS FOR USE IN THE NRC'S SIGNIFICANCE DETERMINATION PROCESS (TAC MA6544)

Dear Mr. Myers:

The purpose of this letter is to provide you with one of the key implementation tools to be used by the Nuclear Regulatory Commission (NRC) in the revised reactor oversight process, which is currently expected to be implemented at the Beaver Valley Power Station, Unit Nos. 1 and 2, in April 2000. Included in the enclosed Risk-Informed Inspection Notebook are the Significance Determination Process (SDP) worksheets that inspectors will be using to risk-characterize inspection findings. The SDP is discussed in more detail below.

On January 8, 1999, the NRC staff described to the Commission plans and recommendations to improve the reactor oversight process in SECY-99-007, "Recommendations for Reactor Oversight Process Improvements." SECY-99-007 is available on the NRC's web site at www.nrc.gov/NRC/COMMISSION/SECY-99-007 is available on the NRC's web site at www.nrc.gov/NRC/COMMISSION/SECY-99-007 is available on the NRC's web site at www.nrc.gov/NRC/COMMISSION/SECYS/index.html. The new process, developed with stakeholder involvement, is designed around a risk-informed framework, which is intended to focus both the NRC's and licensee's attention and resources on those issues of more risk significance.

The performance assessment portion of the new process involves the use of both licensee-submitted performance indicator data and inspection findings that have been appropriately categorized based on their risk significance. In order to properly categorize an inspection finding, the NRC has developed the SDP. This process was described to the Commission in SECY-99-007A, "Recommendations for Reactor Oversight Process Improvements (Follow-up to SECY-99-007)," dated March 22, 1999, also available at the same NRC web site noted above.

The SDP for power operations involves evaluating an inspection finding's impact on the plant's capability to limit the frequency of initiating events; ensure the availability, reliability, and capability of mitigating systems; and ensure the integrity of the fuel cladding, reactor coolant system, and containment barriers. As described in SECY-99-007A, the SDP involves the use of three tables: Table 1 is the estimated likelihood for initiating event occurrence during the degraded period, Table 2 describes how the significance is determined based on remaining mitigation system capabilities, and Table 3 provides the bases for the failure probabilities associated with the remaining mitigation equipment and strategies.

As a result of the recently concluded Pilot Plant review effort, the NRC has determined that site-specific risk data is needed in order to provide a repeatable determination of the significance of an issue. Therefore, the NRC has contracted with Brookhaven National Lab (BNL) to develop site-specific worksheets to be used in the SDP review. These enclosed worksheets were developed based on your Individual Plant Examination (IPE) submittal that was requested by Generic Letter 88-20. The NRC plans to use this site-specific information in evaluating the significance of issues identified at your facility when the revised reactor oversight process is implemented industry wide. It is recognized that the IPE utilized during this effort may not contain current information. Therefore, the NRC or its contractor will conduct a site visit before April 2000 to discuss with your staff any changes that may be appropriate. Specific dates for the site visit have not been determined, but will be communicated to you in the near future. In addition, the NRC is not requesting a written response or comments on the enclosed worksheets developed by BNL.

We will coordinate our efforts through your licensing or risk organizations as appropriate. If you have any questions, please contact me at (301) 415- 1427.

Sincerely,

/RA/

Daniel S. Collins, Project Manager, Section 1 Project Directorate I Division of Licensing Project Management Office of Nuclear Reactor Regulation

Docket Nos. 50-334 and 50-412

Enclosures: 1. Risk Informed Inspection Notebook for Beaver Valley Unit 1 2. Risk Informed Inspection Notebook for Beaver Valley Unit 2

cc w/encls: See next page

As a result of the recently concluded Pilot Plant review effort, the NRC has determined that site-specific risk data is needed in order to provide a repeatable determination of the significance of an issue. Therefore, the NRC has contracted with Brookhaven National Lab (BNL) to develop site-specific worksheets to be used in the SDP review. These enclosed worksheets were developed based on your Individual Plant Examination (IPE) submittal that was requested by Generic Letter 88-20. The NRC plans to use this site-specific information in evaluating the significance of issues identified at your facility when the revised reactor oversight process is implemented industry wide. It is recognized that the IPE utilized during this effort may not contain current information. Therefore, the NRC or its contractor will conduct a site visit before April 2000 to discuss with your staff any changes that may be appropriate. Specific dates for the site visit have not been determined, but will be communicated to you in the near future. In addition, the NRC is not requesting a written response or comments on the enclosed worksheets developed by BNL.

We will coordinate our efforts through your licensing or risk organizations as appropriate. If you have any questions, please contact me at (301) 415- 1427.

Sincerely,

/RA/

Daniel S. Collins, Project Manager, Section 1 Project Directorate I Division of Licensing Project Management Office of Nuclear Reactor Regulation

Docket Nos. 50-334 and 50-412

Enclosures: 1. Risk Informed Inspection Notebook for Beaver Valley Unit 1 2. Risk Informed Inspection Notebook for Beaver Valley Unit 2

cc w/encls: See next page

WDean	MBranch	GParry
ACRS	JFlack	PWilson
DCollins	MO'Brien	JTrapp, RGN-I
DCoe	OGC	PEslegroth, RGN-I
	ACRS DCollins	ACRS JFlack DCollins MO'Brien

DOCUMENT NAME:C:\LtrMa6544BV.wpd

To receive a copy of this document, indicate in the box: "C" = Copy without enclosures "E" = Copy with enclosures "N" = No copy

OFFICE	LA:PDI-2	PM:PDI-1	BC:PIPB	ASC:PDI- 1	
NAME	MO'Brien	DCollins	WDean	MGamberoni	
DATE	1/5/00	1/5/00	1/5/00	1/5/00	

OFFICIAL RECORD COPY

Beaver Valley Power Station, Units 1 and 2

Jay E. Silberg, Esquire Shaw, Pittman, Potts & Trowbridge 2300 N Street, NW. Washington, DC 20037

First Energy Nuclear Operating Company Licensing Section Mark S. Ackerman, Manager (2 Copies) Beaver Valley Power Station PO Box 4, BV-A Shippingport, PA 15077

Commissioner Roy M. Smith West Virginia Department of Labor Building 3, Room 319 Capitol Complex Charleston, WV 25305

Director, Utilities Department Public Utilities Commission 180 East Broad Street Columbus, OH 43266-0573

Director, Pennsylvania Emergency Management Agency Post Office Box 3321 Harrisburg, PA 17105-3321

Ohio EPA-DERR ATTN: Zack A. Clayton Post Office Box 1049 Columbus, OH 43266-0149

Dr. Judith Johnsrud National Energy Committee Sierra Club 433 Orlando Avenue State College, PA 16803

First Energy Nuclear Operating Company Beaver Valley Power Station J. J. Maracek P. O. Box 4, BV-A Shippingport, PA 15077 First Energy Nuclear Operating Company Beaver Valley Power Station PO Box 4 Shippingport, PA 15077 ATTN: Kevin L. Ostrowski, Plant General Manager (BV-SOSB-7)

Bureau of Radiation Protection Pennsylvania Department of Environmental Protection ATTN: Michael P. Murphy Post Office Box 2063 Harrisburg, PA 17120

Mayor of the Borough of Shippingport Post Office Box 3 Shippingport, PA 15077

Regional Administrator, Region I U.S. Nuclear Regulatory Commission 475 Allendale Road King of Prussia, PA 19406

Resident Inspector U.S. Nuclear Regulatory Commission Post Office Box 298 Shippingport, PA 15077

First Energy Nuclear Operating Company Beaver Valley Power Station PO Box 4 Shippingport, PA 15077 ATTN: M. P. Pearson, Director Plant Services (BV-NCD-3)

Mr. J. A. Hultz, Manager Projects & Support Services First Energy 76 South Main Street Akron, OH 44308 Beaver Valley Power Station, Units 1 and 2 (Continued)

David Lochbaum Nuclear Safety Engineer Union of Concerned Scientists 1616 P Street N.W., Suite 310 Washington, D.C. 20036-1495

Steve Floyd Nuclear Energy Institute 1776 I Street N.W., Suite 400 Washington, D.C. 20006

RISK-INFORMED INSPECTION NOTEBOOK FOR

BEAVER VALLEY UNIT 1

PWR, WESTINGHOUSE, THREE-LOOP PLANT WITH SUB-ATMOSPHERIC CONTAINMENT

Prepared by

Brookhaven National Laboratory Department of Advanced Technology

Contributors

M. A. Azarm J. Carbonaro T. L. Chu A. Fresco J. Higgins G. Martinez-Guridi P. K. Samanta

NRC Technical Review Team

John Flack	RES
Morris Branch	NRR
Doug Coe	NRR
Gareth Parry	NRR
Peter Wilson	NRR
Jim Trapp	Region I
Michael Parker	Region III
William B. Jones	Region IV

Prepared for

U. S. Nuclear Regulatory Commission Office of Nuclear Regulatory Research Division of Risk Analysis & Applications

ENCLOSURE 1

NOTICE

This notebook was developed for the NRC's inspection teams to support riskinformed inspections. The activities involved in these inspections are discussed in "Reactor Oversight Process Improvement," SECY-99-007A, March 1999. The user of this notebook is assumed to be an inspector with an extensive understanding of plant-specific design features and operation. Therefore, the notebook is not a stand-alone document, and may not be suitable for use by non-specialists. This notebook will be periodically updated with new or replacement pages incorporating additional information on this plant. Technical errors in, and recommended updates to, this document should be brought to the attention of the following person:

> Mr. Jose G. Ibarra U. S. Nuclear Regulatory Commission M/S TWFN T4 A9 11545 Rockville Pike Rockville, MD 20852

ABSTRACT

This notebook contains summary information to support the Significance Determination Process (SDP) in risk-informed inspections for the Beaver Valley Unit 1.

SDP worksheets support the significance determination process in riskinformed inspections and are intended to be used by the NRC's inspectors in identifying the significance of their findings, i.e., in screening risk-significant findings, consistent with Phase-2 screening in SECY-99-007A. To support the SDP, additional information is given in an Initiators and System Dependency table, and as simplified event-trees, called SDP event-trees, developed in preparing the SDP worksheets.

The information contained herein is based on the licensee's IPE submittal. The information is revised based on IPE updates or other licensee or review comments providing updated information and/or additional details.

CONTENTS

	Page
Notice	. i
Abstract	. iii
1. Information Supporting Significance Determination Process (SDP)	1
1.1 Initiators and System Dependency	. 3
1.2 SDP Worksheets	. 8
1.3 SDP Event Trees	. 25
2. Resolution and Disposition of Comments	. 33
References	. 34

FIGURES

Page

SDP Event Tree — Transients	26
SDP Event Tree — Small LOCA	27
SDP Event Tree — Medium LOCA	28
SDP Event Tree — Large LOCA	29
SDP Event Tree — LOOP	30
SDP Event Tree — Steam Generator Tube Rupture (SGTR)	31
SDP Event Tree — Anticipated Transients Without Scram (ATWS) .	32

TABLES

Page

1	Initiators and System Dependency for Beaver Valley Unit 1	5
2.1	SDP Worksheet — Transients	9
2.2	SDP Worksheet — Small LOCA	11
2.3	SDP Worksheet — Stuck-open PORV	13
2.4	SDP Worksheet — Medium LOCA	15
2.5	SDP Worksheet — Large LOCA	17
2.6	SDP Worksheet — LOOP	19
2.7	SDP Worksheet — Steam Generator Tube Rupture (SGTR)	21
2.8	SDP Worksheet — Anticipated Transients Without Scram (ATWS	323

1. INFORMATION SUPPORTING SIGNIFICANCE DETERMINATION PROCESS (SDP)

SECY-99-007A (NRC, March 1999) describes the process for making a Phase-2 evaluation of the inspection findings. In Phase 2, the first step is to identify the pertinent core damage scenarios that require further evaluation based on the specifics of the inspection findings. To aid in this process, this notebook provides the following information:

- 1. Initiator and System Dependency Table
- 2. Significance Determination Process (SDP) Worksheets
- 3. SDP Event Trees

The initiator and system dependency table shows the major dependencies between front-line- and support-systems, and identifies their involvement in different types of initiators. The information in this table identifies the most risk-significant front-line- and support-systems; it is not an exhaustive nor comprehensive compilation of the dependency matrix as known in Probabilistic Risk Assessments (PRAs). For pressurized water reactors (PWRs), the support systems for Reactor Coolant Pump (RCP) seals are explicitly denoted to assure that the inspection findings on them are properly accounted for. This table is used to identify the SDP worksheets to be evaluated, corresponding to the inspection's findings on systems and components.

To evaluate the impact of the inspection's finding on the core-damage scenarios, the SDP worksheets are developed and provided. They contain two parts. The first part identifies the functions, the systems, or combinations

thereof that can perform mitigating functions, the number of trains in each system, and the number of trains required (success criteria) for each class of initiators. The second part of the SDP worksheet contains the core-damage accident sequences associated with each initiator class; these sequences are based on SDP event trees. In the parenthesis next to each of the sequence the corresponding event tree branch number(s) representing the sequence is included. Multiple branch numbers indicate that the different accident sequences identified by the event tree are merged into one through the boolean reduction. The classes of initiators that are considered in this notebook are 1) Transients, 2) Small Loss of Coolant Accident (LOCA), 3) Stuck-open Power Operated Relief valve (PORV), 4) Medium LOCA, 5) Large LOCA, 6) Loss of Offsite Power (LOOP), 7) Steam Generator Tube Rupture (SGTR), and 8) Anticipated Transients Without Scram (ATWS). Main Steam Line Break (MSLB) events are included separately if they are treated as such in the licensee's Individual Plant Examination (IPE) submittal.

Following the SDP worksheets, the SDP event trees corresponding to each of the worksheets are presented. The SDP event trees are simplified event trees developed to define the accident sequences identified in the SDP worksheets.

The following items were considered in establishing the SDP event trees and the core-damage sequences in the SDP worksheets:

 Event trees and sequences were developed such that the worksheet contains all the major accident sequences identified by the plant-specific IPEs. In cases where a plant-specific feature introduced a sequence that is not fully captured by our existing set of initiators and event trees, then a separate worksheet is included.

- 2. The event trees and sequences for each plant took into account the IPE models and event trees for all similar plants. Any major deviations in one plant from similar plants typically are noted at the end of the worksheet.
- 3. The event trees and the sequences were designed to capture coredamage scenarios, without including containment-failure probabilities and consequences. Therefore, branches of event trees that are only for the purpose of a Level II PRA analysis are not considered. The resulting sequences are merged using Boolean logic.
- 4. The simplified event-trees focus on classes of initiators, as defined above. In so doing, many separate event trees in the IPEs often are represented by a single tree. For example, some IPEs define four classes of LOCAs rather than the three classes considered here. The sizes of LOCAs for which high-pressure injection is not required are some times divided into two classes, the only difference between them being the need for reactor scram in the smaller break size. Some IPEs also may define several classes of transients, depending on the initiator's impact on the systems. Such differentiations generally are not considered in the SDP worksheets unless they could not be accounted for by the Initiator and System Dependency table.
- 5. Major operator actions during accident scenarios are assigned as high stress operator action or operator action using simple, standard criteria among a class of plants. This approach resulted in the designation of some operator actions as high-stress ones (as opposed to normal), even though the PRA may have assumed a (routine) operator action; hence, they have been assigned an error probability less than 5E-2 in the IPE. In such cases, a note is given at the end of the worksheet.

The three sections that follow include the initiators and dependency table, SDP worksheets, and the SDP event-trees for the Beaver Valley Unit 1 Plant.

1.1 INITIATORS AND SYSTEM DEPENDENCY

Table 1 provides the list of the systems included in the SDP worksheets, the major components in the systems, and the support system dependencies. The system involvements in different initiating events are noted in the last column.

Table 1 (Continued)

Table 1. Initiators and System Dependency for Beaver Valley Unit 1

Affected Systems	Major Components	Support Systems	Initiating Event Scenarios
Reactor Coolant Pumps (RCPs)	Pumps 1A, 1B, 1C	RPCCW, Offsite grid, CIA, SIA, SSPS	LOOP, Transient, RCP seal LOCA
PORVs	PORV 455C&D, 456 Block Valves 535,536,537	125V-DC, 480V AC (Block Valves), Containment IA, Backup N_2 (PORV 455C&D)	All except LLOCA, and MLOCA
Main and Dedicated Feed Water (MFW and DFP ⁽¹⁾)	MFW Pumps P1A, P1B, DFW Pump P4 ⁽¹⁾	TPCCW, Offsite grid, DC Battery 1-5, SSPS ERF DG (DFP P4)	Transient. SLOCA. SORV.LOOP
Condensate Pump		TPCCW, Offsite grid, Normal 125VDC Supply Battery 1-5	Transient, SLOCA, SORV, LOOP
AFWs	2 MDPs	4.16 KV EAC, EDG, 125 V-DC,SSPS	All except MLOCA and LLOCA
	1 TDP	125 V-DC,SSPS	
RHR	Pumps P1A, P1B	4.16kV EAC, EDG, 125VDC, RPCCW, SSPS	SGTR
HHSI ⁽²⁾	Pumps P1A, P1B, P1C ⁽²⁾	Offsite grid, 4.16kV EAC, EDG, 125VDC, SSPS, River Water Header	All except LLOCA, RCP Seal LOCA
LHSI	Pumps P1A, P1B	4.16kV EAC, EDG, 125VDC, SSPS	All including RCP Seal LOCA
	MOVs	4.16kV EAC, EDG	
Crosstie Valves (ECCS Cold Led Recirculation)	Train A and B	4.16kV EAC, EDG, SSPS	All including RCP Seal LOCA
RWST Level	LT 100 A, B, C, D	Vital Bus I, II, III, IV; SSPS	MLOCA, SGTR
Quench Spray (QS)	Pumps P1A, P1B	4.16kV EAC, EDG, 125VDC,SSPS	LLOCA

Table 1 (Continued)

Affected Systems	Major Components	Support Systems	Initiating Event Scenarios
Recirculation Spray (RS)	Pumps P1A, P1B, P1C, P1D	4.16KV EAC, EDG, 125 VDC, SSPS	All including RCP Seal LOCA
	Hx E1A, E1B, E1C, E1D	River Water Header A, B	
RPCCW	Pump 1A(normally running), Pump 1B(Auto backup), Pump 1C (manual Backup)	Offsite grid, 4.16 kV EAC, 125VDC, IA, River Water Header, Vital Bus Channel I &II, CIA, SIA ⁽³⁾	RCP Seal LOCA, SGTR
TPCCW	Pump CCP-3A (normally running), Pump-3B (auto backup)	4.16 kV EAC, EDG, 125VDC	Transient, SLOCA, SORV, LOOP
	Pump WR-P-6A (normally running), Pump WR–6B (auto backup) Pump WR-P-12A (normally running), Pump WR-P-12B (auto backup)	4.16kV EAC, EDG, 125VDC	
Emergency AC (EAC)	4.16kV/480V AC Train A,B	Offsite grid, EDG	All
Emergency Diesel Generator (EDG)	EDG 1-1, 1-2	125 VDC, River Water Header, Vent. System, SSPS	LOOP
	ERF DG (Black)	Offsite grid, Vent. System	LOOP
125 V DC	Trains A, B; Batteries	4.16kV EAC, EDG, Vent. System	All

Affected Systems	Major Components	Support Systems	Initiating Event Scenarios
Solid State Protection System (SSPS)	Trains A, B	Vital Bus Channel I, II, II, IV; Vent. System	All
River Water Header	Headers A,B	Offsite grid, 4.16 kV EAC, EDG, 125 VDC, SSPS, Vent. System	All
Ventilation System		Offsite grid, 4.16kV EAC, EDG, RPCCW, Chilled Water	All
Containment Instrument Air (CIA)		Offsite grid, 4.16 kV EAC, EDG, Chilled water, SIA	All except LLOCA and MLOCA
Station Instrument Air (SIA)		Offsite grid, ERF EDG (Black), TPCCW, Normal 125V DC Supply Battery 1-5	Transient, SLOCA, LOOP, RCP Seal LOCA,
Chilled Water System		Offsite grid, Normal 125V DC Supply Battery 1-5	All

Notes:

- (1) the dedicated feed pump (FW-P-4) is powered off the 4160V DC ERF Substation bus 1H. The bus is normally supplied from the offsite grid. During a LOOP, the ERF (black) Diesel Generator supplies power to bus 1H.
- (2) HHSI consists of two trains. HHSI pump P1C can be manually aligned to either train of electric power, but cannot be racked in unless the other charging pump is racked out from the same bus.
- (3) The loss of CIA and SIA causes air-operated isolation valves for the RCP thermal barriers, motor, and bearings to fail closed. RCP seal cooling must then be provided by seal injection and the RCPs must be stopped.

The plant internal event CDF (including internal flood) is 2.1E-4/yr.

1.2 SDP WORKSHEETS

This section presents the SDP worksheets to be used in the Phase 2 evaluation of the inspection findings for the Beaver Valley Unit 1 Nuclear Plant. The SDP worksheets are presented for the following initiating event categories:

- 1. Transients
- 2. Small LOCA
- 3. Stuck-open PORV
- 4. Medium LOCA
- 5. Large LOCA
- 6. LOOP
- 7. Steam Generator Tube Rupture (SGTR)
- 8. Anticipated Transients Without Scram (ATWS)

Table 2.1 SDP Worksheet for Beaver Valley 1 — Transients

Estimated Frequency (Table 1 Row)	Exposu	re Time Table 1 Result (circle): A B C D E F G H		
Safety Functions Needed:	Full Creditable	Mitigation Capability for Each Safety Function:		
Power Conversion System (PCS) Secondary Heat Removal (AFW) Early Inv., High Pressure Injection (EIHP) Primary Heat Removal, Feed/Bleed (FB) High Pressure Recirculation (HPR) Recirculation Spray (RS)	 1 / 2 Main Feedwater (MFW) trains or dedicated feed pump (DFP) and 1/2 Condensate pump trains (operator action) 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 ASD train)⁽¹⁾ 1 / 3 Charging pumps (1 multi-train system). 1 / 3 PORVs and block valves open for Feed/Bleed (operator action)⁽²⁾ 1 / 3 charging pumps with 1/2 LHSI or 1/2 RS (2A or 2B) pumps(Operator action) 1 / 2 Inside RS (1A or 1B) pumps or 1/2 Outside RS (2A or 2B) pumps (2 multi-train systems) 			
Circle Affected Functions	<u>Recovery of</u> Failed Train	Remaining Mitigation Capability Rating for Each Affected Sequence	<u>Sequence</u> <u>Color</u>	
1 TRANS - AFW - PCS - RS (4)				
2 TRANS - AFW - PCS - HPR (5)				
3 TRANS - AFW - PCS - FB (6)				
4 TRANS - AFW - PCS - EIHP (7)				
Identify any operator recovery actions that are	e credited to dire	ctly restore the degraded equipment or initiating event:		

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

- (1) The value assessed by the IPE (Table 3.3.2-2, page 3.3-39) for the AFW TDP failure to start is 2.1E-2. For the SDP calculation, a value of 1E-1 can be used.
- (2) The human error probability (HEP) assessed in the IPE (page 3.3-117) for establishing bleed and feed cooling is 1.39E-2 (Operator failure to to initiate feed and bleed after failure to restore MFW and the dedicated feed pump).

Table 2.2 SDP Worksheet for Beaver Valley Unit 1 — Small LOCA

Estimated Frequency (Table 1 Row)	Exposure 7	Time Table 1 Result (circle): A B C D E F G H		
Safety Functions Needed: Early Inventory, HP Injection (EIHP) Secondary Heat Removal (AFW) Main Feedwater or Dedicated FWP (FW) RCS Cooldown/ Depressurization (RCSDEP) Primary Bleed (FB) Low Pressure Recirculation (LPR) High Pressure Recirculation (HPR) Recirculation Spray (RS)	Full Creditable Mitigation Capability for Each Safety Function:1 / 3 charging pumps (1 multi-train system).1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 ASD train)Operator initiated 1/ 2 main feed pump or dedicated FP (Operator action)Operator depressurizes RCS using 1 / 3 PORVs and block valves (operator action)1 / 3 PORVs and block valves open for Feed/Bleed (operator action)1 / 2 LHSI trains (Operator action)1 / 3 charging pumps with 1 / 2 LHSI pumps or 1/ 2 RS (2A or 2B) pumps (Operator action)1 / 2 inside RS (1A or 1B) pumps or 1/ 2 Outside RS (2A or 2B) pumps (2 multi-train systems)			
Circle Affected Functions	<u>Recovery of</u> Failed Train	Remaining Mitigation Capability Rating for Each Affected Sequence	<u>Sequence</u> <u>Color</u>	
1 SLOCA - RS (2, 5, 8, 11, 14)				
2 SLOCA - LPR (3, 9)				
3 SLOCA - RCSDEP - HPR (6, 12)				
4 SLOCA - AFW - FW- HPR (15)				
5 SLOCA - AFW - FW - FB (16)				
6 SLOCA - EIHP (17)				
Identify any operator recovery actions that are cr	edited to directly	restore the degraded equipment or initiating event:		

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

(1) The human error probability (HEP) assessed in the IPE (page 3-129) for establishing bleed and feed cooling is 1.39E-2.

Table 2.3 SDP Worksheet for Beaver Valley Unit 1 —— Stuck Open PORV (SORV)

Estimated Frequency (Table 1 Row)	Exposure 1	Time Table 1 Result (circle): A B C D E F G H		
Safety Functions Needed: Early Inventory, HP Injection (EIHP) Isolation of Small LOCA (BLK) Secondary Heat Removal (AFW) RCS Cooldown/ Depressurization (RCSDEP) Primary Bleed (FB) Low Pressure Recirculation (LPR) High Pressure Recirculation (HPR) Recirculation Spray (RS)	<i>Full</i> Creditable Mitigation Capability for Each Safety Function: 1 / 3 charging pumps (1 multi-train system). The closure of the block valve associated with stuck open PORV (recovery action) 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 ASD train) Operator depressurizes RCS using 1 / 3 PORVs and block valves (operator action) 1 / 3 PORVs and block valves open for Feed/Bleed (operator action ⁽¹⁾ 1 / 2 LHSI pumps (Operator action) 1 / 3 charging pumps with 1 / 2 LHSI pumps or 1/ 2 RSS pumps (Operator action) 1 / 2 inside RS pumps or 1/ 2 outside RS pumps (2 multi-train systems)			
Circle Affected Functions	<u>Recovery of</u> Failed Train	Remaining Mitigation Capability Rating for Each Affected Sequence	<u>Sequence</u> <u>Color</u>	
1 SORV - BLK - RS (2, 5, 8, 11, 14)				
2 SORV - BLK - LPR (3, 9)				
3 SORV - BLK - RCSDEP - HPR (6, 12)				
4 SORV - BLK - AFW - FW - HPR (15)				
5 SORV - BLK - AFW - FW - FB (16)				
6 SORV - BLK - EIHP (17)				
Identify any operator recovery actions that are cro	edited to directly	restore the degraded equipment or initiating event:		

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

(1) The human error probability (HEP) assessed in the IPE (page 3-129) for establishing bleed and feed cooling is 1.39E-2

Table 2.4 SDP Worksheet for Beaver Valley Unit 1 — Medium LOCA

Estimated Frequency (Table 1 Row)	Exp	oosure Time Table 1 Result (circle): A B C D E	Result (circle): A B C D E F G H	
Safety Functions Needed: Early Inventory, Accumulators (EIAC) Early Inventory, HP Injection (EIHP) Low Pressure Injection (LPI) ⁽¹⁾ Low Pressure Recirculation (LPR) RWST Makeup (RWST) ⁽²⁾ Recirculation Spray (RS)	Full Creditable Mitigation Capability for Each Safety Function:2/ 3 accumulators (1 multi-train system)1/ 3 charging pumps (1 multi-train system).1/ 2 LHSI pumps (1 multi-train system)1 / 2 LHSI pumps or 1/ 2 RS (2A or 2B) pumps aligned for recirculation (operator action)Operator provides makeup for HHSI pumps (Operator action)1/ 2 inside RS (1A or 1B) pumps or 1/ 2 outside RS (2A or 2B) pumps in spray mode (2 multi-train system)			
Circle Affected Functions	<u>Recovery</u> <u>of</u> <u>Failed</u> <u>Train</u>	<u>Remaining Mitigation Capability Rating for Each Affected</u> <u>Sequence</u>	<u>Sequence</u> <u>Color</u>	
1 MLOCA - RS (2)				
2 MLOCA - LPR - RWST (4)				
3. MLOCA - LPI (5)				
4. MLOCA - EIHP (6)				
5. MLOCA - EIAC (7)				
Identify any operator recovery actions that	are credited to	directly restore the degraded equipment or initiating event:		

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

- (1) As per the IPE, both HHSI and LHSI are required for success to cover the full range of medium LOCAs.
- (2) RWST makeup actions are called for by procedure when RWST level is low and cold leg recirculation is unavailable.

Table 2.5 SDP Worksheet for Beaver Valley Unit 1 — Large LOCA

Estimated Frequency (Table 1 Row)	Expos	ure Time Table 1 Result (circle): A B C D E F G H		
Safety Functions Needed: Early Inventory, Accumulators (EIAC) Early Inventory, LP Injection (EILP) Quench Spray (QS) ⁽¹⁾ Recirculation Spray (RS) Outside recirculation spray (ORS) Low Pressure Recirculation (LPR)	<i>Full</i> Creditable Mitigation Capability for Each Safety Function: 2/ 2 Accumulators (1 Train) 1/2 LHSI pump trains (1 multi-train system) 1/ 2 QS pumps drawing from RWST (1 multi-train system) 1/ 2 inside RS pumps (1 multi-train system) 1/ 2 outside RS pumps (1 multi-train system) 1/2 LHSI pump trains; Operator switchover from injection to recirculation (operator action)			
Circle Affected Functions	<u>Recovery of</u> <u>Failed Train</u>	Remaining Mitigation Capability Rating for Each Affected Sequence	<u>Sequence</u> <u>Color</u>	
1 LLOCA - LPR (2)				
2 LLOCA - RS (3)				
3 LLOCA - QS - ORS (6)				
4 LLOCA - LHSI (7)				
5 LLOCA - EIAC (8)				
Identify any operator recovery actions that a	re credited to dire	ectly restore the degraded equipment or initiating event:		

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

(1) A high containment pressure (8 psig) signal initiates both QS pumps. Successful operation of a QS pump is needed to fill the containment sump for required NPSH for inside RS pumps.

Table 2.6 SDP Worksheet for Beaver Valley Unit 1 — LOOP

Estimated Frequency (Table 1 Row)	Exposi	ure Time Table 1 Result (circle): A B C D E F G H		
Safety Functions Needed: Emergency AC Power (EAC) Turbine-driven AFW pump (TDAFW) Secondary Heat Removal (AFW) Recovery of AC Power in < 2 hrs (REC2) Recovery of AC Power in < 5 hrs (REC5) Early Inventory, HP Injection (EIHP) Primary Heat Removal (FB) High Pressure Recirculation (HPR) Recirculation Spray (RS)	Full Creditable Mitigation Capability for Each Safety Function: 1 / 2 Emergency Diesel Generators (1 multi-train system) 1 / 1 TDP trains of AFW (1 ASD train) ⁽¹⁾ 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 diverse train) ⁽¹⁾ or dedicated feed pump (operator action) SBO procedures implemented (operator action under high stress) ⁽²⁾ SBO procedures implemented (operator action) ^(2, 3) 1 / 3 charging pumps (1 multi-train system) Operator uses RCS pressurizer 1 / 3 PORVs and block valves (operator action) ⁽⁴⁾ 1 / 3 charging pumps with 1/2 LHSI pumps or 1/2 RS (2A or 2B) pumps (operator action) 1/2 inside RS (1A or 1B)pumps or 1/2 outside RS (2A or 2B) pumps (2 multi-train system)			
Circle Affected Functions	<u>Recovery of</u> Failed Train	Remaining Mitigation Capability Rating for Each Affected Sequence	<u>Sequence</u> <u>Color</u>	
1 LOOP - AFW - RS (3)				
2 LOOP - AFW - HPR (4)				
3 LOOP - AFW - FB (5)				
4 LOOP - AFW - EIHP (6)				
5 LOOP - EAC - RS (8,13)				
6 LOOP - EAC - HPR (9,14)				
7 LOOP - EAC - EIHP (10,16)				
8 LOOP - EAC - REC5 (11)				
9 LOOP - EAC - TDAFW - FB (15)				
10 LOOP - EAC - TDAFW - REC2 (17)				
Identify any operator recovery actions that ar	e credited to dire	ectly restore the degraded equipment or initiating event:		

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

- (1) The failure probability of AFW TDP used in the IPE is 2.1E-2.
- (3) In IPE, Recovery of AC with AFW, PORV LOCA is assigned a failure probability of 0.14, and Recovery of AC with AFW, No LOCA is assigned a failure probability of 2.1E-2.
- (4) In an SBO situation, an RCP seal LOCA may occur, with subsequent core damage at about 5 hours.
- (5) The human error probability (HEP) assessed in the IPE (page 3-129) for establishing bleed and feed cooling is 1.39E-2.

Table 2.7 SDP Worksheet for Beaver Valley Unit 1 — SGTR

Estimated Frequency (Table 1 Row)	Exposi	ure Time Table 1 Result (circle): A B C D E F G H		
Safety Functions Needed:	Full Creditable Mitigation Capability for Each Safety Function:			
Secondary Heat Removal (SHR) Early Inventory, HP Injection (EIHP) Pressure Equalization (EQ)	1 / 2 MDPs of AFW (1 multi-train system) or 1 / 1 TDP of AFW (1 ASD Train) 1 / 3 charging pumps (1 multi-train system) Operator isolates the ruptured SG and depressurizes RCS using 1 / 1 SG ARV (on each SG fed by AFW) or RCS pressurizer PORV (1 / 3) to less than setpoint of relief valves of SG (operator action under high stress) ⁽¹⁾			
Feed-and-Bleed (FB) Late depressurization and RWST makeup (RWST)	Operator uses RCS pressurizer PORV and block valves (1 / 3) (operator action) ⁽²⁾ Operator depressurizes RCS and provides makeup to RWST for HHSI pumps (Operator action)			
High Pressure Recirculation (HPR) Residual Heat Removal (RHR)	1 / 3 charging pumps with 1/ 2 LHSI pumps or 1/ 2 RS (2A or 2B) pumps for recirculation (operator action) Operator initiates 1/ 2 RHR pumps (Operator action)			
Recirculation Spray (RS)	1/2 inside RS (1A or 1B) pumps or 1/2 outside RS (2A or 2B) pumps (2 multi-train system)			
Circle Affected Functions	<u>Recovery of</u> Failed Train	Remaining Mitigation Capability Rating for Each Affected Sequence	<u>Sequence</u> <u>Color</u>	
1 SGTR - EQ - RHR (3)				
2 SGTR - EQ - RWST (4)				
3 SGTR - SHR - RS (6)				
4 SGTR - SHR - HPR (7)				
5 SGTR - SHR - EQ (8)				
6 SGTR - SHR - FB (9)				
7 SGTR - EIHP - RHR (11)				
8 SGTR - EIHP - EQ (12)				
9 SGTR - EIHP - SHR (13)				

Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

- (1) In IPE, the operator failure to depressurize RCS for RHR entry is assigned a probability of 1.6E-3, and the operator failure to isolate ruptured SG and equalize pressure is assigned a probability of 3.4E-3.
- (2) The human error probability (HEP) assessed in the IPE (page 3-129) for establishing bleed and feed cooling is 1.39E-2.

Table 2.8 SDP Worksheet for Beaver Valley Unit 1 ATWS


Estimated Frequency (Table 1 Row)		Exposure Time	Table 1 Result (circle): A	BCDE	FGH
Safety Functions Needed: Emergency Boration (HPI) Turbine trip (TTP) Primary Relief (SRV) Secondary Heat Removal (AFW)	Full Creditable Mitigation Capability for Each Safety Function: Operator conducts emergency boration using 1 / 3 charging pumps (operator action) AMSAC trips the turbine (1 train) 3 / 3 SRVs with 3/3 PORVs open (1 train) 2 / 2 MDPs of AFW (1 train) or 1 / 1 TDP of AFW (1 ASD Train)				
Circle Affected Functions	<u>Recovery of</u> Failed Train	Remaining Mitigation Capabilit	y Rating for Each Affected	<u>Sequence</u>	<u>Sequence</u> <u>Color</u>
1 ATWS - HPI (2)					
2 ATWS - SRV (3)					
3 ATWS - AFW (4)					
4 ATWS - TTP (5)					
Identify any operator recovery action	ns that are credit	ed to directly restore the degraded	equipment or initiating even	t:	
If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.					


1.3 SDP Event Trees


This section provides the simplified event trees called SDP event trees used to define the accident sequences identified in the SDP worksheets in the previous section. An event tree for the stuck-open PORV is not included since it is similar to the small LOCA event tree. The event tree headings are defined in the corresponding SDP worksheets.


The following event trees are included:


- 1. Transients
- 2. Small LOCA
- 3. Medium LOCA
- 4. Large LOCA
- 5. LOOP
- 6. Steam Generator Tube Rupture (SGTR)
- 7. Anticipated Transients Without Scram (ATWS)

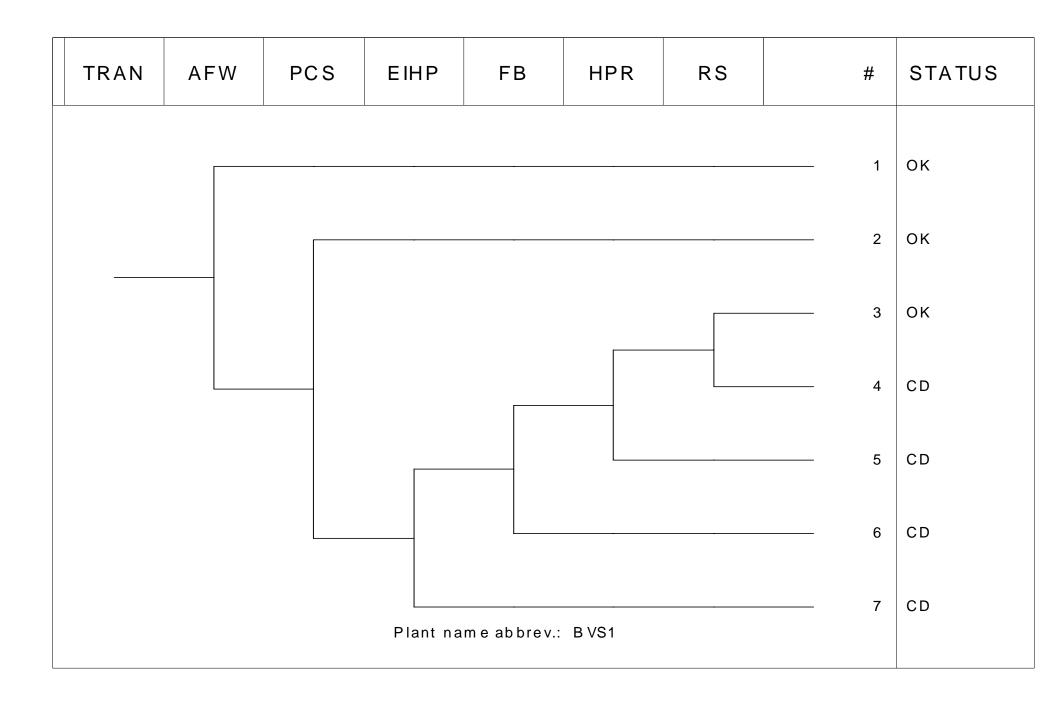


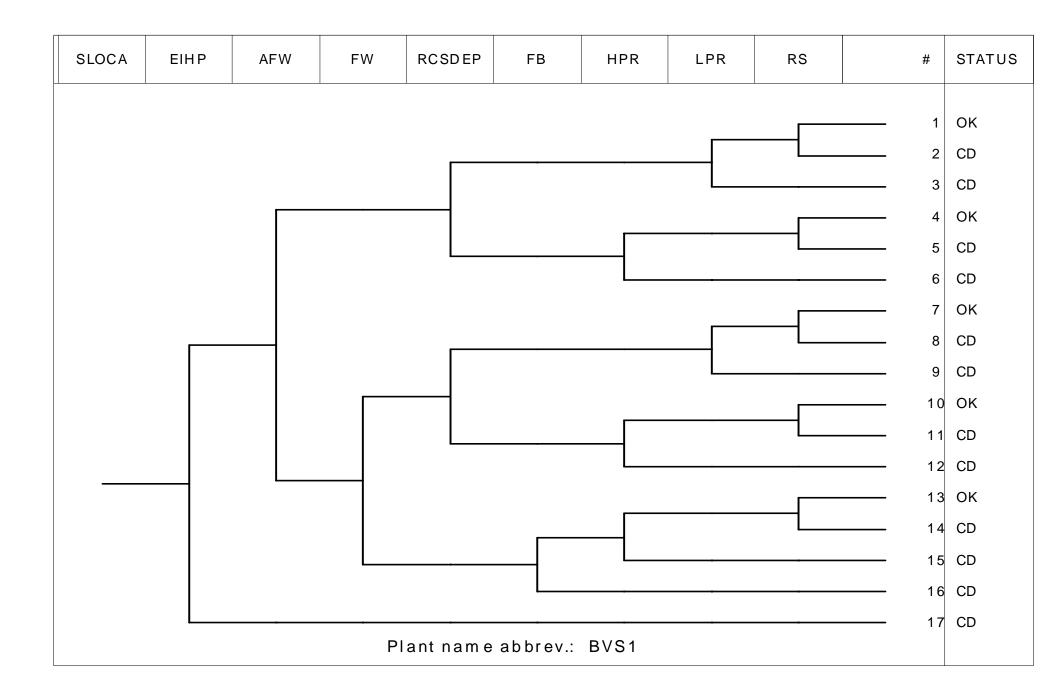


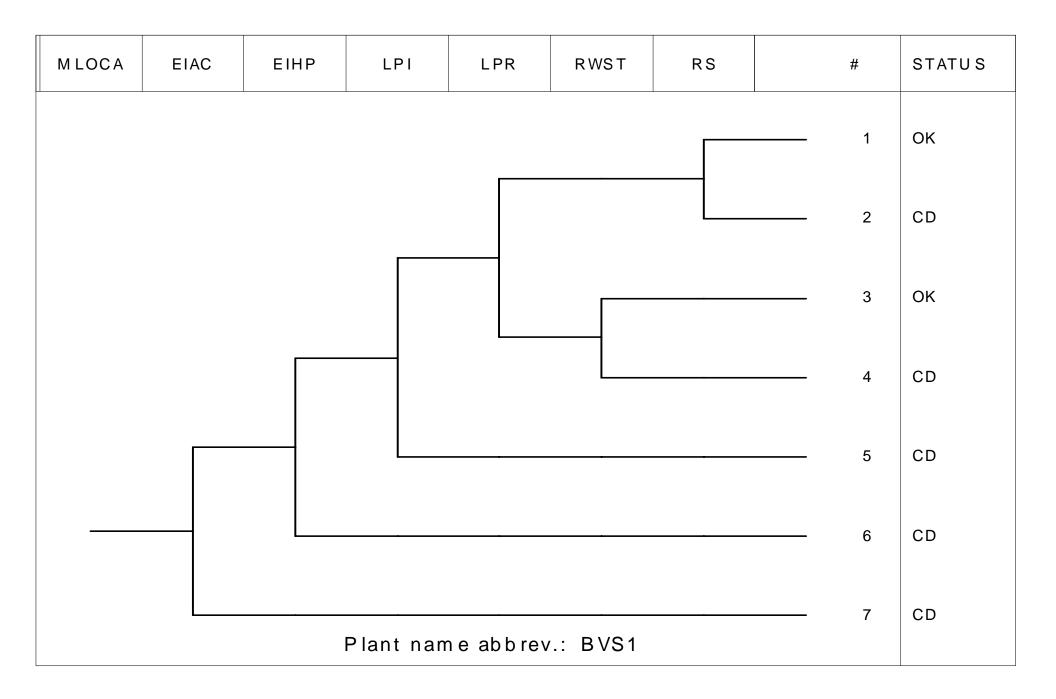

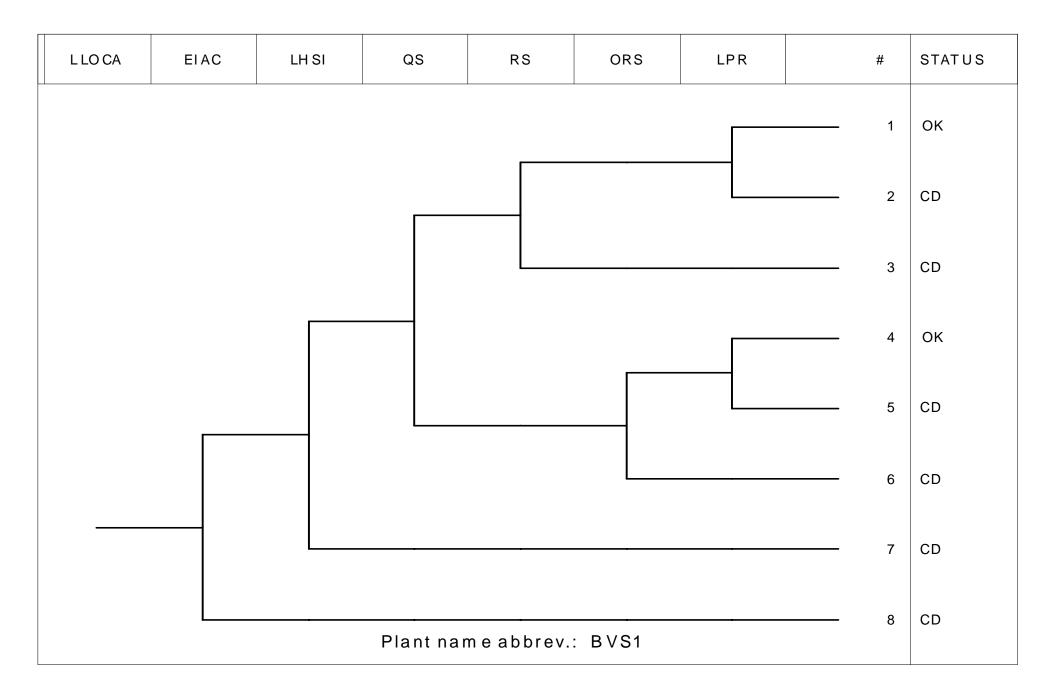

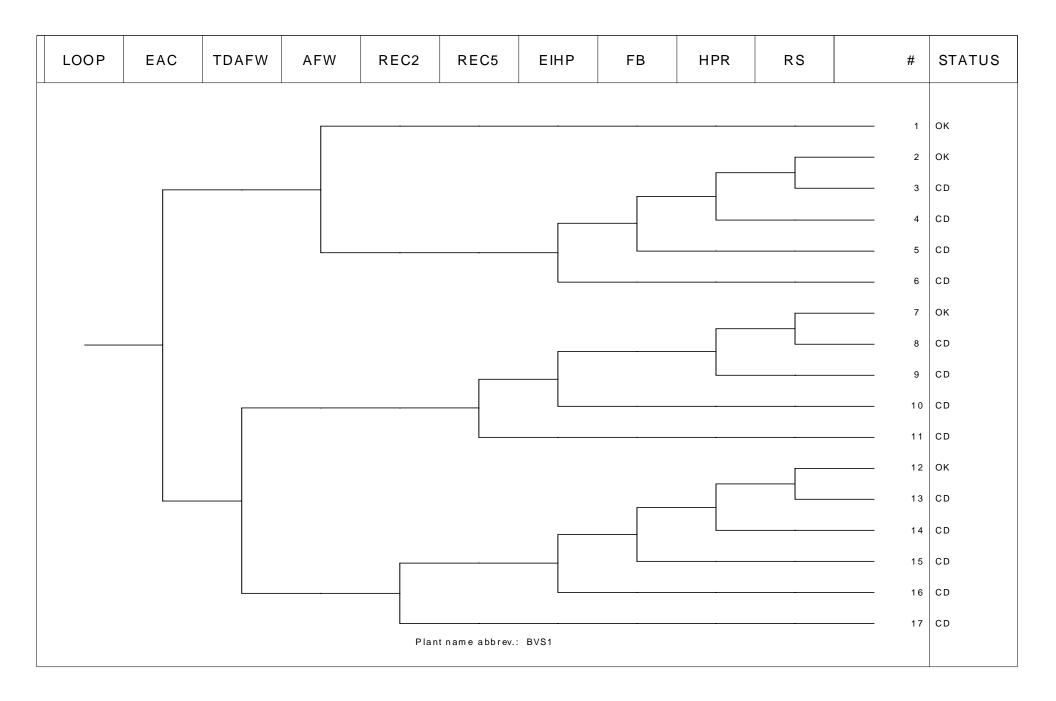

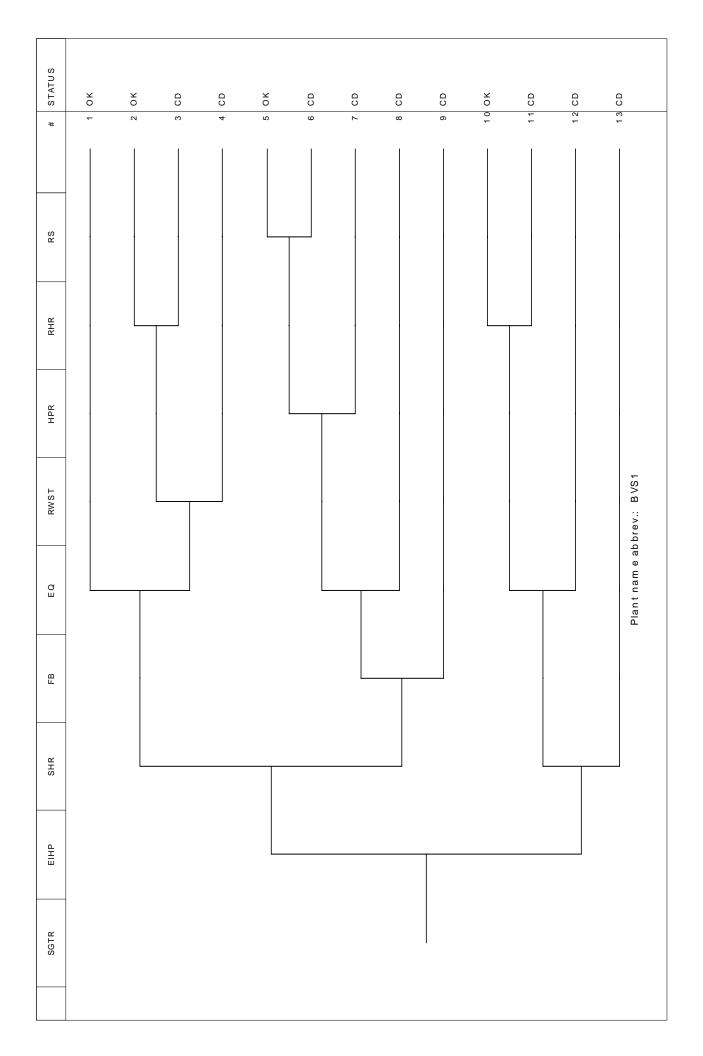

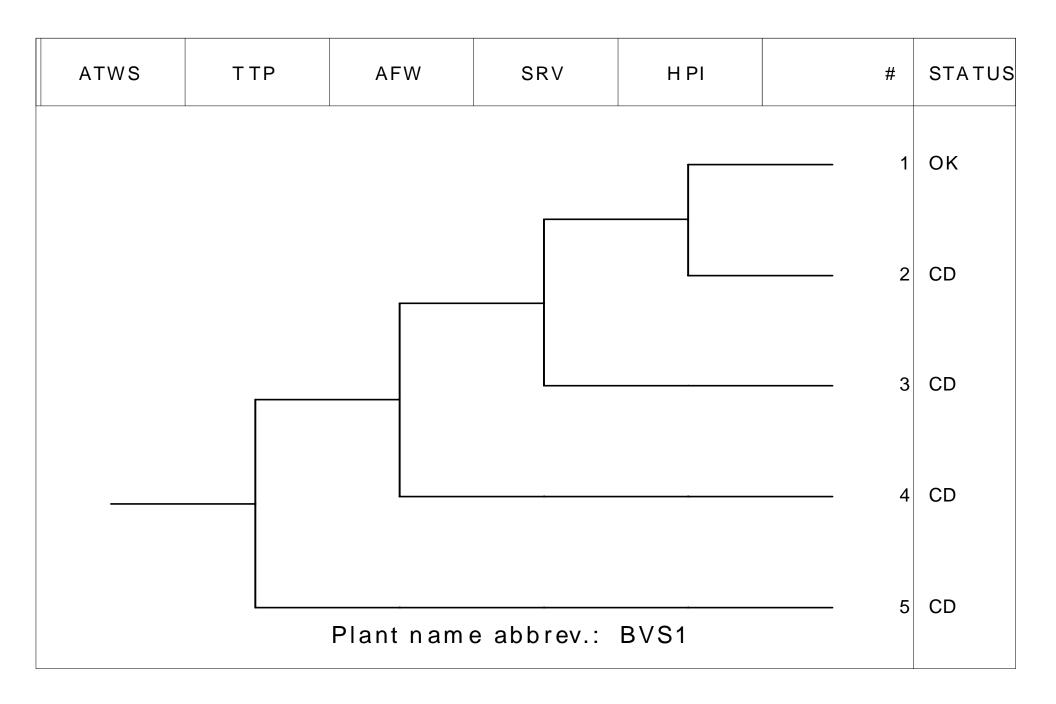

2. RESOLUTION AND DISPOSITION OF COMMENTS

This section documents the comments received on the material included in this report and their resolution. This section is blank until comments are received and are addressed.

REFERENCES

- 1. NRC SECY-99-007A, Recommendations for Reactor Oversight Process Improvements (Follow-up to SECY-99-007), March 22, 1999.
- 2. Dusquesne Light Company, "Beaver Valley Power Station, Unit 1 Probabilistic Risk Assessment Individual Plant Examination Report," October 1, 1992.

RISK-INFORMED INSPECTION NOTEBOOK FOR

BEAVER VALLEY UNIT 2

PWR, WESTINGHOUSE, THREE-LOOP PLANT WITH SUB-ATMOSPHERIC CONTAINMENT

Prepared by

Brookhaven National Laboratory Department of Advanced Technology

Contributors

M. A. Azarm J. Carbonaro T. L. Chu A. Fresco J. Higgins G. Martinez-Guridi P. K. Samanta

NRC Technical Review Team

John Flack	RES
Morris Branch	NRR
Doug Coe	NRR
Gareth Parry	NRR
Peter Wilson	NRR
Jim Trapp	Region I
Michael Parker	Region III
William B. Jones	Region IV

Prepared for

U. S. Nuclear Regulatory Commission Office of Nuclear Regulatory Research Division of Risk Analysis & Applications

NOTICE

This notebook was developed for the NRC's inspection teams to support risk-informed inspections. The activities involved in these inspections are discussed in "Reactor Oversight Process Improvement," SECY-99-007A, March 1999. The user of this notebook is assumed to be an inspector with an extensive understanding of plant-specific design features and operation. Therefore, the notebook is not a stand-alone document, and may not be suitable for use by non-specialists. This notebook will be periodically updated with new or replacement pages incorporating additional information on this plant. Technical errors in, and recommended updates to, this document should be brought to the attention of the following person:

Mr. Jose G. Ibarra U. S. Nuclear Regulatory Commission M/S TWFN T4 A9 11545 Rockville Pike Rockville, MD 20852

ABSTRACT

This notebook contains summary information to support the Significance Determination Process (SDP) in risk-informed inspections for the Beaver Valley Power Station Unit 2.

SDP worksheets support the significance determination process in risk-informed inspections and are intended to be used by the NRC's inspectors in identifying the significance of their findings, i.e., in screening risk-significant findings, consistent with Phase-2 screening in SECY-99-007A. To support the SDP, additional information is given in an Initiators and System Dependency table, and as simplified event-trees, called SDP event-trees, developed in preparing the SDP worksheets.

The information contained herein is based on the licensee's IPE submittal. The information is revised based on IPE updates or other licensee or review comments providing updated information and/or additional details.

CONTENTS

	Page
Notice	
Abstract	ii
 Information Supporting Significance Determination Process (SDP) 1.1 Initiators and System Dependency 	
1.2 SDP Worksheets 1.3 SDP Event Trees	7
2. Resolution and Disposition of Comments	
References	33

FIGURES

Page

SDP Event Tree — Transients	25
SDP Event Tree — Small LOCA	26
SDP Event Tree — Medium LOCA	27
SDP Event Tree — Large LOCA	28
SDP Event Tree — LOOP	29
SDP Event Tree — Steam Generator Tube Rupture (SGTR)	30
SDP Event Tree — Anticipated Transients Without Scram (ATWS)	31

TABLES

Page

Initiators and System Dependency for Beaver Valley Unit 2	4
SDP Worksheet — Transients	8
SDP Worksheet — Small LOCA	10
SDP Worksheet — Stuck-open PORV	12
SDP Worksheet — Medium LOCA	14
SDP Worksheet — Large LOCA	16
SDP Worksheet — LOOP	18
SDP Worksheet — Steam Generator Tube Rupture (SGTR)	20
SDP Worksheet — Anticipated Transients Without Scram (ATWS)	22
	SDP Worksheet — Transients SDP Worksheet — Small LOCA SDP Worksheet — Stuck-open PORV SDP Worksheet — Medium LOCA SDP Worksheet — Large LOCA SDP Worksheet — Large LOCA SDP Worksheet — LoOP SDP Worksheet — Steam Generator Tube Rupture (SGTR)

1. INFORMATION SUPPORTING SIGNIFICANCE DETERMINATION PROCESS (SDP)

SECY-99-007A (NRC, March 1999) describes the process for making a Phase-2 evaluation of the inspection findings. In Phase 2, the first step is to identify the pertinent core damage scenarios that require further evaluation based on the specifics of the inspection findings. To aid in this process, this notebook provides the following information:

- 1. Initiator and System Dependency Table
- 2. Significance Determination Process (SDP) Worksheets
- 3. SDP Event Trees

The initiator and system dependency table shows the major dependencies between front-line- and support-systems, and identifies their involvement in different types of initiators. The information in this table identifies the most risk-significant front-line- and support-systems; it is not an exhaustive nor comprehensive compilation of the dependency matrix as known in Probabilistic Risk Assessments (PRAs). This table is used to identify the SDP worksheets to be evaluated, corresponding to the inspection's findings on systems and components.

To evaluate the impact of the inspection's finding on the core-damage scenarios, the SDP worksheets are developed and provided. They contain two parts. The first part identifies the functions, the systems, or combinations thereof that can perform mitigating functions, the number of trains in each system, and the number of trains required (success criteria) for each class of initiators. The second part of the SDP worksheet contains the core-damage accident sequences associated with each initiator class; these sequences are based on SDP event trees. In the parenthesis next to each of the sequence the corresponding event tree branch number(s) representing the sequence is included. Multiple branch numbers indicate that the different accident sequences identified by the event tree are merged into one through the boolean reduction. The classes of initiators that are considered in this notebook are 1) Transients, 2) Small Loss of Coolant Accident (LOCA), 3) Medium LOCA, 4) Large LOCA, 5) Loss of Offsite Power (LOOP), and 6) Anticipated Transients Without Scram (ATWS). Main Steam Line Break (MSLB) events are included separately if they are treated as such in the licensee's Individual Plant Examination (IPE) submittal.

Following the SDP worksheets, the SDP event trees corresponding to each of the worksheets are presented. The SDP event trees are simplified event trees developed to define the accident sequences identified in the SDP worksheets.

The following items were considered in establishing the SDP event trees and the core-damage sequences in the SDP worksheets:

1. Event trees and sequences were developed such that the worksheet contains all the major accident sequences identified by the plant-specific IPEs. In cases where a plant-specific feature introduced a sequence that is not fully captured by our existing set of initiators and event trees, then a separate worksheet is included.

- 2. The event trees and sequences for each plant took into account the IPE models and event trees for all similar plants. Any major deviations in one plant from similar plants typically are noted at the end of the worksheet.
- 3. The event trees and the sequences were designed to capture core-damage scenarios, without including containment-failure probabilities and consequences. Therefore, branches of event trees that are only for the purpose of a Level II PRA analysis are not considered. The resulting sequences are merged using Boolean logic.
- 4. The simplified event-trees focus on classes of initiators, as defined above. In so doing, many separate event trees in the IPEs often are represented by a single tree. For example, some IPEs define four classes of LOCAs rather than the three classes considered here. The sizes of LOCAs for which high-pressure injection is not required are some times divided into two classes, the only difference between them being the need for reactor scram in the smaller break size. Some IPEs also may define several classes of transients, depending on the initiator's impact on the systems. Such differentiations generally are not considered in the SDP worksheets unless they could not be accounted for by the Initiator and System Dependency table.
- 5. Major operator actions during accident scenarios are assigned as high stress operator action or operator action using simple, standard criteria among a class of plants. This approach resulted in the designation of some operator actions as high-stress ones (as opposed to normal), even though the PRA may have assumed a (routine) operator action; hence, they have been assigned an error probability less than 5E-2 in the IPE. In such cases, a note is given at the end of the worksheet.

The three sections that follow include the initiators and dependency table, SDP worksheets, and the SDP event-trees for the Beaver Valley Unit 2 Plant.

1.1 INITIATORS AND SYSTEM DEPENDENCY

Table 1 provides the list of the systems included in the SDP worksheets, the major components in the systems, and the support system dependencies. The system involvements in different initiating events are noted in the last column.

Table 1 (Continued)

Table 1. Initiators and System Dependency for Beaver Valley Unit 2

Affected Systems	Major Components	Support Systems	Initiating Event Scenarios	
Reactor Coolant Pumps (RCPs)	Pumps 21A, 21B, 21C	PCCW, Offsite grid, IA/CIA	LOOP, Transient, RCP seal LOCA	
PORVs	PORV 455C&D, 456 Block Valves 535,536,537	125 V-DC, 480 V-AC (Block Valves), SSPS, Vital Bus Channel I, II, III, & IV	All except LLOCA, and MLOCA	
Main and Startup Feed Pump (MFW and SUP ⁽¹⁾)	MFW Pumps P21A, P21B, SU Pump P24 ⁽¹⁾	Offsite grid, DC Battery 1-5, SSPS, Secondary CCW, Normal 125 VDC Supply, Batteries 2-5,2-6, ERF DG (SUP-P24)	Transient. SLOCA. SORV.LOOP	
Condensate Pump		Offsite grid, Normal 125 V-DC Supply Battery 1-5, Secondary CCW	Transient, SLOCA, SORV, LOOP	
MSIVs		125 V-DC, IA/CIA, SSPS		
AFWs	2 MDPs	4.16 KV EAC, EDG, 125 V-DC, SW Header B (backup water supply)	All except MLOCA and LLOCA	
	1 TDP	125 V-DC,SSPS, SW Header B (backup water supply)		
RHR	Pumps P21A, P21B	4.16 kV EAC, EDG, 125VDC, PCCW, SSPS	SGTR	
HHSI ⁽²⁾	Pumps P21A, P21B, P21C ⁽²⁾	Offsite grid, 4.16 kV EAC, EDG, 125 V-DC, SSPS, SW	All except LLOCA, RCP Seal LOCA	
LHSI	Pumps P21A, P21B	4.16 kV EAC, EDG, 125 V-DC, SSPS	All including RCP Seal	
	MOVs	4.16 kV EAC, EDG	LOCA	
Crosstie Valves (ECCS Cold Leg Recirculation)	Train A and B	4.16 kV EAC, EDG, SSPS	All including RCP Seal LOCA	

Affected Systems	Major Components	Support Systems	Initiating Event Scenarios
RWST Level	LT 104 A, B, C, D	Vital Bus I, II, III, IV; SSPS	MLOCA, SGTR
Quench Spray (QS)	Pumps P21A, P21B	4.16 kV EAC, EDG, 125 V-DC,SSPS	LLOCA
Recirculation Spray (RS)	Pumps P21A, P21B, P21C, P21D	4.16 KV EAC, EDG, 125 V-DC, SSPS	All including RCP Seal LOCA
	Hx E1A, E1B, E1C, E1D	SW	
PCCW	Pump 1A (normally running), Pump 1B(Auto backup), Pump 1C (manual Backup)	Offsite grid, 4.16 kV EAC, 125 V-DC, SW, Vital Bus Channel I &II, IA/CIA ⁽³⁾	RCP Seal LOCA, SGTR
Emergency AC (EAC)	4.16 kV / 480 V-AC Train A,B	Offsite grid, EDG	All
Emergency Diesel Generator (EDG)	EDG 2-1, 2-2	125 V-DC, SW, Vent. System, SSPS	LOOP
	ERF DG (Black)	Offsite grid, Normal DC Supply Batteries 2-5 and 2-6, Vent. System	LOOP
125 V DC	Trains A, B; Batteries	4.16 kV EAC, EDG, Vent. System	All
Solid State Protection System (SSPS)	Trains A, B	Vital Bus Channel I, II; Vent. System	All
Service Water (SW)	Headers A,B	Offsite grid, 4.16 kV EAC, EDG, 125 V-DC, SSPS, Vital Bus I&II, Vent. System	All
Ventilation System		4.16 kV EAC, EDG, PCCW, Vital Bus I &II	All
Instrument Air / Containment Instrument Air (IA/CIA)		Offsite grid, Vital Bus I&II, SSPS, PCCW, SCCW	All except LLOCA and MLOCA

Table 1 (Continued)

Affected Systems	Major Components	Support Systems	Initiating Event Scenarios
Secondary CCW (SCCW)	Pump 2CCS-P21A normally running, Pump 2CCS-P21B for auto backup	Offsite grid, Vital Bus I &II, SSPS, SW, Normal DC Supply Batteries 2-5 and 2-6	Transient, SLOCA, SORV, LOOP, RCP Seal LOCA,
Chilled Water System		Offsite grid, SW, Normal DC Battery Supplies 2-5 and 2-6	All

Notes:

- (1) the Startup feed pump (SUP-P4) is powered off the Unit 1 4160V Bus 1G. The bus 1G power is backed up by the ERF (black) Diesel Generator, but the control logic prevents startup feed pump from operating unless supplied from offsite power.
- (2) HHSI consists of two trains. HHSI pump P1C can be manually aligned to either train of electric power and the associated train of SW, but is not normally aligned to either train. It receives start signal from the train aligned to it.
- (3) The loss of CIA and SIA causes air-operated isolation valves for the RCP thermal barriers, motor, and bearings to fail closed. RCP seal cooling must then be provided by seal injection from normal charging and the RCPs must be tripped.

The plant internal event CDF (including internal flood) is 1.9E-4/yr.

1.2 SDP WORKSHEETS

This section presents the SDP worksheets to be used in the Phase 2 evaluation of the inspection findings for the Beaver Valley Unit 2 Nuclear Plant. The SDP worksheets are presented for the following initiating event categories:

- 1. Transients
- 2. Small LOCA
- 3. Stuck-open PORV
- 4. Medium LOCA
- 5. Large LOCA
- 6. LOOP
- 7. Steam Generator Tube Rupture (SGTR)
- 8. Anticipated Transients Without Scram (ATWS)

Table 2.1 SDP Worksheet for Beaver Valley 2 Transients

Estimated Frequency (Table 1 Row)	Exposu	re Time	Table 1 I	Result (circle):	A	В	С	D	Е	F	G	Н
Safety Functions Needed:	Full Creditable	Full Creditable Mitigation Capability for Each Safety Function:										
Power Conversion System (PCS) Secondary Heat Removal (AFW) Early Inv., High Pressure Injection (EIHP) Primary Heat Removal, Feed/Bleed (FB) High Pressure Recirculation (HPR) Recirculation Spray (RS)	 1 / 2 Main Feedwater (MFW) trains or Startup pump (SUP) and 1/ 2 Condensate pump trains (operator action) 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 ASD train)⁽¹⁾ 1 / 3 Charging pumps (1 multi-train system). 1 / 3 PORVs and block valves open for Feed/Bleed (operator action)⁽²⁾ 1 / 3 charging pumps with 1/ 2 LHSI or 1/ 2 RS (2A or 2B) pumps(Operator action) 1 / 2 Inside RS (1A or 1B) pumps or 1/ 2 Outside RS (2A or 2B) pumps (2 multi-train systems) 											
Circle Affected Functions	<u>Recovery of</u> Failed Train	<u>Remaining Mitigati</u> <u>Sequence</u>	ion Capabilit	y Rating for E	<u>ach</u>	<u>Affe</u>	<u>ctea</u>	1	<u> </u>	Seq <u>Co</u>	uen olor	
1 TRANS - AFW - PCS - RS (4)												
2 TRANS - AFW - PCS - HPR (5)												
3 TRANS - AFW - PCS - FB (6)												
4 TRANS - AFW - PCS - EIHP (7)												
Identify any operator recovery actions that are If operator actions are required to credit placing mitigation time is available to implement these actions, 2) environm conditions similar to the scenario assumed, and 5) any e	n equipment in servic iental conditions allov	e or for recovery actions, su v access where needed, 3)	uch credit should	be given only if the	e follo	owing c						

Notes:

- (1) The value assessed by the IPE (Table 3.3.2-2, page 3.3-31) for the AFW TDP failure to start is 2.3E-2. For the SDP calculation, a value of 1E-1 can be used.
- (2) The human error probability (HEP) assessed in the IPE (page 3.3-76) for establishing bleed and feed cooling is 3.7E-2 (Operator failure to to initiate feed and bleed after failure to restore MFW and the startup feed pump).

Table 2.2 SDP Worksheet for Beaver Valley Unit 2 — Small LOCA

Estimated Frequency (Table 1 Row)	Exposure Time Table 1 Result (circle): A B C D E						
Safety Functions Needed:	Full Creditable	Full Creditable Mitigation Capability for Each Safety Function:					
Early Inventory, HP Injection (EIHP) Secondary Heat Removal (AFW) Main Feedwater or Dedicated FWP (FW) RCS Cooldown/ Depressurization (RCSDEP) Primary Bleed (FB) Low Pressure Recirculation (LPR) High Pressure Recirculation (HPR) Recirculation Spray (RS)	 1 / 3 charging pumps (1 multi-train system). 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 ASD train) Opeartor initiates 1/ 2 main feed pump or Startup pump (Operator action) Operator depressurizes RCS using 1 / 3 PORVs and block valves (operator action) 1 / 3 PORVs and block valves open for Feed/Bleed (operator action)⁽¹⁾ 1 / 2 LHSI trains (Operator action) 1 / 3 charging pumps with 1 / 2 LHSI pumps or 1/ 2 RS (2A or 2B) pumps (Operator action) 1 / 2 inside RS (1A or 1B) pumps or 1/ 2 Outside RS (2A or 2B) pumps (2 multi-train systems) 						
Circle Affected Functions	<u>Recovery of</u> Failed Train	<u>Remaining Mitigation Capability Rating for Each Affected</u> <u>Sequence</u>	<u>Sequence</u> <u>Color</u>				
1 SLOCA - RS (2, 5, 8, 11, 14)							
2 SLOCA - LPR (3, 9)							
3 SLOCA - RCSDEP - HPR (6, 12)							
4 SLOCA - AFW - FW- HPR (15)							
5 SLOCA - AFW - FW - FB (16)							
6 SLOCA - EIHP (17)							
Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:							

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

(1) The human error probability (HEP) assessed in the IPE (page 3.3 -76) for establishing bleed and feed cooling is 3.9E-2.

Table 2.3 SDP Worksheet for Beaver Valley Unit 2 — Stuck Open PORV (SORV)

Estimated Frequency (Table 1 Row)	Exposure 7	Time Table 1 Result (circle): A B C D E	FGH		
Safety Functions Needed:	Full Creditable	e Mitigation Capability for Each Safety Function:			
Early Inventory, HP Injection (EIHP) Isolation of Small LOCA (BLK) Secondary Heat Removal (AFW) RCS Cooldown/ Depressurization (RCSDEP) Primary Bleed (FB) Low Pressure Recirculation (LPR) High Pressure Recirculation (HPR) Recirculation Spray (RS)	 1 / 3 charging pumps (1 multi-train system). The closure of the block valve associated with stuck open PORV (recovery action) 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 ASD train) Operator depressurizes RCS using 1 / 3 PORVs and block valves (operator action) 1 / 3 PORVs and block valves open for Feed/Bleed (operator action⁽¹⁾) 1 / 2 LHSI pumps (Operator action) 1 / 3 charging pumps with 1 / 2 LHSI pumps or 1/ 2 RSS pumps (Operator action) 1 / 2 inside RS pumps or 1/ 2 outside RS pumps (2 multi-train systems) 				
Circle Affected Functions	<u>Recovery of</u> Failed Train	<u>Remaining Mitigation Capability Rating for Each Affected</u> <u>Sequence</u>	<u>Sequence</u> <u>Color</u>		
1 SORV - BLK - RS (2, 5, 8, 11, 14)					
2 SORV - BLK - LPR (3, 9)					
3 SORV - BLK - RCSDEP - HPR (6, 12)					
4 SORV - BLK - AFW - FW - HPR (15)					
5 SORV - BLK - AFW - FW - FB (16)					
6 SORV - BLK - EIHP (17)					

Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

(1) The human error probability (HEP) assessed in the IPE (page 3.3 -76) for establishing bleed and feed cooling is 3.7E-2

Table 2.4 SDP Worksheet for Beaver Valley Unit 2 Medium LOCA

Estimated Frequency (Table 1 Row)	Exp	oosure Time	Table 1 Result (circle):	ABCDI	EFGH					
Safety Functions Needed:	Full Creditable	Full Creditable Mitigation Capability for Each Safety Function:								
Early Inventory, Accumulators	2/3 accumulate	ors (1 multi-train system)								
(EIAC) Early Inventory, HP Injection (EIHP) Low Pressure Injection (LPI) ⁽¹⁾ Low Pressure Recirculation (LPR) RWST Makeup (RWST) ⁽²⁾ Recirculation Spray (RS)	1/ 2 LHSI pump 1 / 2 LHSI pump Operator provid	 1/3 charging pumps (1 multi-train system). 1/2 LHSI pumps (1 multi-train system) 1/2 LHSI pumps or 1/2 RS (2A or 2B) pumps aligned for recirculation (operator action) Operator provides makeup for HHSI pumps (Operator action) 1/2 inside RS (1A or 1B) pumps or 1/2 outside RS (2A or 2B) pumps in spray mode (2 multi-train system) 								
Circle Affected Functions	<u>Recovery of</u> Failed Train	<u>Remaining Mitigation C</u> <u>Sequence</u>	apability Rating for Each	<u>Affected</u>	<u>Sequence</u> <u>Color</u>					
1 MLOCA - RS (2)										
2 MLOCA - LPR - RWST (4)										
3. MLOCA - LPI (5)										
4. MLOCA - EIHP (6)										
5. MLOCA - EIAC (7)										
Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event: If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.										

Notes:

- (1) As per the IPE, both HHSI and LHSI are required for success to cover the full range of medium LOCAs.
- (2) RWST makeup actions are called for by procedure when RWST level is low and cold leg recirculation is unavailable.

Table 2.5 SDP Worksheet for Beaver Valley Unit 2 — Large LOCA

Estimated Frequency (Table 1 Row)	Expos	posure Time Table 1 Result (circle): A		A B C	D	ΕF	GΗ
Safety Functions Needed:	Full Creditable Mitigation Capability for Each Safety Function:						
Earlt Inventory, Accumulators (EIAC) Early Inventory, LP Injection (EILP) Quench Spray (QS) ⁽¹⁾ Recirculation Spray (RS) Outside recirculation spray (ORS) Low Pressure Recirculation (LPR)	 2/ 2 Accumulators (1 Train) 1/2 LHSI pump trains (1 multi-train system) 1/2 QS pumps drawing from RWST (1 multi-train system) 1/2 inside RS pumps (1 multi-train system) 1/2 outside RS pumps (1 multi-train system) 1/2 LHSI pump trains; Operator switchover from injection to recirculation (operator action) 						
Circle Affected Functions	<u>Recovery of</u> Failed Train	<u>Remaining Mitigation</u> <u>Sequence</u>	n Capability Rating for E	ach Affected	!		<u>quence</u> Color
1 LLOCA - LPR (2)							
2 LLOCA - RS (3)							
3 LLOCA - QS - ORS (6)							
4 LLOCA - LHSI (7)							
5 LLOCA - EIAC (8)							
Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:							

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

(1) A high containment pressure (8 psig) signal initiates both QS pumps. Successful operation of a QS pump is needed to fill the containment sump for required NPSH for inside RS pumps.

Table 2.6 SDP Worksheet for Beaver Valley Unit 2 — LOOP

Estimated Frequency (Table 1 Row)	Exposu	osure Time Table 1 Result (circle): A B C D		Е	EFGH					
Safety Functions Needed:	Full Creditable Mitigation Capability for Each Safety Function:									
Emergency AC Power (EAC) Turbine-driven AFW pump (TDAFW) Secondary Heat Removal (AFW) Recovery of AC Power in < 2 hrs (REC2) Recovery of AC Power in < 5 hrs (REC5) Early Inventory, HP Injection (EIHP) Primary Heat Removal (FB) High Pressure Recirculation (HPR) Recirculation Spray (RS)	 1 / 2 Emergency Diesel Generators (1 multi-train system) 1 / 1 TDP trains of AFW (1 ASD train)⁽¹⁾ 1 / 2 MDAFW trains (1 multi-train system) or 1 TDAFW train (1 diverse train)⁽¹⁾ SBO procedures implemented (operator action under high stress)⁽²⁾ 									
Circle Affected Functions	<u>Recovery of</u> Failed Train	<u>Remaining Mitigati</u> <u>Sequence</u>	on Capability Rating	g for Ea	ach A	Affecte	<u>d</u>	<u>,</u>	Seque Colo	
1 LOOP - AFW - RS (3)										
2 LOOP - AFW - HPR (4)										
3 LOOP - AFW - FB (5)										
4 LOOP - AFW - EIHP (6)										
5 LOOP - EAC - RS (8,13)										
6 LOOP - EAC - HPR (9,14)										
7 LOOP - EAC - EIHP (10,16)										
8 LOOP - EAC - REC5 (11)								\perp		
9 LOOP - EAC - TDAFW - FB (15)								\perp		
10 LOOP - EAC - TDAFW - REC2 (17)										

Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

- (1) The failure probability of AFW TDP used in the IPE is 2.3E-2.
- (2) In IPE, Recovery of AC with AFW, PORV LOCA is assigned a failure probability of 0.12, and Recovery of AC with AFW, No LOCA is assigned a failure probability of 5.0E-3.
- (3) In an SBO situation, an RCP seal LOCA may occur, with subsequent core damage at about 5 hours.
- (4) The human error probability (HEP) assessed in the IPE (page 3-129) for establishing bleed and feed cooling is 3.7E-2.

Table 2.7 SDP Worksheet for Beaver Valley Unit 2 — SGTR

Exposure	e Time	Table 1 Result (circle): A B C D	EFGH			
Full Creditable Mitigation Capability for Each Safety Function:						
1 / 2 MDPs of AFW (1 multi-train system) or 1 / 1 TDP of AFW (1 ASD Train) 1 / 3 charging pumps (1 multi-train system) Operator isolates the ruptured SG and depressurizes RCS using 1 / 1 SG ARV (on each SG fed by AFW) or RCS pressurizer PORV (1 / 3) to less than setpoint of relief valves of SG (operator action under high stress) ⁽¹⁾						
Operator uses RCS pressurizer PORV and block valves (1 / 3) (operator action) ⁽²⁾ Operator depressurizes RCS and provides makeup to RWST for HHSI pumps (Operator action) 1 / 3 charging pumps with 1/ 2 LHSI pumps or 1/ 2 RS (2A or 2B) pumps for recirculation						
1/ 2 inside RS (1A or 1B) pumps or 1/ 2 outside RS (2A or 2B) pumps (2 multi-train system)						
<u>Recovery of</u> <u>Failed Train</u>	<u>Remaining Miti</u> <u>Sequence</u>	igation Capability Rating for Each Affected	<u>Sequence</u> <u>Color</u>			
1						
	<i>Full</i> Creditable 1 / 2 MDPs of / 1 / 3 charging p Operator isolat fed by AFW) or (operator action Operator uses Operator depre- action) 1 / 3 charging p (operator action Operator initiat 1/ 2 inside RS	Full Creditable Mitigation Capa1 / 2 MDPs of AFW (1 multi-train1 / 3 charging pumps (1 multi-train0 / 3 charging pumps (1 multi-train0 / 9 charging pumps with 1/2 L0 / 9 charging Pumps (1 / 9 charging pumps)1 / 2 inside RS (1 / 9 charging pumps)1 / 2 inside RS (1 / 9 charging pumps)1 / 2 inside RS (1 / 9 charging pumps)1 / 9 charging Pumps1 / 9 charging Pumps	Full Creditable Mitigation Capability for Each Safety Function:1 / 2 MDPs of AFW (1 multi-train system) or 1 / 1 TDP of AFW (1 ASD Train)1 / 3 charging pumps (1 multi-train system)Operator isolates the ruptured SG and depressurizes RCS using 1 / 1 SG ARVfed by AFW) or RCS pressurizer PORV (1 / 3) to less than setpoint of relief value(operator action under high stress) ⁽¹⁾ Operator uses RCS pressurizer PORV and block valves (1 / 3) (operator action)Operator depressurizes RCS and provides makeup to RWST for HHSI pumps (action)1 / 3 charging pumps with 1/ 2 LHSI pumps or 1/ 2 RS (2A or 2B) pumps for relicion1 / 2 inside RS (1A or 1B) pumps or 1/ 2 outside RS (2A or 2B) pumps (2 multi-there is a constrained in the strest of the s			

Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:

If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.

Notes:

- (1) In IPE, the operator failure to depressurize RCS for RHR entry is assigned a probability of 1.2E-3, and the operator failure to isolate ruptured SG and equalize pressure is assigned a probability of 5.4E-3.
- (2) The human error probability (HEP) assessed in the IPE (page 3-129) for establishing bleed and feed cooling is 3.7E-2.

Table 2.8 SDP Worksheet for Beaver Valley Unit 2 — ATWS

Estimated Frequency (Table 1 Row))	Exposure Time	Table 1 Result (circle):	ABCDE	FGH		
Safety Functions Needed: Emergency Boration (HPI) Turbine trip (TTP) Primary Relief (SRV) Secondary Heat Removal (AFW)	Full Creditable Mitigation Capability for Each Safety Function: Operator conducts emergency boration using 1 / 3 charging pumps (operator action) AMSAC trips the turbine (1 train) 3 / 3 SRVs with 3/3 PORVs open (1 train) 2 / 2 MDPs of AFW (1 train) or 1 / 1 TDP of AFW (1 ASD Train)						
Circle Affected Functions	<u>Recovery of</u> <u>Failed Train</u>	Remaining Mitigation Capab	<u>Sequence</u> <u>Color</u>				
1 ATWS - HPI (2)							
2 ATWS - SRV (3)							
3 ATWS - AFW (4)							
4 ATWS - TTP (5)							
Identify any operator recovery actions that are credited to directly restore the degraded equipment or initiating event:							
If operator actions are required to credit placing mitigation equipment in service or for recovery actions, such credit should be given only if the following criteria are met: 1) sufficient							


time is available to implement these actions, 2) environmental conditions allow access where needed, 3) procedures exist, 4) training is conducted on the existing procedures under conditions similar to the scenario assumed, and 5) any equipment needed to complete these actions is available and ready for use.


1.3 SDP Event Trees


This section provides the simplified event trees called SDP event trees used to define the accident sequences identified in the SDP worksheets in the previous section. An event tree for the stuck-open PORV is not included since it is similar to the small LOCA event tree. The event tree headings are defined in the corresponding SDP worksheets.


The following event trees are included:


- 1. Transients
- 2. Small LOCA
- 3. Medium LOCA
- 4. Large LOCA
- 5. LOOP
- 6. Steam Generator Tube Rupture (SGTR)
- 7. Anticipated Transients Without Scram (ATWS)

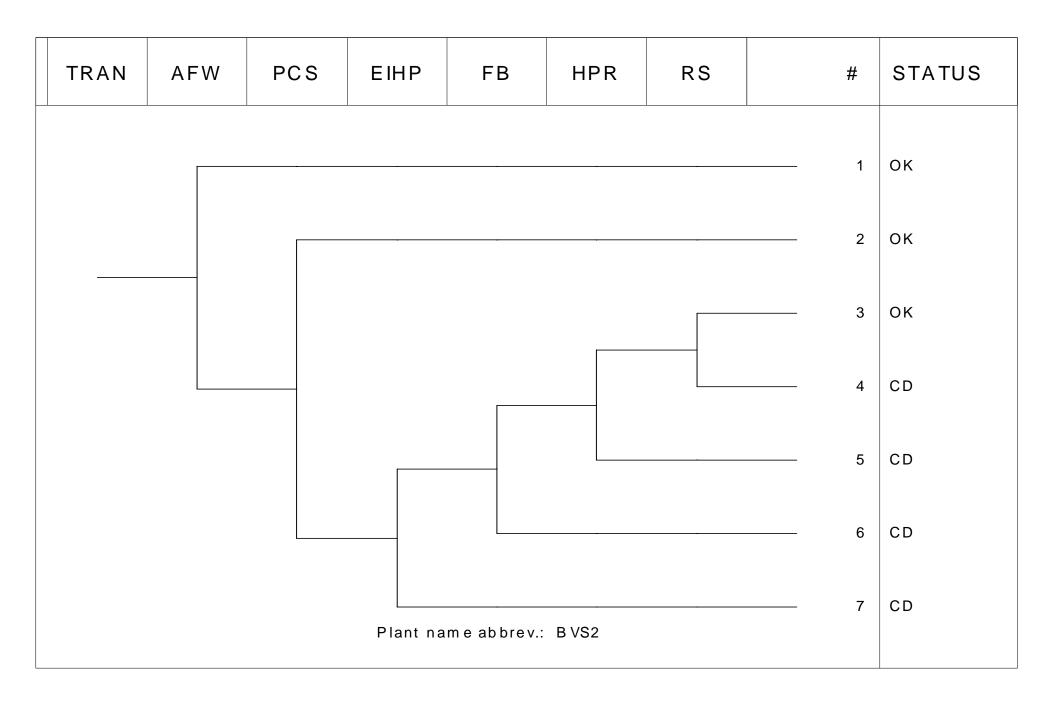


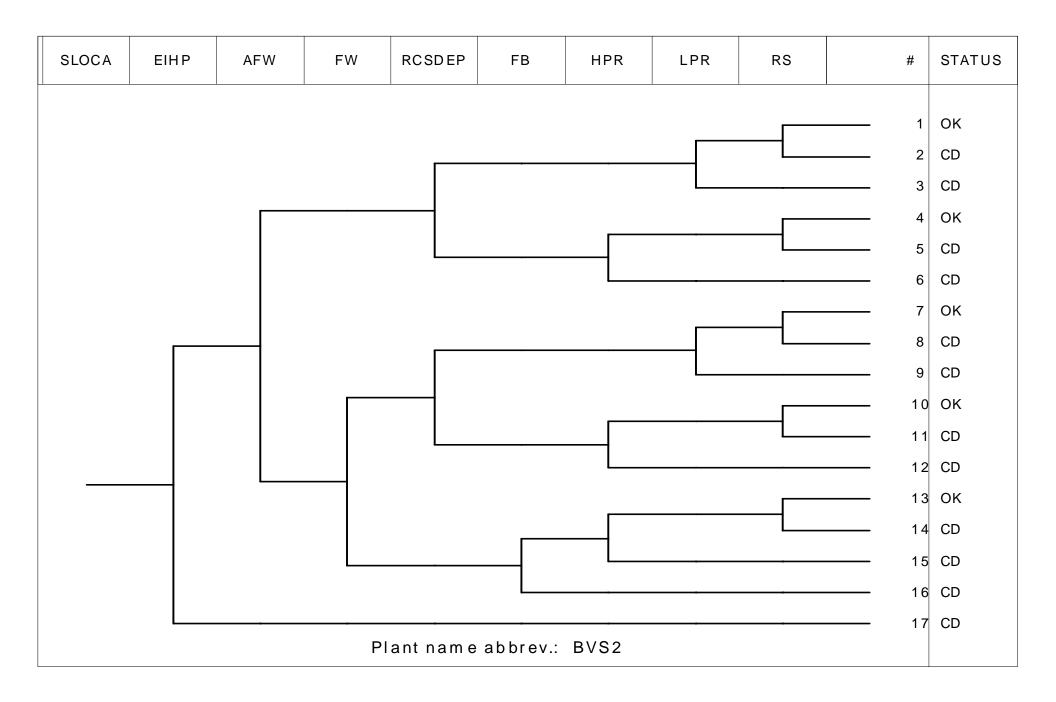


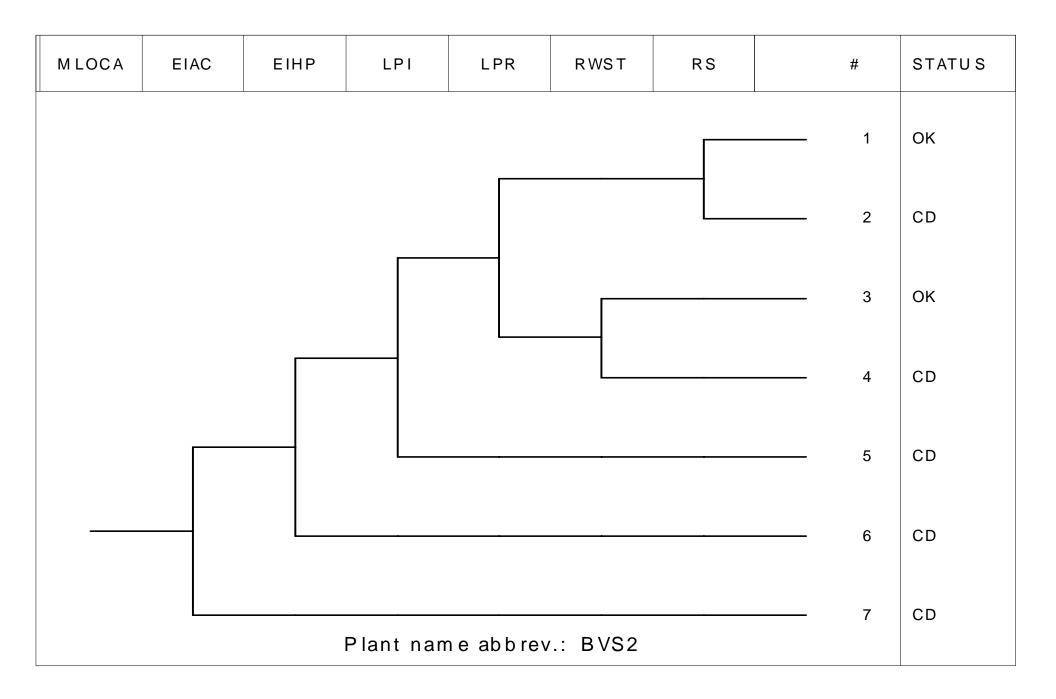

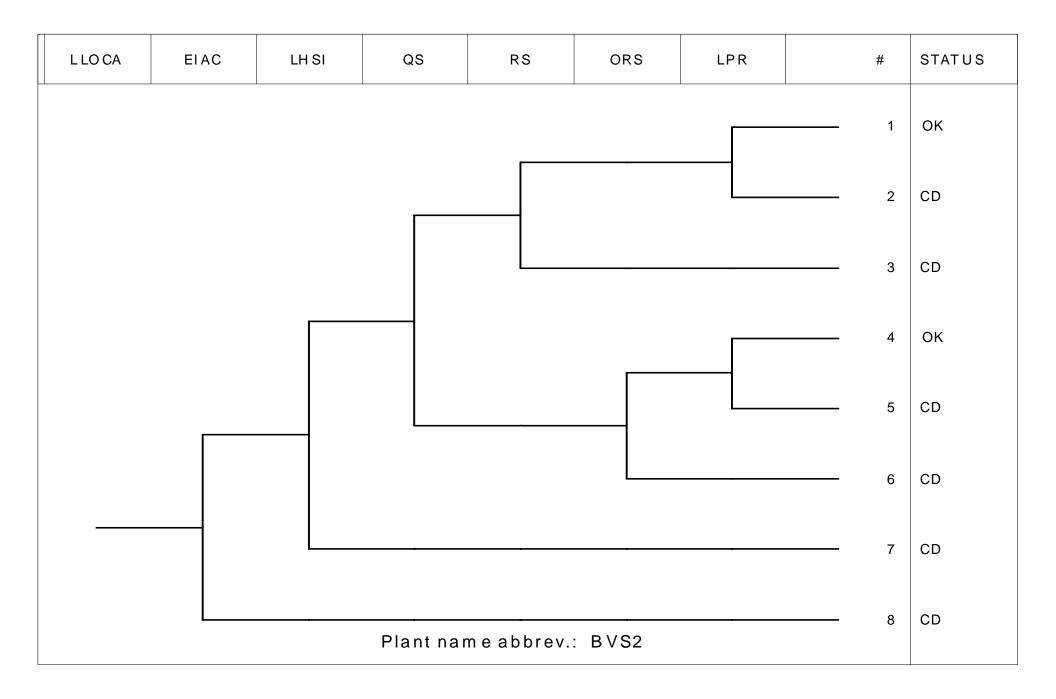

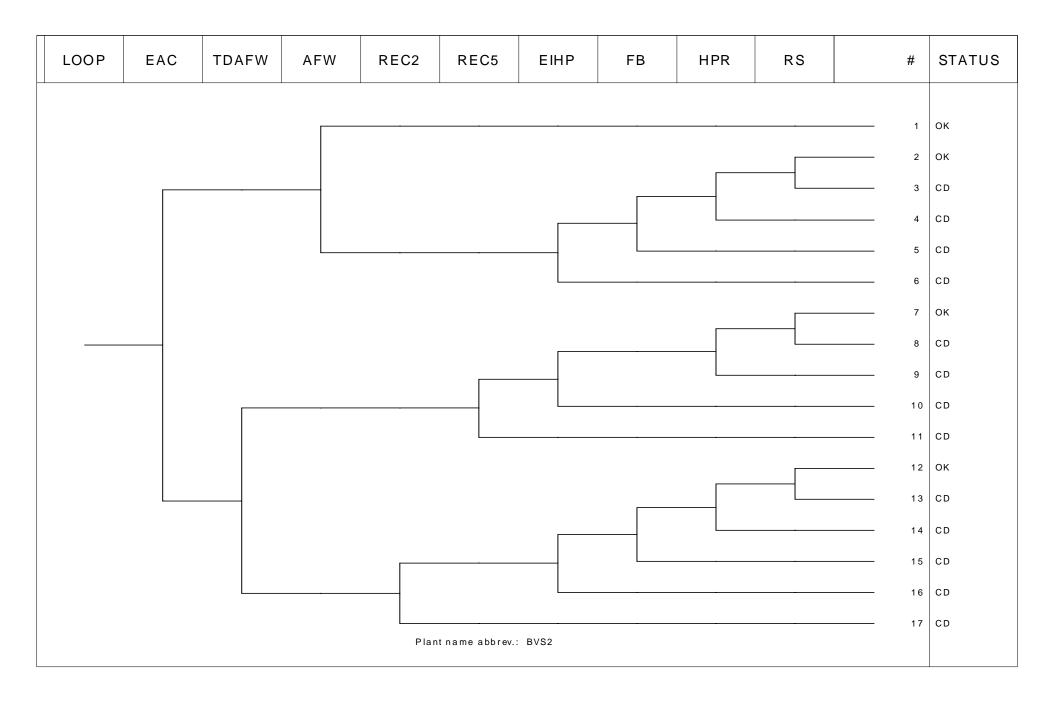

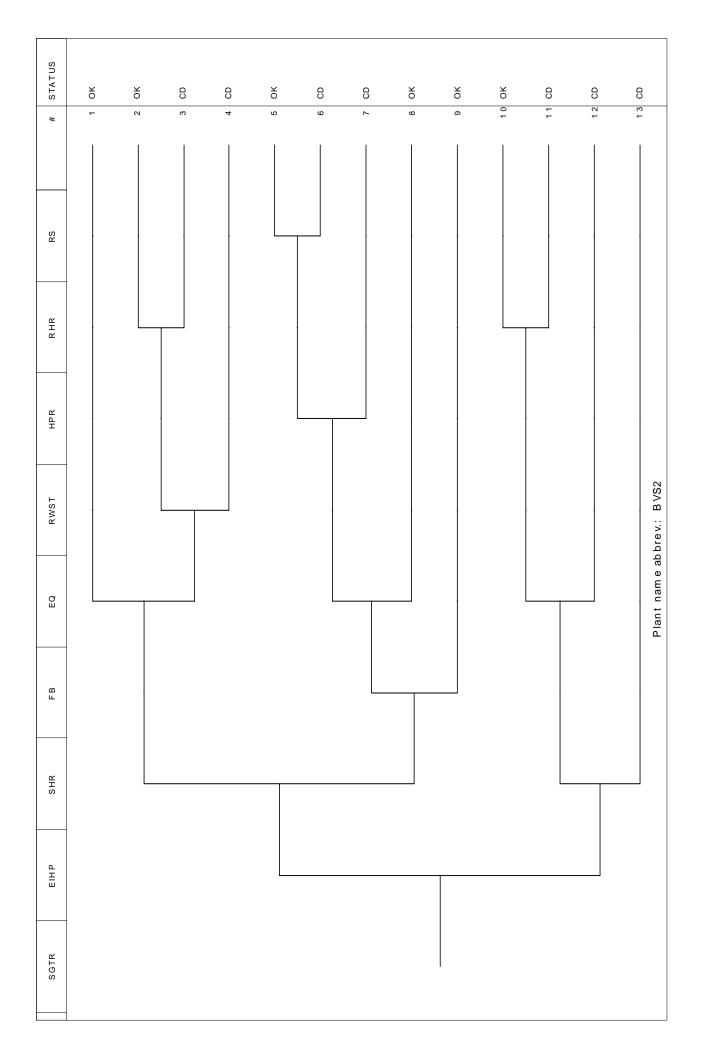

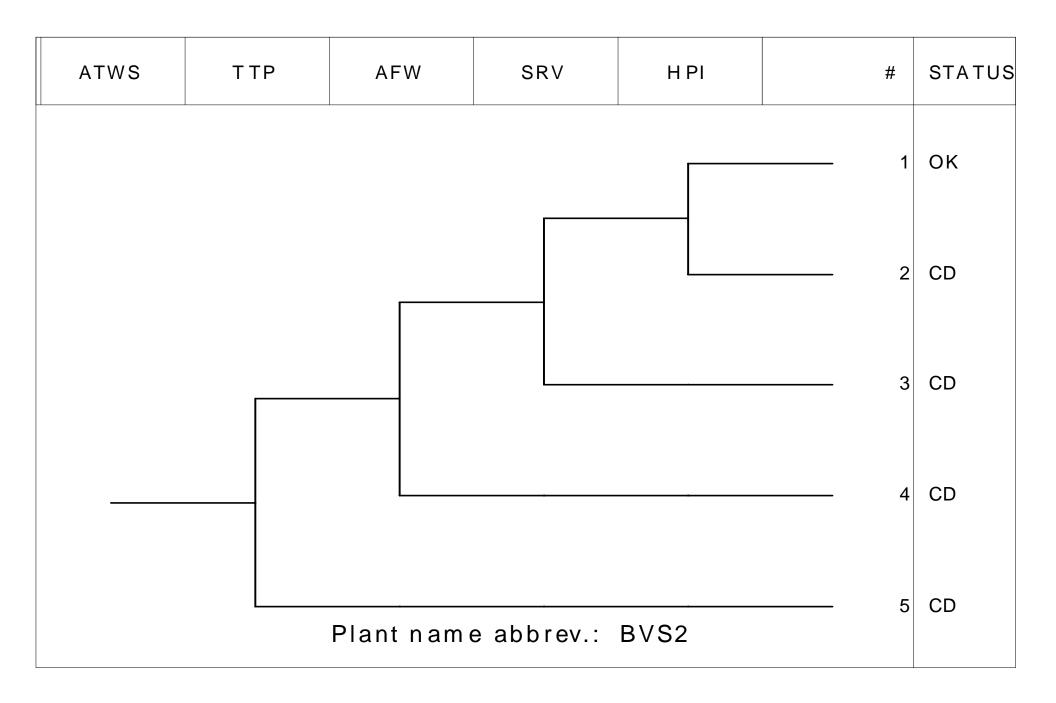

2. RESOLUTION AND DISPOSITION OF COMMENTS

This section documents the comments received on the material included in this report and their resolution. This section is blank until comments are received and are addressed.

REFERENCES

- 1. NRC SECY-99-007A, Recommendations for Reactor Oversight Process Improvements (Follow-up to SECY-99-007), March 22, 1999.
- 2. Dusquesne Light Company, "Beaver valley Power Station Unit 2 Probabilistic Risk Assessment Individual Plant Examination Report," March 17, 1992.
- 3. Dusquesne Light Company, "Beaver Valley Power Station Unit 2 Response to NRC RAI," October 26, 1992.