Facility: Grand Gulf Nuclear Station Date of Examination: 12/05/2011						
Examination Level: RO	SRO 🗌	Operating Test Number: <u>LOT-2011</u>				
Administrative Topic (see Note)	Type Code*	Describe activity to be performed				
		Fire Door Surveillance				
Conduct of Operations	N-R	GJPM-OPS-2011AR1				
		2.1.20 (4.6)				
		Review Cooldown Record				
Conduct of Operations	M-R	GJPM-OPS-2011AR2				
		2.1.23 (4.3)				
		Prepare a Tagout				
Equipment Control	N-R	GJPM-OPS-2011AR3				
		2.2.13 (4.1)				
Radiation Control	Radiation Control					
		Primary CTMT Water LvI Determination EOP Att 29				
Emergency Procedures/Plan	P-R	GJPM-OPS-2011AR4				
	2.4.21 (4.0)					
NOTE: All items (5 total) are required for SROs. RO applicants require only 4 items unless they are retaking only the administrative topics, when all 5 are required.						
 * Type Codes & Criteria: (C)ontrol room, (S)imulator, or Class(R)oom (D)irect from bank (≤ 3 for ROs; ≤ 4 for SROs & RO retakes) (N)ew or (M)odified from bank (≥ 1) (P)revious 2 exams (≤ 1; randomly selected) 						

Facility: Grand Gulf Nuclear Station Date of Examination: <u>12/05/2011</u>					
Examination Level: RO SRO		Operating Test Number: LOT-2011			
Administrative Topic (see Note)	Type Code*	Describe activity to be performed			
		Determine Fire Watch Requirements			
Conduct of Operations	N-R	GJPM-OPS-2011AS1			
		K/A 2.1.2 (4.0)			
		Plant Safety Index			
Conduct of Operations	M-S	GJPM-OPS-2011AS2			
		K/A 2.1.20 (4.6)			
		Review Adequacy of a Tagout			
Equipment Control	N-R	GJPM-OPS-2011AS3			
		K/A 2.2.13 (4.3)			
		Review Liquid Radwaste Discharge Permit			
Radiation Control	N-R	GJPM-OPS-2011AS4			
		K/A 2.3.6 (3.8)			
		EPP Classification			
Emergency Procedures/Plan	N-R	GJPM-OPS-2011AS5			
		K/A 2.4.41 (4.6)			
NOTE: All items (5 total) are required for SROs. RO applicants require only 4 items unless they are retaking only the administrative topics, when all 5 are required.					
 * Type Codes & Criteria: (C)ontrol room, (S)imulator, or Class(R)oom (D)irect from bank (≤ 3 for ROs; ≤ 4 for SROs & RO retakes) (N)ew or (M)odified from bank (≥ 1) (P)revious 2 exams (≤ 1; randomly selected) 					

Control Room/In-Plant Systems Outline

Facility: GRAND GULF NUCLEAR STATION Date of Examination: 12/05/2011 Exam Level: RO SRO-I SRO-U Operating Test No.: LOT-2011				
Control Room Systems [@] (8 for RO); (7 for SRO-I);	(2 or 3 for SRO-U, i	ncluding 1 ESF)		
System / JPM Title		Type Code*	Safety Function	
a. 202001 A4.01 (3.7/3.7) / Shifting Reactor Recirc Speed (GJPM-OPS-B3306)	Pumps to Fast	A-D-S	1	
b. 217000 A4.04 (3.6/3.6) / RCIC Manual Startup (E5102)	GJPM-OPS-	A-D-S	2	
c. 241000 A2.06 (3.1/3.2) / Rotate EHC Pumps (G	JPM-OPS-N3201)	A-D-S	3	
 d. 205000 A4.01 (3.7/3.7) / Startup Shutdown Coo (GJPM-OPS-E1201) 	ling B	D-L-S	4	
e. 223001 A2.11 (3.6/3.8) / Manually Initiate Suppr Up (GJPM-OPS-E3013)	ession Pool Make	D-S	5	
f. 212000 A2.03 (3.3/3.5) / Reactor Manual Scram yet added to JPM bank GJPM-OPS-C7105)	Switch Test (Not	A-N-S	7	
g. 400000 A4.01 (3.1/3.0) / Rotate CCW Pumps (GJPM-OPS-P4271)	A-D-S	8		
h. 261000 A4.03 (3.0/3.0) / Secure SSTG With On Standby Mode Following Automatic Initiation (G		D-S	9	
In-Plant Systems [@] (3 for RO); (3 for SRO-I); (3 or 2	2 for SRO-U)			
i. 295015 AA1.01 (3.8/3.9) / Manually Venting the Scram Air Header (GJPM-OPS-EOP23) D-E-R 1				
j. 219000 A4.01 (3.8/3.7) / Startup RHR In Suppre Cooling From the Remote Shutdown Panel (GJP		D-E	5	
k. 262002 A4.01 (2.8/3.1) / Startup an ESF Static Inverter (Not yet added to JPM bank GJPM-OPS-L62-3)		Ν	6	
All RO and SRO-I control room (and in-plant) systems must be different and serve different safety functions; all 5 SRO-U systems must serve different safety functions; in-plant systems and functions may overlap those tested in the control room.				
* Type Codes Criteria for RO / SRO-I / SRO-U				
 (A)Iternate path (C)ontrol room (D)irect from bank (E)mergency or abnormal in-plant (EN)gineered safety feature (L)ow-Power / Shutdown (N)ew or (M)odified from bank including 1(A) (P)revious 2 exams (R)CA (S)imulator 	$4-6/4-6/2-3$ $\leq 9/\leq 8/\leq 4$ $\geq 1/\geq 1/\geq 1$ $-/-/\geq 1 \text{ (control room system)}$ $\geq 1/\geq 1/\geq 1$ $\geq 2/\geq 2/\geq 1$ $\leq 3/\leq 3/\leq 2 \text{ (randomly selected)}$ $\geq 1/\geq 1/\geq 1$			

Control Room/In-Plant Systems Outline

Form ES-301-2

Facility: GRAND GULF NUCLEAR STATION Date of Examination: 12/05/2011 Exam Level: RO SRO-I SRO-U Operating Test No.: LOT-2011				
Control Room Systems [@] (8 for RO); (7 for SRO-I);	(2 or 3 for SRO-U, i	ncluding 1 ESF)		
System / JPM Title		Type Code*	Safety Function	
a. 202001 A4.01 (3.7/3.7) / Shifting Reactor Recirc Speed (GJPM-OPS-B3306)	Pumps to Fast	A-D-S	1	
 b. 217000 A4.04 (3.6/3.6) / RCIC Manual Startup (E5102) 	GJPM-OPS-	A-D-S	2	
c. 241000 A2.06 (3.1/3.2) / Rotate EHC Pumps (G	JPM-OPS-N3201)	A-D-S	3	
 d. 205000 A4.01 (3.7/3.7) / Startup Shutdown Coo (GJPM-OPS-E1201) 	ling B	D-L-S	4	
e. 223001 A2.11 (3.6/3.8) / Manually Initiate Suppr Up (GJPM-OPS-E3013)	ession Pool Make	D-S	5	
f. 212000 A2.03 (3.3/3.5) / Reactor Manual Scram yet added to JPM bank GJPM-OPS-C7105)	Switch Test (Not	A-N-S	7	
g. 400000 A4.01 (3.1/3.0) / Rotate CCW Pumps (GJPM-OPS-P4271)		A-D-S	8	
h. NA				
In-Plant Systems ^{$@$} (3 for RO); (3 for SRO-I); (3 or 2	2 for SRO-U)			
i. 295015 AA1.01 (3.8/3.9) / Manually Venting the Header (GJPM-OPS-EOP23)	Scram Air	D-E-R	1	
j. 219000 A4.01 (3.8/3.7) / Startup RHR In Suppres Cooling From the Remote Shutdown Panel (GJP		D-E	5	
k. 262002 A4.01 (2.8/3.1) / Startup an ESF Static I added to JPM bank GJPM-OPS-L62-3)	nverter (Not yet	Ν	6	
@ All RO and SRO-I control room (and in-plant) systems must be different and serve different safety functions; all 5 SRO-U systems must serve different safety functions; in-plant systems and functions may overlap those tested in the control room.				
* Type Codes Criteria for RO / SRO-I / SRO-U				
 (A)Iternate path (C)ontrol room (D)irect from bank (E)mergency or abnormal in-plant (EN)gineered safety feature (L)ow-Power / Shutdown (N)ew or (M)odified from bank including 1(A) (P)revious 2 exams (R)CA (S)imulator 	$4-6/4-6/2-3$ $\leq 9/\leq 8/\leq 4$ $\geq 1/\geq 1/\geq 1$ $-/-/\geq 1 \text{ (control room system)}$ $\geq 1/\geq 1/\geq 1$ $\geq 2/\geq 2/\geq 1$ $\leq 3/\leq 3/\leq 2 \text{ (randomly selected)}$ $\geq 1/\geq 1/\geq 1$			



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR1

JOB PERFORMANCE MEASURE

 Number: GJPM-OPS-2011AR1

 Revision: 0

 Page: 1 of 7

 Rtype: ______

 QA Record

 Number of pages

 Date ______

 Initials ______

TRAINING PROGRAM:							
NRC Operating Exam							
	JPM-AR1						
Time Critical	Time Critical Alternate Path Validation Time: 20 min						
TITLE:							
	Fire Door Surveillance						
New Material	Minor Revision Major Revision	n Cancellation					
	<u>REASON FOR REVISION:</u> THIS DOCUMENT REPLACES:						
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()	1					
Prepared By:	Mark Pait	5/24/2011					
	**Preparer	Date					
Ops Review ^{++:}	Keith Huff	10/5/2011					
Technical Reviewer (e.g., SME, line management) Date							
Validated By:	10/5/2011						
_	Training Representative	Date					
Approved By:	Kane Ryder	10/5/2011					
· · · _	⁺ Discipline Training Supervisor Date						
Approval Date:*	10/5/2011						

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE TRANSMITTED TO RM	INITIAL RECEIPT BY RM (DATE/INITIAL)	RETURNED FOR CORRECTIONS (DATE/INITIAL)	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)

04-1-01-T42-1 Rev 28



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR1 Revision: 0 JOB PERFORMANCE Page: 2 of 7

MEASURE

Admin Task:

Fire Doors Surveillance

Setting:	Classroom
<u>Type</u> :	RO
<u>Task</u> :	CRO-P64-NORM-7
<u>K&A</u> :	2.1.20 (4.6/4.6) 2.2.12 (3.7/4.1)
Safety Function:	NA
Time Required:	20 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	06-OP-SP64-M-0043, Fire Doors Alarm Check
Handout(s):	06-OP-SP64-M-0043, Fire Doors Alarm Check (Attachment 1 prepared)
<u># Manipulations:</u>	NA
# Critical Steps:	2
<u>Group:</u>	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR1 Revision: 0

Page: 3 of 7

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The Plant is operating at rated power.
- 06-OP-SP64-M-0043 step 5.2.1 and 5.2.2 are performed as required by another operator.
- The CRS directs you to perform a <u>partial</u> 06-OP-SP64-M-0043, Fire Doors Alarm Check on the following doors: (1) Elect Pen Rm 1A221 door number 1A212, (2) Emerg S/D Rm OC208A door number OC208, and (3) Sec Ctmt Door 1A604.
- You note the following items during your inspection:
 - Elect Pen Rm 1A221 door 1A212:
 - Door <u>does not</u> latch after being fully opened and allowing the closure mechanism to pull the door shut; however, when you pull the door it latches.
 - Alarms after 1 second upon opening.
 - Emerg S/D Rm OC208A door OC208:
 - Has a deep gouge/dent 10" long on one side on the bottom right quadrant but does not penetrate the door skin.
 - Seam has separated next to the 10" gouge.
 - Alarms after 30 seconds upon opening.
 - Sec Ctmt Door 1A604:
 - Has a rust patch on the Aux Building Roof side that has left a 3 in² hole in the skin of the door (the inside door skin is not damaged).
 - Has not alarmed 4 minutes after opening.

Initiating Cue(s):

- Complete the attached 06-OP-SP64-M0043, Fire Doors Alarm Check surveillance, including all portions of Attachment 1 Cover Sheet sections 2.0 and 3.0. Only mark Tech Spec Acceptance Criteria as Acceptable if <u>REQUIRED</u> by 06-OP-SP64-M-0043 surveillance procedure.
- Note reasons for marking Tech Spec Acceptance Criteria or other steps/data in the test results section as "Acceptable" or "Unacceptable" on the back of the surveillance coversheet.
- All prerequisites are verified met.



Admin Task: Fire Doors Surveillance

Notes: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• The operator will perform a Fire Door Alarm Check using the information provided in the initiating ques. The operator will discover tech spec door OC208 is INOP, tech spec door 1A212 is OPERABLE but requires a WR to fix the closing mechanism, and non-tech spec door 1A604 also requires a WR to fix the security alarm timing and a rust patch.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 06-OP-SP64-M-0043				
\square^* The operator evaluates the given conditions for each fire door given in the				
initiating cues and determines the follo	wing:			
will not shut the door without assistar	eptable" because the closing mechanism nce (see note for step 5.2.6).			
· · · · · · · · · · · · · · · · · · ·	2.5c; however, the Tech Spec Acceptance stable" (see note for step 5.2.5). The other			
Tech Spec Door OC208 is INOP since	e it fails step 5.2.5c.			
□* <u>Door 1A604 is not a Tech Spec door;</u> <u>Criteria is NA. Step 5.2.5a data is "Ur</u> <u>skin is visibly damaged with a hole ></u>	nacceptable" because the outside door			
Standard: The deficiencies noted abo cover sheet.	ove are recorded on the surveillance			
<u>Cue</u> :				
	ent for step 3.2 on the surveillance hat demonstrate an equivalent able.			



SAT / UNSAT

Step 2: 06-OP-SP64-M-0043

□* Complete the surveillance coversheet section 3.1 by checking boxes for:

(1) Partial procedure complete,

(2)* Tech Spec Acceptance Criteria Acceptable, and

(3)* All other steps/data Unacceptable.

Standard: Checks appropriate boxes.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step	3: 06-OP-SP	64-M-0043]	
	Complete th	ne surveillance covershe	eet sections 2.1, 2.2 and 3.3	
	Standard:	Circle for the plant be performer with the dat	eing in Mode 1 and record themselves as ate and time.	;
	<u>Cue</u> :			
	<u>Notes:</u>	JPM is completed whe surveillance package	en the operator completes the coversheet.	
			SAT / UNSA	٩T

Task Standard(s):

The operator determines that the Tech Spec Acceptance Criteria is "Acceptable" and that All other steps/data is "Unacceptable" per 06-OP-SP64-M-0043.

SAT / UNSAT



<u>Admin Task</u>: Fire Doors Surveillance

Follow-Up Questions & Answers:

Comments:

Initial Condition(s):

- The Plant is operating at rated power.
- 06-OP-SP64-M-0043 step 5.2.1 and 5.2.2 are performed as required by another operator.
- The CRS directs you to perform a <u>partial</u> 06-OP-SP64-M-0043, Fire Doors Alarm Check on the following doors: (1) Elect Pen Rm 1A221 door number 1A212, (2) Emerg S/D Rm OC208A door number OC208, and (3) Sec Ctmt Door 1A604.
- You note the following items during your inspection:
 - Elect Pen Rm 1A221 door 1A212:
 - Door <u>does not</u> latch after being fully opened and allowing the closure mechanism to pull the door shut; however, when you pull the door it latches.
 - Alarms after 1 second upon opening.
 - Emerg S/D Rm OC208A door OC208:
 - Has a deep gouge/dent 10" long on one side on the bottom right quadrant but does not penetrate the door skin.
 - Seam has separated next to the 10" gouge.
 - Alarms after 30 seconds upon opening.
 - o Sec Ctmt Door 1A604:
 - Has a rust patch on the Aux Building Roof side that has left a 3 in² hole in the skin of the door (the inside door skin is not damaged).
 - Has not alarmed 4 minutes after opening.

Initiating Cue(s):

- Complete the attached 06-OP-SP64-M0043, Fire Doors Alarm Check surveillance, including all portions of Attachment 1 Cover Sheet sections 2.0 and 3.0. Only mark Tech Spec Acceptance Criteria as Acceptable if <u>REQUIRED</u> by 06-OP-SP64-M-0043 surveillance procedure.
- Note reasons for marking Tech Spec Acceptance Criteria or other steps/data in the test results section as "Acceptable" or "Unacceptable" on the back of the surveillance coversheet.
- All prerequisites are verified met.



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR2

JOB PERFORMANCE MEASURE

 Number: GJPM-OPS-2011AR2

 Revision: 1

 Page: 1 of 7

 Rtype: ______

 QA Record

 Number of pages ______

 Date ______ Initials ______

TRAINING PROGRA	AM:					
NRC Operating Exam						
	JPM-AR2					
Time Critical	Alternate Path Validation Time: 15 min					
	Review Cooldown Record					
New Materia	l Minor Revision Dajor Revision	Cancellation				
	<u>REASON FOR REVISION</u> : Origional electronic copy lost <u>THIS DOCUMENT REPLACES</u> : GJPM-OPS-ADMR92					
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()					
Prepared By:	Mark Pait	5/17/2011				
Ops Review ^{++:}	**Preparer	Date				
Technical Reviewer (e.g., SME, line management) Date						
Validated By: _	Training Representative	Date				
Approved By: Kane Ryder		10/11/2011				
Ammunul Datas	⁺ Discipline Training Supervisor	Date				
Approval Date:*	10/11/2011					

* Indexing Information

** The requirements of the Training Material Checklist have been met.

 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	JENS LIENN	X Not Applicable		
DATE TRANSMITTED TO RM	INITIAL RECEIPT BY RM (DATE/INITIAL)		(DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)



JOB PERFORMANCE Revision: 1
Page: 2 of 7

ENTERGY NUCLEAR Number: GJPM-OPS-2011AR2

MEASURE

Admin Task:

Review Cooldown Record

Setting:	Classroom
<u>Type</u> :	RO
Task:	CRO-ADMIN-07
<u>K&A</u> :	2.1.25 (3.9/4.2) 2.1.23 (4.3/4.4)
Safety Function:	N/A
Time Required:	15 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	03-1-01-3, Plant Shutdown; TS 3.4.11
Handout(s):	03-1-01-3 Attachment 3 with data (Attached)
	Current TS Figure 3.4.11-1
<u># Manipulations</u> :	N/A
# Critical Steps:	2
Group:	N/A

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR2 Revision: 1

Page: 3 of 7

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The Plant is in Mode 3.
- Plant cooldown is in progress for a planned shutdown.
- A non-licensed operator has collected cooldown data using 03-1-01-3 Attachment 3, but no reviews have been performed.

Initiating Cue(s):

• The CRS directs you to review the cooldown data recorded by the non-licensed operator as the Reactor Operator in accordance with 03-1-01-3 to determine whether any limits have been exceeded.



Admin Task: Review Cooldown Record

Notes: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• The operator will review cooldown data recorded on 03-1-01-3 Attachment 3 and identify the Tech Spec limit of 100F/hr has been exceeded.

<u>Tasks</u> : Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 03-1-01-3	3 Attachment 3]
□* <u>Review terr</u>	nperature data on 03-1-0	1-3 Attachment 3 and determine:
□* <u>The adi</u>	minsitrative limit of 90F was	s exceeded
□* <u>The Tec</u>	ch Spec limit of 100F was e	exceeded
<u>Standard</u> :	temperatures and determ will compare the pressure TS Figure 3.4.11-1. The c 90F/hr and the TS limit of	e cooldown rates for reactor vessel nine if any limits were exceeded. The operator es and temperatures recorded to curve B of operator inentifies the Administrative Limit of f 100F/hr was exceeded in the hour from Suction Temperatures A and B respectively.
<u>Cue</u> :		
<u>Notes:</u>	R643 pt. 5 reads 311F at cooldown rate during th	t 0300 and 215F at 0400 for a 96F/hr nis period.
	R643 pt. 6 reads 311F at cooldown rate during th	t 0300 and 215F at 0400 for a 96F/hr nis period.
		SAT / UNSAT



Step 2: 03-1-01-3 A	ttachment 3		
□* <u>Complete the</u> <u>Attachment 3</u>		cooldown data sheet of 03-1	<u>1-01-3</u>
\Box^* <u>Check the</u>	Tech Spec Acceptance	Criteria as "Unacceptable"	
\Box^* <u>Check the</u>	Admin Limit Criteria as '	<u>'Unacceptable"</u>	
Initial as Ve	erifier on right colum of t	he Cooldown table	
☐ Sign the "R	eview performed by" lin	e at the bottom of the page	
<u>Standard</u> : Fi	ills out the data sheet co	prrectly	
<u>Cue</u> :			
<u>Notes:</u> S	ee attached Key		
			SAT / UNSAT

Task Standard(s):

Review the cooldown record data sheet for plant shut down in accordance with 03-1-01-3 and Tech Spec 3.4.11 and identify the Tech Speck and Administrative cooldown rate limits have been exceeded.

SAT / UNSAT

DATA SHEET I PLANT SHUTDOWN HEATUP/COOLDOWN DATA SHEETS SAFETY RELATED

SHEET 1 of 1

Record Every 30 Minutes; Recorder 1B21-R643 suggested for temps, IF NOT available, PDS May be used.

Date	REACTOR VESSEL TEMPERATURES PRESSURE									
Today	R643 Pt.1	R643 Pt.2 BOTTOM	R643 <mark>Pt.3</mark> SHE <mark>:LL</mark>	R643 Pt.4 BOTTOM	R643 Pt.5	R643 Pt.6	REACTOR	TEMPS MEET TS CURVE per	INIT	IALS
TIME	HEAD FLANGE	HEAD	FLANGE	DRAIN	RECIRC A SUCT	RECIRC B SUCT	PRESSURE	SR3.4.11.1** Y/N	PERF	VERIF*
0200 (Start Time)	430	308	40 <mark>1</mark>	349	370	372	184	Y	mp	
<u>02</u> 30**	406	284	38 <mark>8</mark>	325	344	345	112	Y	mp	
03_00	375	258	359	303	311	313	85	Y	mp	
<u>03</u> 30	348	231	329	249	264	266	49	Y	mp	
04_00	305	188	289	217	215	212	37	Y	mp	
<u>04</u> 30	297	175	294	199	201	203	22	Y	mp	
<u>05</u> 00	289	158	279	194	197	199	10	Y	mp	

*Tech Spec Acceptance Criteria: *Verifier to EVALUATE every 60-minute segment to ensure H/U, C/D limits (< 100°F/Hr) are NOT exceeded.

Every 30 minutes **COMPARE head flange temperature, shell flange temperature <u>AND</u> reactor pressure to **ENSURE** reactor metal temperature vs. reactor pressure is to the right of the curve as required in Tech Spec SR 3.4.11.1.

Tech Spec Acceptar	nce Criteria:	Acceptable []	Unacceptable [X]		Admin Limit Criteria	ı (≤ 90°F/HR):	Acceptable []	Unacceptable [X]
Review performed b	У			/		/		
		(Reactor Operator)		Date	Time		
DEFICIENCIES:	CR Issued # _		I	LCO Ente	ered #			



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR2 Revision: 1 JOB PERFORMANCE MEASURE

Admin Task: Review Cooldown Record

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The Plant is in Mode 3.
- Plant cooldown is in progress for a planned shutdown.
- A non-licensed operator has collected cooldown data using 03-1-01-3 Attachment 3, but no reviews have been performed.

Initiating Cue(s):

• You have been directed to review the cooldown data recorded by the non-licensed operator as the Reactor Operator in accordance with 03-1-01-3 to determine whether any limits have been exceeded.

INTEGRATED OPERATING INSTRUCTION

03-1-01-3	Revision: 118
Attachment III	Page 1 of 3

DATA SHEET I PLANT SHUTDOWN HEATUP/COOLDOWN DATA SHEETS SAFETY RELATED

SHEET 1 of 1

Record Every 30 Minutes; Recorder 1B21-R643 suggested for temps, IF NOT available, PDS May be used.

Date		REACT	OR VESSEL							
Today	R643 Pt.1	R643 Pt.2 BOTTOM	R643 Pt.3 SHELL	R643 Pt.4 BOTTOM	R643 Pt.5	R643 Pt.6	DEACTOR	TEMPS MEET TS CURVE per	INIT	IALS
TIME	HEAD FLANGE	HEAD	FLANGE	DRAIN	RECIRC A SUCT	RECIRC B SUCT	REACTOR PRESSURE	SR3.4.11.1** Y/N	PERF	VERIF*
0200 (Start Time)	430	308	401	349	370	372	184	Y	mp	
<u>02</u> 30**	406	284	388	325	344	345	112	Y	mp	
<u>03 </u> 00	375	258	359	303	311	313	85	Y	mp	
<u>03</u> 30	348	231	329	249	264	266	49	Y	mp	
<u>04</u> 00	305	188	289	217	215	212	37	Y	mp	
<u>04</u> 30	297	175	294	199	201	203	22	Y	mp	
<u>05</u> 00	289	158	279	194	197	199	10	Y	mp	

*Tech Spec Acceptance Criteria: *Verifier to **EVALUATE** every 60-minute segment to ensure H/U, C/D limits (< 100°F/Hr) are <u>NOT</u> exceeded. **Every 30 minutes **COMPARE** head flange temperature, shell flange temperature <u>AND</u> reactor pressure to **ENSURE** reactor metal temperature vs. reactor pressure is to the right of the curve as required in Tech Spec SR 3.4.11.1.

Tech Spec Acceptance	e Criteria:	Acceptable []	Unacceptable []	Admin Limit Criteria	(≤ 90°F/HR):	Acceptable []	Unacceptable []
Review performed by_			/		/		
		(Reactor Operator	r)	Date	Time		
DEFICIENCIES: C	R Issued # _		LCO Ente	ered #			
APPROVAL: Shift Sup	ov/Mgr				Date		

03-1-01-3	Revision: 118
Attachment III	Page 2 of 3

DATA SHEET II PLANT SHUTDOWN HEATUP/COOLDOWN DATA SHEETS SAFETY RELATED

Check Recorder Point Used: Recirc A Recirc B Bottom Head I MAINTAIN the Heatup or Cooldown Rate less than the slope of the or (Administrative limit of 90 degree F/hr.)	
MAINTAIN the Heatup or Cooldown Rate less than the slope of the c (Administrative limit of 90 degree F/hr.)	
(Administrative limit of 90 degree F/hr.)	Drain 🗹
	curve.
300	
200	
100	
	7 8
ELASPED TIME (HOURS)	0.000



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-2011AR3
Revision: 1
Page: 1 of 10
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRA	AM:								
	NRC Operating Exam								
JPM-AR3									
Time Critical	Alternate Path Validation Time: 25 mi	n							
TITLE:									
	Determine Tagging Requirements								
New Materia	I Minor Revision Major Revision	Cancellation							
REASON FOR RE THIS DOCUMEN									
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()								
Prepared By:	Mark Pait	5/24/2011							
	**Preparer	Date							
Ops Review ^{++:}	Keith Huff	10/5/2011							
	Technical Reviewer (e.g., SME, line management)	Date							
Validated By:	Chris Laird	10/5/2011							
	Training Representative	Date							
Approved By:	Kane Ryder	10/5/2011							
Approved Dy.	⁺ Discipline Training Supervisor	Date							
		Duto							
Approval Date:*_	10/5/2011								

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
	INITIAL RECEIPT		RETURN RECEIPT	FINAL ACCEPTANCE
TRANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR3 Revision: 1 JOB PERFORMANCE MEASURE

Admin Task:

Determine Tagging Requirements

Setting:	Classroom
<u>Type</u> :	RO
<u>Task</u> :	CRO-ADMIN-005
<u>K&A</u> :	2.2.13 (4.1/4.3) 2.2.41 (3.5/3.9)
Safety Function:	NA
Time Required:	25 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	EN-OP-102, Protective and Caution Tagging
	EN-OP-102-01, Protective and Caution Tagging Forms and Checklist
	04-S-01-P64-1, Fire Protection Water System SOI
	M-0035A, E-0231-2, J-0204-2
Handout(s):	EN-OP-102, Protective and Caution Tagging
	04-S-01-P64-1, Fire Protection Water System SOI
	M-0035A, E-0231-2, J-0204-2
	Blank Tagout Tags Sheets
<u># Manipulations:</u>	NA
<u># Critical Steps</u> :	2
<u>Group:</u>	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR3 Revision: 1

Page: 3 of 10

JOB PERFORMANCE MEASURE

X 7	TT	T 0.
Name:	Time Start:	Time Stop:

Initial Condition(s):

- The Plant is operating at rated power.
- The Motor Driven Fire Pump C002-N Controller needs to be replaced.

Initiating Cue(s):	
	are a Tagout Tags Sheet using EN-OP-102-01 Attachment 9.3 e Motor Driven Fire Pump C002-N for this maintenance.
Restoration Configuration is	not required.
• The next sequential tag seria	number is "01."



<u>Admin Task</u>: Determine Tagging Requirements

Notes: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• The operator will determine the proper isolations for the Motor Driven Fire Pump.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: EN-OP-102 5.3 [2] (e) / Att. 9.2							
\Box^* The operator must determine minimum	um Tagout boundaries to include:						
□* <u>52-11305 (MD Fire Pump Breaker)</u>							
□* <u>52-1P13229 (STRIP HEATER MO</u>	<u>TOR DRIVEN FIRE PUMP)</u>						
HS M602 (Control Room Manual S	tart Pushbutton)						
Standard: Determines appropriate I	boundaries.						
<u>Cue</u> :							
Notes: See the attached KEY f	or details.						
	SAT / UNSAT						



Step 2: EN-OP-10	2 5.3 [4]	
	<u>ne <i>Tagout Tags Sheet o</i>r</u> d Tagout Tags Sheet KEY	<u>EN-OP-102-01 Attachment 9.3</u>
Standard:	Completes the Tagout from Step 1.	Tags Sheet with required components
<u>Cue</u> :		
<u>Notes:</u>	EN-OP-102 Attachme Tagging Sequence g	nt 9.2 section 7.0 contains the uidance.
	JPM complete when the Sheet.	e operator completes the Tagout Tags
		SAT / UNSAT

Task Standard(s):

All required isolations are identified and correctly documented on the Tagout Tags Sheet in accordance with EN-OP-102.

SAT / UNSAT



<u>Admin Task</u>: Determine Tagging Requirements

Follow-Up Questions & Answers:

Comments:

Entergy

INFORMATIONAL USE

EN-OP-102-01

Protective and Caution Tagging Forms & Checklist

ATTACHMENT 9.3

TAGOUT TAGS SHEET

		CLEARANCE: MANUAL		TA	goυτ: <u>Χ</u>	(XX	_				
Tag	Tag	Equipment	Dlaga	Discoment	Place.	Place.	Dest	Destantion	Rest. 1st	Rest. 2nd Verif	Placement/R
Serial No.	Туре	Equipment Description Equipment Location	Place. Seq.	Placement Configuration	1st Verif Date/Time	2nd Verif Date/Time	Rest. Seq.	Restoration Configuration	Verif Date/Time	Date/Time	emoval Tag Notes
1	<u>*D</u>	* <u>52-11305</u> MD Fire Pump 11BD3	2	<u>*OPEN</u>							
2	<u>*D</u>	* <u>52-1P13229</u> STRIP HEATER MOTOR DRIVEN FIRE PUMP 11P32	3	<u>*OPEN</u>							
3	D	HS M602 MD Fire Pump Remote Start PB SH13-P862	1	Not Depressed							



Give this page to the student

Initial Condition(s):

- The Plant is operating at rated power.
- The Motor Driven Fire Pump C002-N Controller needs to be replaced.

Initiating Cue(s):

- The CRS directs you to prepare a Tagout Tags Sheet using EN-OP-102-01 Attachment 9.3 (Provided) to De-energize the Motor Driven Fire Pump C002-N for this maintenance.
- Restoration Configuration is not required.
- The next sequential tag serial number is "01."

Entoro	NUCLEAR MANAGEMENT	NON-QUALITY RELATED	EN-OP-102-01	REV. 7
- Entergy	MANUAL	INFORMATIONAL USE	PAGE 7 O	F 26

Protective and Caution Tagging Forms & Checklist

ATTACHMENT 9.3

TAGOUT TAGS SHEET

	С	LEARANCE: <u>MANUAL</u>		TAGOUT	: <u>XXXX</u>						
Tag Serial No.	Tag Type	Equipment Equipment Description Equipment Location	Place. Seq.	Placement Configuration	Place. 1st Verif Date/Time	Place. 2nd Verif Date/Time	Rest. Seq.	Restoration Configuration	Rest. 1st Verif Date/Time	Rest. 2nd Verif Date/Time	Placement/R emoval Tag Notes

Entoro	NUCLEAR MANAGEMENT	NON-QUALITY RELATED	EN-OP-102-01	REV. 7
- Entergy	MANUAL	INFORMATIONAL USE	PAGE 7 O	F 26

Protective and Caution Tagging Forms & Checklist

ATTACHMENT 9.3

TAGOUT TAGS SHEET

	С	LEARANCE: <u>MANUAL</u>		TAGOUT	: <u>XXXX</u>						
Tag Serial No.	Tag Type	Equipment Equipment Description Equipment Location	Place. Seq.	Placement Configuration	Place. 1st Verif Date/Time	Place. 2nd Verif Date/Time	Rest. Seq.	Restoration Configuration	Rest. 1st Verif Date/Time	Rest. 2nd Verif Date/Time	Placement/R emoval Tag Notes



JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR Number: GJPM-OPS-2011AR4 **Revision: 0** Page: 1 of 7 **Rtype: QA Record** Number of pages Date _____ Initials _____

TRAINING PROGRA	AM:					
NRC Operating Exam						
	JPM-AR4					
Time Critical						
TITLE: Primary Containment Water Level Determination EOP Attachment 29						
New Material	□ New Material					
<u>REASON FOR REVISION</u> : Original electronic copy was lost. <u>THIS DOCUMENT REPLACES</u> : GJPM-OPS-ADMR94						
REVIEW / APPROVAL (Print Name): TEAR Approval ()						
Prepared By: _	Mark Pait **Preparer	6/1/2011 Date				
Ops Review ^{++:}	Ops Review ^{++:} Keith Huff Technical Reviewer (e.g., SME, line management)					
Validated By:	10/5/2011					
	Training Representative	Date				
Approved By:	Kane Ryder ⁺ Discipline Training Supervisor	10/5/2011 Date				
Approval Date:*	10/5/2011	Duit				

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	X Not Applicable		
	INITIAL RECEIPT BY RM (DATE/INITIAL)	RETURNED FOR CORRECTIONS (DATE/INITIAL)	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR4 **Revision: 0** Page: 2 of 7 **JOB PERFORMANCE**

MEASURE

Primary Containment Water Level Admin Task: Determination

Setting:	Classroom
<u>Type</u> :	RO
<u>Task</u> :	CRO-EP-29
<u>K&A</u> :	295029 EA2.01 (3.9/3.9) EA2.03 (3.4/3.5) 2.4.21 (4.0/4.6)
	2.1.25 (3.9/4.2) 2.1.20 (4.6/4.6)
Safety Function:	5 – Containment Integrity
Time Required:	15 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	05-S-01-EP-1 Attachment 29
Handout(s):	05-S-01-EP-1 Attachment 29
	SPDS Screen shot, Panel photo for E51-R604
<u># Manipulations:</u>	N/A
<u># Critical Steps:</u>	1
<u>Group:</u>	N/A

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

None •



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR4


Revision: 0 Page: 3 of 7

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- A LOCA has occurred.
- Suppression Pool water level indication is off scale high.
- RCIC is shut down with suction aligned to the suppression pool.

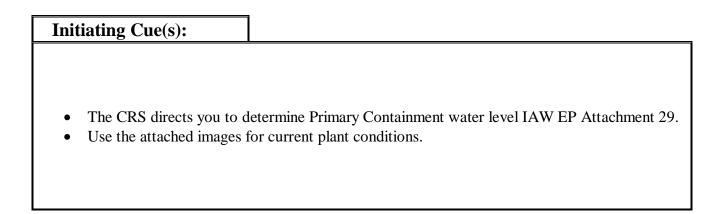



Admin Task:Primary Containment Water LevelDetermination

<u>Notes</u>: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• Using EP Attachment 29 and the attached images to obtain RCIC Suction Pressure and Containment Pressure, determine Primary Containment Water Level from the Delta Pressure to Ctmt Level Conversion Table, EP Attachment 29 Table 1.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: EP-1 Att	. 29 step 2.4				
\Box^* Determine RCIC Pump Suction Pressure indicated on E51-R604 is 15 psig.					
<u>Standard</u> :	Determine from attache	d photo RCIC Pump Suction F	Pressure.		
<u>Cue</u> :					
<u>Notes:</u>	•	since RCIC is already secur m the suppression pool.	ed and		
		S	AT / UNSAT		

Step 2: EP-1 Att. 2	29 step 2.5				
□* <i>Determine Containment Pressure indicated on SPDS is 2.2 psig.</i>					
Standard:	Determine from attach	ed screen shot Containment Pressure.			
<u>Cue</u> :					



ENTERGY NUCLEAR Number: GJPM-OPS-2011AR4 Revision: 0 JOB PERFORMANCE MEASURE Page: 5 of 7

Notes:

SAT / UNSAT

Step 2: EP-1 Att. 29 step 2.6
Determine delta pressure to be 12.8 psig by subtracting Containment Pressure from <u>RCIC Pump Suction Pressure.</u>
Standard: Determines delta pressure to be 12.8 psig.
<u>Cue</u> :
Notes:
SAT / UNSAT
Step 2: EP-1 Att. 29 step 2.7
\square^* Determine Primary Containment water level to be 35.5 ft.
Standard: Determines Primary Containment water level using EP Attachment 29 Table 1.
<u>Cue</u> :
Notes:

SAT / UNSAT

<u>Task Standard(s)</u>: Determine Containment Water level us

Determine Containment Water level using Containment pressure and RCIC Suction pressure and 05-S-01-EP-1 Attachment 29.

SAT / UNSAT



Admin Task: Primary Containment Water Level Determination

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- A LOCA has occurred.
- Suppression Pool water level indication is off scale high.
- RCIC is shut down with suction aligned to the suppression pool.

Initiating Cue(s):	
	etermine Primary Containment water level IAW EP Attachment 29.
• Use the attached images	for current plant conditions.



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS1

JOB PERFORMANCE MEASURE

 Number: GJPM-OPS-2011AS:

 Revision: 0

 Page: 1 of 7

 Rtype: ______

 QA Record

 Number of pages ______

 Date ______ Initials ______

TRAINING PROGRAM:				
NRC Operating Exam				
	JPM-AS1			
Time Critical	Alternate Path Validation Time: 15 min			
TITLE:				
]	Determine Fire Watch Requirem	ents		
New Material	Minor Revision Major Revision	Cancellation		
<u>REASON FOR REVISION:</u> <u>THIS DOCUMENT REPLACES</u> :				
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()			
Prepared By:	Mark Pait	5/24/2011		
	**Preparer	Date		
Ops Review ^{++:}	Mark Goodwin	10/4/2011		
Technical Reviewer (e.g., SME, line management)		Date		
Validated By:	Keith Huff	10/4/2011		
	Training Representative	Date		
Approved By:	Kane Ryder	10/5/2011		
	⁺ Discipline Training Supervisor	Date		
Approval Date:*	10/5/2011			

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE TRANSMITTED TO RM	INITIAL RECEIPT BY RM (DATE/INITIAL)	RETURNED FOR CORRECTIONS (DATE/INITIAL)	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)

04-1-01-T42-1 Rev 28



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS1 Revision: 0 JOB PERFORMANCE MEASURE Page: 2 of 7

Admin Task:

: Determine Fire Watch Requirements

Setting:	Classroom
<u>Type</u> :	RO
<u>Task</u> :	CRO-P64-NORM-7
<u>K&A</u> :	2.1.2 (4.1/4.0) 2.1.8 (3.4/4.1) 2.1.20 (4.6/4.6) 2.2.12 (3.7/4.1)
	2.2.22 (4.0/4.7) 2.4.25 (3.3/3.7)
Safety Function:	NA
Time Required:	20 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	06-OP-SP64-M-0043, Fire Doors Alarm Check
	TRM 6.2.8, Fire Maps
Handout(s):	06-OP-SP64-M-0043, Fire Doors Alarm Check
	Copy of Tech Specs/TRM
	Fire Watch Maps for Auxiliary Building elevations 119' and 245' and
	control building elevation 111'
<u># Manipulations:</u>	NA
<u># Critical Steps</u> :	2
Group:	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS1 Revision: 0

Page: 3 of 7

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:
Initial Condition(s):		

- The Plant is operating at rated power.
- All fire detection devices are functioning properly.
- A partial 06-OP-SP64-M-0043, Fire Doors Alarm Check was just performed on the following doors: (1) Elect Pen Rm 1A221 door number 1A212, (2) Emerg S/D Rm OC208A door number OC208, and (3) Sec Ctmt Door 1A604.
- An operator reports the following after completing the 06-OP-SP64-M-0043:
 - Elect Pen Rm 1A221 door 1A212:
 - Door <u>does not</u> latch after being fully opened and allowing the closure mechanism to pull the door shut; however, when you pull the door it latches.
 - Alarms after 1 second upon opening.
 - Emerg S/D Rm OC208A door OC208:
 - Has a deep gouge/dent 10" long on one side on the bottom right quadrant but does not penetrate the door skin.
 - Seam has separated next to the 10" gouge.
 - Alarms after 30 seconds upon opening.
 - Sec Ctmt Door 1A604:
 - Has a rust patch on the Aux Building Roof side that has left a 3 in² hole in the skin of the door (the inside door skin is not damaged).
 - Has not alarmed 4 minutes after opening.

- The Shift Manager asks you to determine the fire watch requirements associated with the indications given.
- Use the provided references.



<u>Admin Task</u>: Determine Fire Watch Requirements

Notes: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• The operator will determine that tech spec fire door OC208 is INOP and set a fire watch in accordance with TR 6.2.8 for the Division 1 ESF Switchgear Room (Control Building Elevation 111').

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 06-OP-SP64-M-0043	
 The operator evaluates the given constrained initiating cues and determines the formula initiating cues and determines the formula in the formula in the spec Door 1A212 is OPERA Tech Spec Door 0C208 is INOP become constrained in the spec Door 0C208 is INOP become constr	BLE.
Standard: Determine Door OC208	is INOP
<u>Cue</u> :	
Notes:	
	SAT / UNSAT



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS1 Revision: 0 JOB PERFORMANCE MEASURE

Step 2: TR 6.2.8		
	e watch for action A.2.2	olish a continuous fire watch for action A.1 on at least one side of door OC208 (see
Standard:	Establishes Fire Wate	h
<u>Cue</u> :		
<u>Notes:</u>	Switchgear Room to The candidate may s which requires a fire	oor from the Division 1 ESF the Remote Shutdown Panels Room. specifically identify a room number watch. In this case, either room DC202 is acceptable.
	JPM is complete when determined.	n Fire Watch requirements are
		SAT / UNSAT

Task Standard(s):

The operator establishes a fire watch at least hourly for the Division 1 ESF Switchgear Room due to declaring tech spec door OC208 INOP in accordance with 06-OP-SP64-M-0043 and TR 6.2.8 Condition A.

SAT / UNSAT



<u>Admin Task</u>: Determine Fire Watch Requirements

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s): • The Plant is operating at rated power. • All fire detection devices are functioning properly. • A partial 06-OP-SP64-M-0043, Fire Doors Alarm Check was just performed on the following doors: (1) Elect Pen Rm 1A221 door number 1A212, (2) Emerg S/D Rm OC208A door number OC208, and (3) Sec Ctmt Door 1A604. • An operator reports the following after completing the 06-OP-SP64-M-0043: o Elect Pen Rm 1A221 door 1A212: Door does not latch after being fully opened and allowing the closure mechanism to pull the door shut; however, when you pull the door it latches. Alarms after 1 second upon opening. • Emerg S/D Rm OC208A door OC208: Has a deep gouge/dent 10" long on one side on the bottom right quadrant but does not penetrate the door skin. • Seam has separated next to the 10" gouge. Alarms after 30 seconds upon opening. • Sec Ctmt Door 1A604: Has a rust patch on the Aux Building Roof side that has left a 3 in² hole in the skin of the door (the inside door skin is not damaged). Has not alarmed 4 minutes after opening.

- Determine the fire watch requirements associated with the indications given.
- Use the provided references.



CONTROL BUILDING

ELEVATION 95'-0"




|-| |-2 |-3



IONIZATION DETECTOR

MANUAL PULL STATION

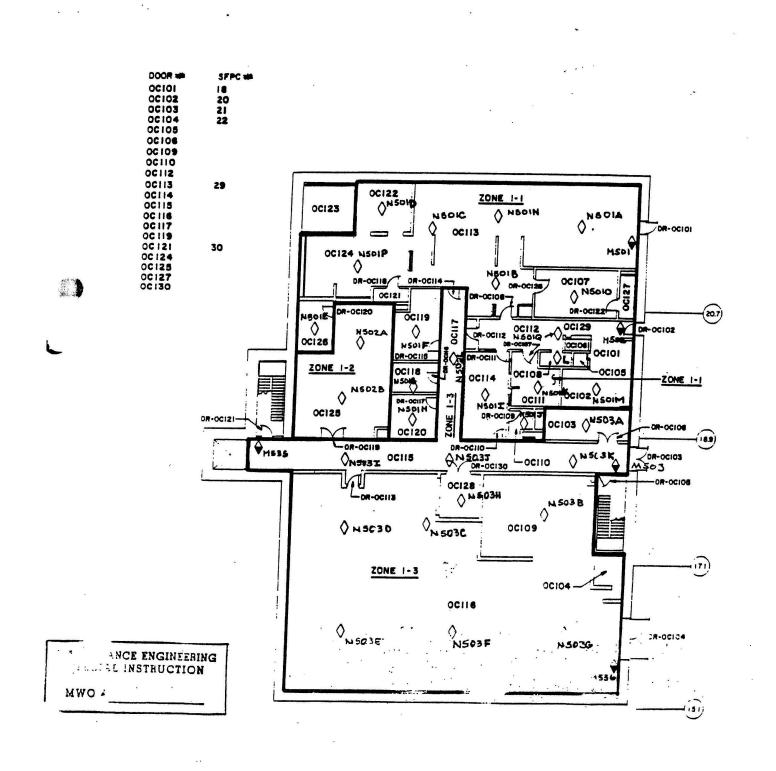

(нв)

×



 \bigcirc

-(N)-

AUXILIARY BLDG. ELEVATION 119'-0"

.

SFPC #

998 999 1001

988

ZONE #


2-02


2-03 2-04

2-18

IONIZATION DETECTOR

MANUAL PULL STATION

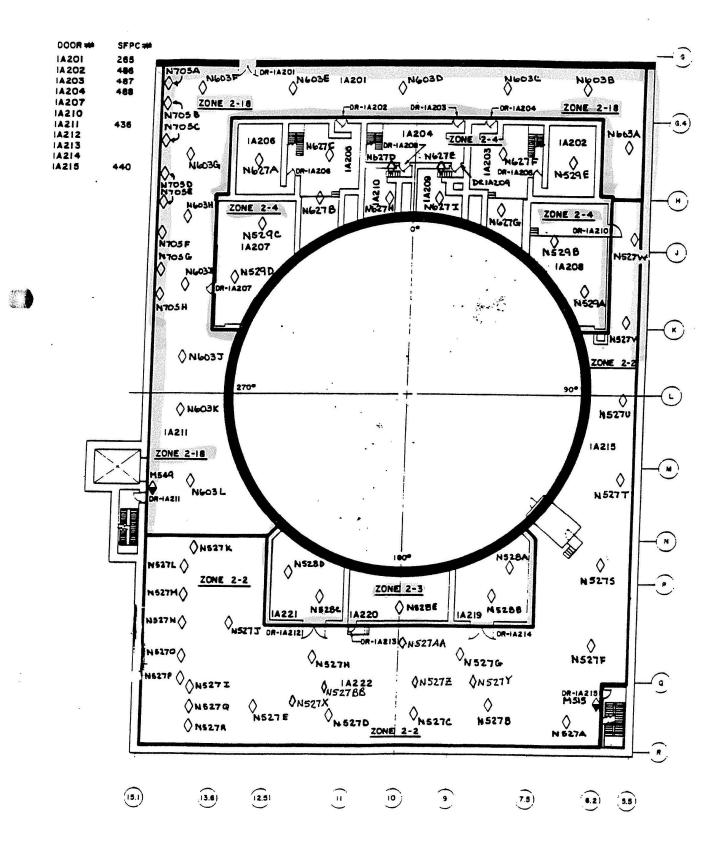

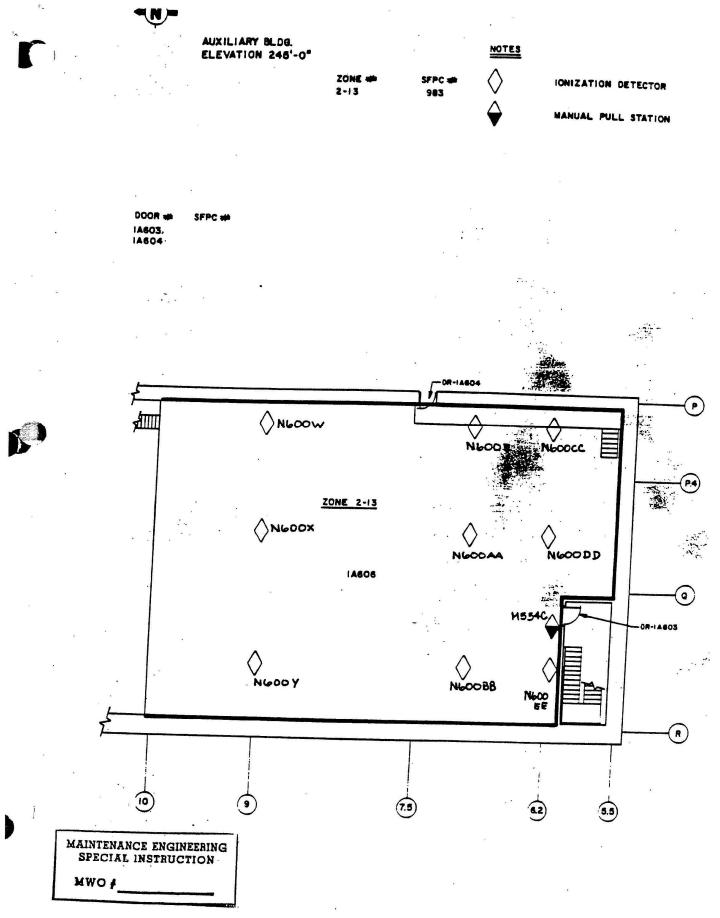



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

 Number: GJPM-OPS-2011AS2

 Revision: 1

 Page: 1 of 7

 Rtype: ______

 QA Record

 Number of pages ______

 Date ______ Initials ______

TRAINING PROGRAM:

NRC Operating Exam			
	JPM-AS2		
Time Critical	Alternate Path Validation Time: 15 mi	n	
TITLE:			
Manı	1al Risk Assessment – Plant Saf	ety Index	
🛛 New Material	Minor Revision Major Revision	n Cancellation	
REASON FOR RE			
REVIEW / APPRO	OVAL (Print Name): TEAR Approval ()		
Prepared By:	Mark Pait	10/26/2011	
· · _	**Preparer	Date	
Ops Review ^{++:}	Marty McAdory	10/26/2011	
	Technical Reviewer (e.g., SME, line management)	Date	
Validated By:	Steve Reeves	10/26/2011	
	Training Representative	Date	
Approved By:	Kane Ryder	10/26/2011	
	⁺ Discipline Training Supervisor	Date	
Approval Date:*	10/27/2011		

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE	INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
TRANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)

04-1-01-T42-1 Rev 28



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS2 Revision: 1 Page: 2 of 8 MEASURE

Admin Task:

Manual Risk Assessment – Plant Safety Index

Setting:	Classroom
<u>Type</u> :	SRO
<u>Task</u> :	SRO-ADMIN-15
<u>K&A</u> :	2.1.20 (4.6/4.6); 2.1.25 (3.9/4.2); 2.2.17 (2.6/3.8)
Safety Function:	NA
Time Required:	15 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	01-S-18-6, Risk Assessment of Maintenance Activities
Handout(s):	01-S-18-6, Risk Assessment of Maintenance Activities
<u># Manipulations:</u>	NA
# Critical Steps:	1
<u>Group:</u>	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS2

Revision: 1 Page: 3 of 8

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The plant is operating at 90% power with the following:
 - Division 1 Diesel Generator is out of service for repairs
 - 12 days ago a crane collided into the SSW 'A' pump house which breached the pump house outer wall (large through-wall crack).
 - SSW 'A' has been determined to be OPERABLE
- A severe thunder storm is over the site.
- The EOOS computer is <u>not</u> available.

- The Shift Manager directs you to perform a risk assessment to determine the risk color for these current conditions.
- This is not a time critical task.



Admin Task: Manual Risk Assessment – Plant Safety Index

Notes: (Notes to Evaluator)

Task Overview: (Detailed description of task)

• This task is to use GGNS procedure 01-S-18-6 (Risk Assessment of Maintenance Activities) to perform a risk assessment and determine the associated risk color.

<u>Tasks</u>: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 01-S-18-6 step 6.5.2.a		
When the EOOS tool is not available for risk assessments, use Attachment IV (Level 1 out of service guidance table for use when EOOS is unavailable) for EOOS related risk and qualitative guidance in Attachment V.		
Standard: Recognizes need to use b perform this risk assessm	ooth Attachment IV and Attachment V to ent.	
<u>Cue</u> :		
Notes:		
	SAT / UNSAT	

Step 2: Attachment IV		
Review Attachment IV		
Determine that P75A, 'A' DIESEL GEN, out-of-service yields a risk color of GREEN.		
Determine that Weather/Grid, Seve YELLOW.	ere Thunder Storm, yields a risk color of	
Standard: Determines correct risk c	colors.	
<u>Cue</u> :		
<u>Notes:</u>		
	SAT / UNSAT	

= Enterov	/

0)		
Step 3: Attachment V Table 1		
□* Complete Attachment V, Table 1 Risk Assessment		
Check "Yes" Applicability for, "Exterior flood barrier or tornado missile barrier not available"		
* <u>Check "Yes" Applicability for, "Severe weather forecasted or imminent, with</u> tornado missile barrier not available"		
Standard: Checks both items "YES" and boxes are checked as "NO."	refers to Table 4. All other Applicability	
Cue: Examinee may ask Examiner if Engi degree to which the SSW 'A' pump h amount to an unavailable tornado m	nouse wall is damaged does infact issile barrier.	
If asked, the answer is "Yes, that tor considered to be unavailable."	nado missile barrier is	
<u>Notes:</u>		
	SAT / UNSAT	



Step 4: Attachment V Table 4		
□* Review Attachment V, Table 4 and	determine proper risk color	
	A' pump house wall (i.e., a "tornado missile tem that is not available") for greater than 7 risk color of YELOW.	
barrier for a required Tech Spec system severe thunder storm condition is eq	A' pump house wall (i.e., a "tornado missile stem that is not available") combined with a quivalent to the first 'Plant Configuration' uration yields a risk color of ORANGE.	
Standard: Determines the correct r	risk colors.	
<u>Cue</u> :		
Notes: Task is complete when the Examinee reports to his Shift Manager that the risk color is ORANGE.		
	SAT / UNSAT	

Task Standard(s):

Risk Assessment is performed per 01-S-18-6, applying at least Attachment IV and Attachment V Tables 1 and 4, to determine that a risk color of ORANGE exists for the current plant conditions.

SAT / UNSAT



Admin Task: Manual Risk Assessment – Plant Safety Index

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s): The plant is operating at 90% power with the following: Division 1 Diesel Generator is out of service for repairs 12 days ago a crane collided into the SSW 'A' pump house which breached the pump house outer wall (large through-wall crack). SSW 'A' has been determined to be OPERABLE A severe thunder storm is over the site. The EOOS computer is not available.

- The Shift Manager directs you to perform a risk assessment to determine the risk color for these current conditions.
- This is not a time critical task.



JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR Number: GJPM-OPS-2011AS3 **Revision: 0** Page: 1 of 8 **Rtype:** QA Record Number of pages Date _____ Initials _____

TRAINING PROGRA	AM:			
NRC Operating Exam				
	JPM-AS3			
Time Critical	Alternate Path Validation Time: 25 min			
TITLE:				
	Review Adequacy of a Tagout			
New Material	Minor Revision Major Revision	Cancellation		
<u>REASON FOR REVISION</u> : <u>THIS DOCUMENT REPLACES</u> :				
REVIEW / APPROVAL (Print Name): TEAR Approval ()				
Prepared By:	Mark Pait	5/24/2011		
	**Preparer	Date		
Ops Review ^{++:}	Mark Goodwin	10/6/2011		
	Technical Reviewer (e.g., SME, line management)	Date		
Validated By:	Keith Huff	10/6/2011		
_	Training Representative	Date		
Approved By:	Kane Ryder	10/6/2011		
	⁺ Discipline Training Supervisor	Date		
Approval Date:*	10/6/2011			

* Indexing Information

** The requirements of the Training Material Checklist have been met.

+ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE	INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
TRANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS3 Revision: 0 JOB PERFORMANCE MEASURE Page: 2 of 7

Admin Task:

Review Adequacy of a Tagout

Setting:	Classroom
<u>Type</u> :	SRO
<u>Task</u> :	SRO-ADMIN-ADMIN-48
<u>K&A</u> :	2.2.13 (4.1/4.3) 2.2.41 (3.5/3.9)
Safety Function:	NA
Time Required:	25 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	EN-OP-102, Protective and Caution Tagging
	EN-OP-102-01, Protective and Caution Tagging Forms and Checklist
	04-S-01-P64-1, Fire Protection Water System SOI
	M-0035A, E-0231-02, J-0204-2
Handout(s):	EN-OP-102, Protective and Caution Tagging
	04-S-01-P64-1, Fire Protection Water System SOI
	M-0035A, E-0231-02, J-0204-2
	Tagout Tags Sheet (Attached)
<u># Manipulations</u> :	NA
<u># Critical Steps</u> :	1
<u>Group:</u>	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS3 Revision: 0

JOB PERFORMANCE Page: 3 of 7

MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The Plant is operating at rated power.
- The Motor Driven Fire Pump C002-N needs a new impeller.
- The pump motor will need to be removed for access.

- As CRS you are tasked to verify the adequacy of the proposed tagout for work on the Motor Driven Fire Pump C002-N.
- Document errors or inadequate boundaries.



<u>Admin Task</u>: Review Adequacy of a Tagout

<u>Notes</u>: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• The operator will determine the proper isolations work on the MDFP.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: EN-OP-102 5.3 [2] (e) / Att. 9.2
☐ The operator must determine minimum Tagout boundaries to include:
NSP64-F160 (Mtr Driven Fw Pmp Casing Dr)
NSP64-F108 (Mtr Driven Fw Pmp Suct)
NSP64-F177 (Mtr Driven Fw Pmp Test Loop Isol)
□ NSP64-F016 (Mtr Driven Fw Pmp Disch)
52-11305 (MD Fire Pump Breaker)
52-1P13229 (STRIP HEATER MOTOR DRIVEN FIRE PUMP)
HS M602 (Control Room Manual Start Pushbutton)
Standard: Determines appropriate boundaries.
<u>Cue</u> :
Notes: The valves listed are the minimum required valves required to perform work. Any combination of valves that adequately isolates the MDFP and provides a drain or vent path will meet the requirements of this step.
SAT / UNSAT



Step 2:			
□* <u>Th</u> e	Operator documents the following:		
□*	\square^* NSP64-F177 is required to isolate the test loop from the MDFP.		
*	\square^* <u>52-1P13229 is required to isolate the strip heater power.</u>		
	HS-M602 is required by EN-OP-102 Att 9.2 section 1.1 (this tag is not required for safety of personnel).		
	HS-M002 is not necessary (or practical since it is a pushbutton).		
<u>Stai</u>	ndard: Documents deficiencies.		
<u>Cue</u>	2:		
<u>Not</u>	tes:These requirements can be specifically found in EN-OP- 102 Attachment 9.2 sections 1.1 and 2.1 and Attachment 9.3 sections 1.1 and 1.4. Any words that demonstrate an equivalent understanding is acceptable.The task is complete when the operator determines the adequacy for this Tagout.		
	SAT / UNSAT		

Task Standard(s):	
The operator indentifies the tagout lacks the required isolations	per EN-OP-102.
	F ·······
	SAT / UNSAT



<u>Admin Task</u>: Review Adequacy of a Tagout

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The Plant is operating at rated power.
- The Motor Driven Fire Pump C002-N needs a new impeller.
- The pump motor will need to be removed for access.

- As CRS you are tasked to verify the adequacy of the proposed tagout for work on the Motor Driven Fire Pump C002-N.
- Document errors or inadequate boundaries.

Entergy	NUCLEAR MANAGEMENT MANUAL	NON-QUALITY RELATED	EN-OP-102-01	REV. 7
		INFORMATIONAL USE	PAGE 7 OF 26	

Protective and Caution Tagging Forms & Checklist

ATTACHMENT 9.3

TAGOUT TAGS SHEET

		CLEARANCE: MANUAL		ΤΑ	GOUT: <u>Χ</u>	(XX	_				
Tag Serial No.	Tag Type	Equipment Equipment Description Equipment Location	Place. Seq.	Placement Configuration	Place. 1st Verif Date/Time	Place. 2nd Verif Date/Time	Rest. Seq.	Restoration Configuration	Rest. 1st Verif Date/Time	Rest. 2nd Verif Date/Time	Placement/R emoval Tag Notes
1	D	NSP64-F160 Mtr Driven Fw Pmp Casing Dr BLDG FW PUMP HOUSE ELEV 132'	5	OPEN							
2	D	NSP64-F108 Mtr Driven Fw Pmp Suction BLDG FW PUMP HOUSE ELEV 132'	4	CLOSE							
4	D	NSP64-F016 Mtr Driven Fw Pmp Disch BLDG FW PUMP HOUSE ELEV 132'	3	CLOSE			7				
5	D	52-11305 MD Fire Pump 11BD3	2	OPEN	Ġ,						
6	D	HS M002 MD Fire Pump Local Stop PB SH22-P134	1	Depressed							



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-2011AS4
Revision: 1
Page: 1 of 6
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRA	AM:			
NRC Operating Exam				
	JPM-AS4			
Time Critical	Alternate Path Validation Time: 15 min			
TITLE:				
	Review Radwaste Discharge Per	mit		
New Material	Minor Revision Major Revision	Cancellation		
<u>REASON FOR REVISION</u> : <u>THIS DOCUMENT REPLACES</u> :				
REVIEW / APPROVAL (Print Name): TEAR Approval ()				
Prepared By:	Mark Pait	6/2/2011		
	**Preparer	Date		
Ops Review ^{++:}	Mark Goodwin	10/6/2011		
	Technical Reviewer (e.g., SME, line management)	Date		
Validated By:	Keith Huff	10/6/2011		
• _	Training Representative	Date		
Approved By:	Kane Ryder	10/6/2011		
	⁺ Discipline Training Supervisor	Date		
Approval Date:*	10/6/2011			

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE TRANSMITTED TO RM	INITIAL RECEIPT BY RM (DATE/INITIAL)	RETURNED FOR CORRECTIONS (DATE/INITIAL)	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)

04-1-01-T42-1 Rev 28



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS4 Revision: 1 JOB PERFORMANCE MEASURE Page: 2 of 6

Admin Task:

Review Radwaste Discharge Permit

Setting:	Classroom
<u>Type</u> :	SRO
Task:	SRO-ADMIN-ADMIN-22
<u>K&A</u> :	2.3.6 (2.0/3.8)
Safety Function:	NA
Time Required:	15 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	ODCM, 01-S-08-11 Radioactive Discharge Controls
Handout(s):	01-S-08-11 including a prepared Attachment 1 (attached)
	ODCM (Available)
<u># Manipulations:</u>	NA
# Critical Steps:	1
Group:	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS4 Revision: 1

Page: 3 of 6

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

• Radwaste is preparing for a Batch Liquid Discharge of the Floor Drain Sample Tank "B" A009B.

- Radwaste has asked you to review the Batch Liquid Radwaste Discharge Permit.
- Identify all errors that appear on the provided discharge permit.
- All ODCM calculations were performed correctly.
- This is not a time critical task.



Admin Task: Review Radwaste Discharge Permit

Notes: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• This task is to perform the SRO review of the Batch Liquid Radwaste Discharge Permit performed by the Shift Manager to authorize a controlled release of liquid radwaste.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: EN-OP-102 5.3 [2] (e) / Att. 9.2
\Box^* The operator must identify the following five errors:
The current dilution flow in Part 1 is less than the minimum required dilution flow in Part 2.
The minimum Blowdown Flow Rate Setpoint in Part 3 is 100 gpm vice 6800 gpm.
The maximum Tank Discharge Flow Rate Setpoint in Part 3 is 6800 gpm vice 100 gpm.
\Box^* The Effluent Monitor Alarm Setpoint in Part 3 is 45,200 cpm vice 4,520 cpm.
\Box^* The Effluent Monitor Trip Setpoint in Part 3 is 116,000 cpm vice 11,600 cpm.
Standard: Identifies the five errors.
<u>Cue</u> :
Notes: Task is complete when the operator identifies errors

SAT / UNSAT

Task Standard(s):

The operator indentifies 5 errors in the Batch Liquid Radwaste Discharge Permit.



JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR Number: GJPM-OPS-2011AS4 Revision: 1 Page: 5 of 6

SAT / UNSAT



Admin Task: Review Radwaste Discharge Permit

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):	
 Radwaste is preparing fo A009B. 	r a Batch Liquid Discharge of the Floor Drain Sample Tank "B"

- Radwaste has asked you to review the Batch Liquid Radwaste Discharge Permit.
- Identify all errors that appear on the provided discharge permit.
- All ODCM calculations were performed correctly.
- This is not a time critical task.

GRAND GULF NUCLEAR STATION	ADMINISTRATIVE PROCEDURE		
	01-S-08-11	Revision: 112	
	Attachment I	Page 1 of 4	
BATCH LIQUID RADWAST	E DISCHARGE PERMIT		
<u>YY-MM-DD-01</u> Part 1 Pre-Release Processing		Release Number	
Date <u>Today</u> Time <u>0300</u>			
Tank to be released Floor Drain A009B Volume	<u>28,560 g</u> al		
Tank is isolated. Recirculation started <u>Yesterday/150</u> Date/Time	0		
Dilution flow <u>6,200 gpm</u> Radwaste monitor backg	round reading <u>1,700</u> cpm	1	
	<u>c Pait</u> rator		
Radwaste monitor background reading verified Ka Rad Con	ne Ryder <u>Today/03</u> Iwaste Specialist or /Date/ ntrol Room Supervisor	45 /Time	
Part 2 Pre-Release Analysis		20YY-XXX Rotab Number	
Sample Date Today Time 0450		Batch Number	
One Total Suspended Solids (TSS) sample has been co	ollected and analyzed for the	e month:	
Yes X Initials MR			
NoTSS mg/l (≤ 30 mg/l)			
Minimum dilution factor <u>3.2</u>			
Minimum dilution flow rate setpoint <u>6,800</u> gpm			
Maximum tank discharge flow rate setpoint <u>100</u> gpm	n		
Effluent Monitor Alarm Setpoint <u>4.52 E⁺³</u> cpm (H	li)		
Effluent Monitor Trip Setpoint <u>1.16 E ⁺⁴</u> cpm (H	Hi-Hi)		
The radioactive liquid from the tank designated above is defined by surveillance 06-CH-SG17-P-0041 and 06-CH	within the ALARA criteria I-SP41-P-0035 and may be	a of 10CFR50 App I as released.	
All significant peaks were identified.	Micha Radiocl	ael Rash hemist	
Independent Verification if Effluent Radiation Monitor I	noperable.		
-	-		

NA Radiochemist

Comments:

ADMINISTRATIVE PROCEDURE

01-S-08-11	Revision: 112
Attachment I	Page 2 of 4

ADMINISTRATIVE PROCEDURE

01-S-08-11	Revision: 112
Attachment I	Page 3 of 4

BATCH LIQUID RADWASTE DISCHARGE PERMIT

Part 3 Monitor Setpoint Calibration	
Batch Number (from Part 2) <u>20YY-XXX</u>	
Setpoints Adjusted to:	
Minimum Blowdown Flow Rate Setpoint (Circ Water Blowdown Flow Setpoint) 100 gpm	
Maximum Tank Discharge Flow Rate Setpoint (Liquid Radwaste Effluent Flow Setpoint) <u>6,800</u> gpm	
Effluent Monitor Alarm Setpoint <u>45,200</u> cpm (Hi)	
Effluent Monitor Trip Setpoint 116,000 cpm (Hi-Hi)	
David A Cooper / Today	
I&C Technician Date	
Carlos Dawson / Today	
Verified Date	
• Copies of Pages 1 and 2 of this permit have been placed in the Control Room Setpoint Logbook, and	
• The previous Pages 1 and 2 have been removed.	
The providus Fuges Fund 2 have been removed.	
David A Cooper / Today	
I&C Technician Date	
Carlos Dawson / Today	
Verified Date	
Part 4 Release Authorization	
The designated tank may be released provided the discharge and dilution flows	
meet the criteria of Part 2.	
Shift Manager Date	
Part 5 Release	
Valve lineup Verified/ Independent Verification	
if Radiation Monitor Inop	
From Step 6.4.2e(2): On the date of release , prior to opening SG17-F355 DRAIN BASIN ISOL VLV, have chemistry vertice the Total Suspended Solids analysis for this tank has been completed or is not required. The Total Suspended Solids analysis for this tank has been completed.	rify
□ YES □ Not Required_ /	
Radiation Monitor Reading Radiochemist Date	
Before releasecpm	
Maximum during releasecpm	

ADMINISTRATIVE PROCEDURE

01-S-08-11	Revision: 112
Attachment I	Page 4 of 4

Average during release _____cpm

ADMINISTRATIVE PROCEDURE

01-S-08-11	Revision: 112
Attachment I	Page 5 of 4

BATCH LIQUID RADWASTE DISCHARGE PERMIT

Part 5 (Cont.) Release

Tank Level

Before

After

Gallons Released

Average Release Rate (Tank Discharge Rate GPM)

Flow Rate Indication During Discharge

a) Maximum Radwaste Tank Effluent Flow _____gpm

b) Average Dilution Flow _____ gpm

1) Circulation Water Blowdown Flow _____, ____ gpm

2)* Discharge Canal Flow _____, ____ gpm

* Flow must be estimated at intervals not to exceed every four hours during discharge; N/A if normal indication is operable.

c) If either a) or b) is inop, flow must be estimated at intervals not to exceed every four hours (N/A if normal indication/monitor is operable)

_____ Start _____ Approx. Middle _____ End _____ Flow Time

LCO No.

DATE AND TIME		
VALVES OPEN	VALVES SHUT	ELAPSED TIME
	TOTAL	

Monitor flushed _____

Initials

Operator

Radwaste Specialist or Control Room Supervisor

ADMINISTRATIVE PROCEDURE

01-S-08-11	Revision: 112
Attachment I	Page 6 of 4

BATCH LIQUID RADWASTE DISCHARGE PERMIT

Part 6 Post-Release Analysis

The post-release analysis is based on actual data recorded during the release

Comments:

Radiochemist Date



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-2011AS5
Revision: 1
Page: 1 of 6
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRA	AM:		
NRC Operating Exam			
	JPM-AS5		
Time Critical	Alternate Path Validation Time: 15 min		
TITLE:			
DC 1	Electrical Failures – EAL Detern	nination	
New Material	Minor Revision Major Revision	Cancellation	
<u>REASON FOR REVISION</u> : THIS DOCUMENT REPLACES:			
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()		
Prepared By:	Mark Pait	6/2/2011	
	**Preparer	Date	
Ops Review ^{++:}	Mark Goodwin 10/4/2011		
	Technical Reviewer (e.g., SME, line management)	Date	
Validated By:	Keith Huff	10/5/2011	
Training Representative		Date	
	K D I	10/5/2011	
Approved By:	Kane Ryder Dissipling Testing Supervisor	10/5/2011	
	⁺ Discipline Training Supervisor	Date	
Approval Date:*	10/5/2011		

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE TRANSMITTED TO RM	INITIAL RECEIPT BY RM (DATE/INITIAL)	RETURNED FOR CORRECTIONS (DATE/INITIAL)	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)

04-1-01-T42-1 Rev 28



ENTERGY NUCLEARNumber: GJPM-OPS-2011AS5
Revision: 1JOB PERFORMANCEPage: 2 of 6

MEASURE

Admin Task:

DC Electrical Failures – EAL Determination

Setting:	Classroom
<u>Type</u> :	SRO
<u>Task</u> :	SRO-A&E-015
<u>K&A</u> :	2.4.41 (2.9/4.6)
Safety Function:	NA
Time Required:	15 minutes
Time Critical:	Yes
Faulted:	No
Performance:	Actual
Reference(s):	10-S-01-1, Activation of the Emergency Plan
Handout(s):	10-S-01-1 Flow Charts
<u># Manipulations</u> :	NA
<u># Critical Steps</u> :	1
<u>Group:</u>	NA

Simulator Setup/Required Plant Conditions:

• None

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-2011AS5 Revision: 1

Page: 3 of 6

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The Plant is operating in Mode 3 with a plant shutdown in progress due to loss of DC bus 11DA.
- A bus fault occurred on ESF bus 16AB. Electrical estimates that the bus may be re-energized in approximately 45 minutes.
- An operator reported 20 minutes ago that 11DB bus voltage is 104 VDC and trending down.
- A fire that began 18 minutes ago continues to burn in the Division 3 battery room. Operators immediately de-energized the 11DC bus as soon as the fire started.

Initiating Cue(s):

- Classify the event.
- This is a time critical task.



Admin Task: DC Electrical Failures – EAL Determination

<u>Notes</u>: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

• Event classification JPM in accordance with Emergency Preparedness Plan.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 10-S-01-1
□* <u>Classify the event as a SITE AREA EMERGENCY</u>
Standard: EAL SS4, Site Area Emergency
<u>Cue</u> :
Notes:
SAT / UNSAT
Summary of Candidate's thought process used to make this determination:
 Recognize that a fire has been burning for greater than 15 minutes inside the Protected Area (i.e., Div 3 battery room is in the Control Building, one of the VITAL AREAS listed on Table H3). This alone would be classified as an Unusual Event because of EAL HU4.
 Recognize that all "Vital DC Power" has been lost (i.e., loss of Div 1 DC bus 11DA has precipitated the plant shutdown; the Div 2 DC bus 11DB has indicated less than 105 VDC for at least 20 minutes; the Div 3 DC bus 11DC was immediately lost when the Div 3 battery room fire started 18 minutes ago.
 Recognize that the Loss of all Vital DC Power warrants a Site Area Emergency because of EAL SS4.

Task Standard(s): Within 15 minutes, classify the event as a Site Area Emergency in accordance with EAL SS4. SAT / UNSAT



Admin Task: DC Electrical Failures – EAL Determination

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The Plant is operating in Mode 3 with a plant shutdown in progress due to loss of DC bus 11DA.
- A bus fault occurred on ESF bus 16AB. Electrical estimates that the bus may be re-energized in approximately 45 minutes.
- An operator reported 20 minutes ago that 11DB bus voltage is 104 VDC and trending down.
- A fire that began 18 minutes ago continues to burn in the Division 3 battery room. Operators immediately de-energized the 11DC bus as soon as the fire started.

Initiating Cue(s):

- Classify the event.
- This is a time critical task.



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-B3306
Revision: 05
Page: 1 of 13
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRAM:					
	NRC Operating Exam				
	JPM-CR1				
Time Critical	Alternate Path Validation Time: 25	min			
TITLE:					
	Shift Recirc Pumps to Fast S	Speed			
New Material	Minor Revision Major Revi	sion Cancellation			
REASON FOR RE	I	· ·			
	procedure revision. Changed JPM of the time required to complete this J	1 1			
THIS DOCUMENT	1 1	1 1/1.			
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()			
Prepared By:	Jonathan Sparks	5/1/10			
	**Preparer	Date			
Ops Review ^{++:}	Keith Huff	10/4/11			
	Technical Reviewer (e.g., SME, line management)	Date			
Validated By: Chris Laird		10/4/11			
_	Training Representative	Date			
Approved By:	Kane Ryder	10/4/11			
	⁺ Discipline Training Supervisor	Date			
Approval Date:*_	10/4/11	_			

* Indexing Information

 ** The requirements of the Training Material Checklist have been met.
 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

ENS ENN Not Applicable Fleet

	1.000				
D	ATE	INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
TI	RANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
T	O RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



Task:

JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR Number: GJPM-OPS-B3306

Revision: 5 Page: 2 of 13

Shifting Reactor Recirc Pumps to Fast Speed

G	
<u>Setting</u> :	Simulator
<u>Type</u> :	RO
<u>Task</u> :	CRO-B33(1)-005
<u>K&A</u> :	202001: A4.01 (3.7/3.7)
Safety Function:	Recirculation System
Time Required:	25 minutes
Time Critical:	No
Alternate Path:	Yes
Performance:	Actual
Reference(s):	04-1-01-B33-1/4.2/6.2/6.3
Handout(s):	None
<u># Manipulations:</u>	6
<u># Critical Steps:</u>	4
<u>Group:</u>	2

Simulator Setup/Required Plant Conditions:

- 1. In the Simulator Instructor Booth, ensure Director is running and reset the simulator to IC-43 (IC with plant ready to upshift Recirc Pumps)
- 2. Perform or verify the following:
 - Verify plant power between 30% and 32% power
 - Verify load line < 75%
 - Verify feedwater flow > 4.0 mlbm/hr.
 - Verify Recirc Pump "B" operating in SLOW speed with FCV 95% open
 - Verify Recirc Pump "A" operating in FAST speed with:
 - o FCV at min position
 - Reset cavitation interlock
 - Depress the Recirc Pump "A" start PB
 - Verify FCTR in SETUP (remote function c51310)
 - Verify that all prerequisites contained in section 4.2.1 of 04-1-01-B33-1 are satisfied.
- 3. Insert Malfunction rr196b (Incomplete Sequence B)

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-B3306

Revision: 5 Page: 3 of 13

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The plant is in power ascension, approximately 34% power.
- Recirc Pump A is in FAST speed
- APRM FCTR cards are in SETUP
- Breakers CB-3B and CB-4B are racked in and closed.
- Requirements for entry into Restricted Region have been met.

Initiating Cue(s):	
• The Shift Manager has di	rected you to shift Reactor Recirc Pump B to FAST speed.
• All prerequisites are met.	
• This task is not time critic	al.



Task: Shifting Reactor Recirc Pumps to Fast Speed

Notes: (Notes to Evaluator)

- 1. Several parameter verifications must be made prior to transferring a Recirc pump to fast speed. The standard for doing so offers only one source for this instrumentation. There may be more than one source, so the standard usually states "or equivalent" to let the evaluator know that there may another legitimate way to verify the parameter.
- 2. Unless otherwise indicated, all controls and indications for this task are on panel 1H13-P680-3A 3C.
- 3. If asked about monitoring for THI, inform the trainee that another operator will monitor for THI.
- 4. This task begins at 04-1-01-B33-1/ Step 4.2.2

Task Overview: (Detailed description of task)

- This task shifts the second Reactor Recirculation Pump to fast speed in preparation for power ascension.
- The first recirc pump is already in fast speed.
- The fault in this task is that RRP fast speed breaker CB-5B fails to close, resulting in an Incomplete Start Sequence and a system shutdown.
- The operator will enter the Reduction in Recirc System Flow ONEP and close the discharge valve for the B Recirc Pump completing the JPM.
- The core must be closely monitored for Thermal Hydraulic Instability (THI). For this task, it will be assumed that another operator will monitor for THI.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)



Step 1: 04-1-01-B33-1 step 4.2.2a(1)
 ADJUST Recirc Loop B FCV to MIN ED position as follows: [*] USING Recirc Loop B FLO CONT on 1H13-P680, THEN CLOSE Recirc Loop B FCV until MIN ED (≈20%) is just indicated on B33 Process Diagram OR Computer point B33N027B. ALLOW computer point B33K658B.C88 at least 5 seconds for computer point updates. IF sufficient PDS computer points are NOT available, a FCV position of approximately ≈20% USING FEEDS indication May be used to set FCV.
Standard: Adjust B flow control valve to 20% open (Min Ed).
<u>Cue</u> :
<u>Notes:</u>
SAT / UNSAT



CHECK soal n	urad flow ANE	Vtiveo leos	pressure normal.
CHECK Searp	ange now Ane	<u>seal</u> cavity	pressure normal.

		Seal purge flow	1.5 to 2.5 gpm.	. (Local C11-FI-R02	20B).
--	--	-----------------	-----------------	---------------------	-------

CHECK #1 seal cavity pressure slightly higher than Reactor pressure	ure.
---	------

CHECK #2 seal cavity pressure indicates approximately half the value of
#1 seal cavity pressure.

Standard: Check purge flow and cavity pressures are r

<u>Cue</u> :	Report Seal Purge Flow as 2.0 gpm when asked as the local
	operator to check seal purge flow.

Notes:



 Step 3: 04-1-01-B33-1 step 4.2.2a(3)

 CHECK pump AND motor temperature normal on Recirc Pump Recorder 1B33-TR-R601 on 1H13-P614.

 Standard:

 Cue:
 When the operator is on this step, inform the operator that all temperatures are normal.

 Notes:
 This recorder is broken in the simulator.

 SAT / UNSAT

Step	4: 04-1-01-B	33-1 step 4.2.2a(4)	
OBSERVE annunciators associated with Loop B HPU, seal flow, <u>AND</u> pump temperatures extinguished on 1H13-P680-3A.			
	Standard:	Observes indications listed.	
	<u>Cue</u> :		
	Notes:		
			SAT / UNSAT

Step 5: 04-1-01-B	33-1 step 4.2.2a(5)		
DEPRESS RECIRC PMP B CAV INTLK RESET pushbutton on 1H13-P680 AND OBSERVE respective status light deenergizes.			
Standard: Depress pushbutton.			
<u>Cue</u> :			



ENTERGY NUCLEAR Number: GJPM-OPS-B3306 Revision: 5 JOB PERFORMANCE MEASURE Page: 8 of 13

Notes: If the status light is already deenergized (i.e. interlock already reset) then this step is NOT critical.

SAT / UNSAT

Step 6: 04-1-01-B33-1 step 4.2.2a(6)

DEPRESS RX WTR LVL LO INTLK B RESET pushbutton on 1H13-P680
 <u>AND</u>OBSERVE respective status light deenergizes.

Standard: Depress pushbutton.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step 7: 04-1-01-B	33-1 step 4.2.2a(7)	
	ective BOP transformer tap setting to E) for pump to be shifted.	about 7.2 kV on Bus
<u>Standard</u> :	On panel P807, raise the tap setting turning the BOP XFMR 11B X-WDG clockwise to the "RAISE" position un indicated on meter R22-R603.	TO BUS 12HE LTC
<u>Cue</u> :		
<u>Notes:</u>		
		SAT / UNSAT

Step 8: 04-1-01-B33-1 step 4.2.2a(8)

□ NOTIFY Chemistry <u>AND</u> Radiation Protection of the possibility of a crud burst as a result of the Recirculation pump speed transfer.



Standard: Notifies Chemistry and RP.
<u>Cue</u> : Chemistry and RP is notified.
Notes:
SAT / UNSAT
Step 9: 04-1-01-B33-1 step 4.2.2a(9)
<u> DEPRESS START pushbutton on TRANS TO LFMG/START handswitch on </u>
<u>1H13-P680 for Recirc Pump B.</u>
CHECK the following:
CB-2B LFMG B GEN BRKR FDR 252-1205A, OPENS.
CB-1B, LFMG B MTR FDR 152-1411 OPENS.
CB-TB, LFMG B MTR FDR 152-1411 OFENS.
Recirc Pump B COASTS down to less than 360 rpm.
—
Standardy Danraga nuchbuttan
Standard: Depress pushbutton.
<u>Cue</u> :
Notes:



ENTERGY NUCLEAR Number: GJPM-OPS-B3306 Revision: 5 Page: 10 of 13

JOB PERFORMANCE MEASURE

Step 10: 04-1-01-	B33-1 step 4.2.2a(10)	
WHEN pump speed lowers below 360 rpm, CHECK that CB-5B, RECIRC PUMP B FDR, 252-1205) CLOSED.		
Standard:	Observes that breaker CB-5B DOES Annunciator "PMP B AUTO XFER IN	
<u>Cue</u> :	When the operator reports that Re	-
	start, as the CRS direct the operat in Recirc System Flow ONEP (05-1 the immediate and subsequent ac	-02-III-3) and implement
<u>Notes:</u>	in Recirc System Flow ONEP (05-1	-02-III-3) and implement tions.

Step 11: 05-1-02-I	II-3 step 3.1	
MONITOR APRMs, LPRMs, SRM period meters, and PBDS Computer Trends. <u>IF</u> operating in the Restricted or Monitored Region <u>and</u> thermal hydraulic instability is observed, <u>THEN</u> IMMEDIATELY SCRAM the Reactor.		
Standard:		
<u>Cue</u> :	As the CRS inform the operator th have the responsibilities as THI w the ONEP subsequent actions.	•
<u>Notes:</u>	No conditions meet the requireme Operator Actions.	nts of step 2.1 Immediate



ENTERGY NUCLEAR Number: GJPM-OPS-B3306 Revision: 5 JOB PERFORMANCE Page: 11 of 13

SAT / UNSAT

Step 12: 05-1-02-I	II-3 step 3.2	
	Recirc pump has stopped, THEN CL VLV B33-F067B.	<u>OSE RECIRC PMP B</u>
Standard:	Closes B33-F067B	
<u>Cue</u> :	This completes the JPM.	
<u>Notes:</u>		
		SAT / UNSAT

MEASURE

Task Standard(s):

The B Recirc Pump is tripped with the B33-F067B closed per 04-1-01-B33-1 SOI.



Task: Shifting Reactor Recirc Pumps to Fast Speed

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The plant is in power ascension, approximately 32% power.
- Recirc Pump A is in FAST speed
- APRM FCTR cards are in SETUP
- Breakers CB-3B and CB-4B are racked in and closed.
- Requirements for entry into Restricted Region have been met.

Initiating Cue(s):	
• The Shift Manager has di	rected you to shift Reactor Recirc Pump B to FAST speed.
• All prerequisites are met.	
• This task is not time critic	al.



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-E5102
Revision: 05
Page: 1 of 12
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRAM:					
	NRC Operating Exam				
	JPM-CR2				
Time Critical	Alternate Path Validation Time: 15 m	in			
TITLE:					
	RCIC Manual Startup				
New Material	I Minor Revision Dajor Revisio	n Cancellation			
<u>REASON FOR REVISION</u> : Correct typographical errors discovered during operator validation and add instructions for the simulator operator.					
THIS DOCUMEN	<u>F REPLACES</u> : GJPM-OPS-E5102 Rev 4				
REVIEW / APPROVAL (Print Name): TEAR Approval ()					
Prepared By:	Jonathan Sparks	8/5/2010			
	**Preparer	Date			
Ops Review ^{++:}	Keith Huff	9/26/2011			
	Technical Reviewer (e.g., SME, line management)	Date			
Validated By:	Chris Laird	9/26/2011			
	Training Representative	Date			
		9/28/2011			
Approved By:	Kane Ryder				
	⁺ Discipline Training Supervisor	Date			
Approval Date:*_	9/28/2011				

* Indexing Information

** The requirements of the Training Material Checklist have been met.

 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

++ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

LENS LENN	Not Applicable		
INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)
	INITIAL RECEIPT BY RM	INITIAL RECEIPT RETURNED FOR BY RM CORRECTIONS	INITIAL RECEIPTRETURNED FOR CORRECTIONSRETURN RECEIPT (DATE/INITIAL)



ENTERGY NUCLEAR Number: GJPM-OPS-E5102 Revision: 5 JOB PERFORMANCE MEASURE Page: 2 of 12

Task:RCIC Manual Startup

Setting:	Simulator
<u>Type</u> :	RO
<u>Task</u> :	CRO-E51-003
<u>K&A</u> :	217000: A4.04 - 3.6/3.6
Safety Function:	Reactor Core Isolation Cooling System (RCIC)
Time Required:	15 minutes
Time Critical:	No
Alternate Path:	Yes
Performance:	Actual
Reference(s):	04-1-01-E51-1 section 5.2.2
	ARI 1H13-P601-21A-G3
Handout(s):	None
<u># Manipulations:</u>	12
# Critical Steps:	8
<u>Group:</u>	1

Simulator Setup/Required Plant Conditions:

- IC-31 (or any full power IC).
- Start SSW A per the SOI.
- Ensure P11-F064 and P11-F065 auxiliary building isolation valves are open on P870.
- Insert Malf. **E51050** at severity **100** and delay **10** on trigger 1, "steam leak in RCIC room upstream of E51F045"
- From Director, open Event.exe
 - Double click event 1 and then click "Edit Event"
 - In event code type: zlo4(665) == 1
 - o Click validate to confirm that it evaluates as "FALSE"
 - Click OK, then click OK on the edit event screen.
- Insert EP Attachment 3 as DONE, "RCIC Div 1 and 2 Isolations bypassed".

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-E5102 Revision: 5

Page: 3 of 12

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- SSW A is in service.
- Another operator is monitoring Suppression Pool temperature per 06-OP-1M24-V-0001.
- All prerequisites are met.

Initiating Cue(s): • The CRS directs you to do a controlled manual startup of RCIC in the CST-to-CST mode, with the following parameters: • 800 gpm flow • 300 psig discharge pressure • This task is not time critical.



Task:RCIC Manual Startup

Notes: (Notes to Evaluator)

1. Unless otherwise stated, all control manipulations will be at panel P601 in the Main Control Room.

Task Overview: (Detailed description of task)

- This task starts the RCIC system by manual operation of the system's individual components and controls.
 - The normal means of starting RCIC for Rx level control would be automatic as a function of Rx level or depressing the system's automatic initiation pushbutton.
- The critical skills examined here are the operator's ability to locate and operate RCIC system controls in a manner that would provide for safe, uninterrupted operation of the system without reliance on the logic that would automatically operate this system in the same manner. Also, diagnostics involved for recognition of a steam line break and failure of the automatic isolation to occur, along with effecting the required isolation will be examined.
- The fault in this task is a RCIC Steam Line break in the RCIC room with failure of the automatic isolation.
 - Continued operation of RCIC in this condition without isolating the steam supply line would lead to damage of equipment in the RCIC room and restricted personnel habitability, possibly spreading to other areas within the auxiliary building.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)



Step 1: 02-S-01-27 Ops Philosophy 6.6.13

□ Place the RCIC DIV 1 and 2 MOV TEST switches in TEST.

<u>Standard</u>: Place switches in TEST.

<u>Cue</u>:

Notes: Must be performed prior to RCIC valve operation for credit.

Step 2: 04-1-0	01-E51-1 step 5.2.2b	
	RCIC RM FAN COIL UNIT USING RCIC itch on 1H13-P870-1C.	RM FAN COIL UNIT
<u>Standar</u>	d: Start fan, observing red light on and	d green light off.
<u>Cue</u> :		
<u>Notes:</u>	 If step 5.2.2a is performed, this this JPM. Step 5.2.2c is NA since the initia step is complete. The operator m 	I conditions indicate this
		SAT / UNSAT

Step 3	Step 3: 04-1-01-E51-1 step 5.2.2d				
□ IF desired to run RCIC in recirculation mode only, CLOSE F268, PRESS LOCK ISO FOR F013; to PREVENT flow to the reactor due to disc flexing of E51-F013. (Concurrent Verification Required)					
	Standard:	Directs local operator to close E51-F	-268.		
	<u>Cue</u> :	E51-F268 is closed.			
	Notes:	step 5.2.2e is NA			



SAT / UNSAT

Step 4: 04-1-01-E51-1 step 5.2.2f

□* **Shift** RCIC FLO CONT to MANUAL.

Standard: Place Controller E51-R600 in manual.

<u>Cue</u>: Notes:

Step 5: 04-1-01-E51-1 step 5.2.2g	
□* Reduce RCIC FLO CONT output to minimum.	
Standard: Lower E51-R600 controller to 0%	
<u>Cue</u> :	
Notes:	
	SAT / UNSAT
	,

Step 6: 04-1-01	-E51-1 step 5.2.2h	
□* <u>OPEN</u> F0	946 USING RCIC WTR TO TURB LUBE	OIL CLR handswitch.
Standard	: Opens E51-F046, observing red lig	ht on and green light off.
<u>Cue</u> :		



Notes:

SAT / UNSAT

Step 7: 04-1-01-E51-1 step 5.2.2i

□* **START** Turbine Gland Seal compressor **USING** RCIC GL SEAL COMPR <u>handswitch.</u>

<u>Standard</u>: Start compressor, observing red light on and green light off.

Cue:

Notes:

SAT / UNSAT

Step 8: 04-1-01-E51-1 step 5.2.2j

□* OPEN F095 USING RCIC STM SPLY BYP VLV handswitch.

<u>Standard</u>: Open valve, observing red light on and green light off.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step 9: 04-1-01-E51-1 step 5.2.2k

□* <u>AFTER 6 seconds</u>, **OPEN** F045 **USING** RCIC STM SPLY TO RCIC TURB <u>handswitch</u>.

Standard: Opens E51-F045, observing red light on and green light off.



ENTERGY NUCLEAR Number: GJPM-OPS-E5102 Revision: 5 JOB PERFORMANCE MEASURE Page: 8 of 12

<u>Cue</u>:

Notes:

Step	10: 04-1-01-	E51-1 step 5.2.2l	
	RAISE turbi CONT in M	ne speed to develop greater than 2000 ANUAL.) rpm USING RCIC FLO
	Standard:	Raises turbine speed >2000 rpm as	indicated on E51-R605.
	<u>Cue</u> :		
	<u>Notes:</u>	An over-speed trip during this ste of the JPM.	p will constitute a failure
			SAT / UNSAT



Step	11: 0	4-1-01-E	51-1 step 5.2.2m(1)	
□*	WHEN discharge pressure is above 125 psig, ESTABLISH RCIC discharge flow path.			
	□*	<u>OPEN (</u>	F059 USING RCIC OTBD TEST RTN	TO CST handswitch.
	□*	<u>OPEN I</u>	F022 USING RCIC INBD TEST RTN	TO CST handswitch.
		THROT handsw	TLE OPEN FV-F551 USING RCIC T vitch.	EST RTN FCV TO CST
		RAISE	turbine speed as desired to establish	desired flow.
	<u>Star</u>	ndard:	Open E51-F059 and E51-F022, obs green lights off.	erving red lights on and
	<u>Cue</u>	:	If asked for guidance, as the CRS ensure automatic actions occur.	direct the operator to
	Note	<u>es:</u>	Once E51-F022 is open, the steam The operator will have indications RCIC room as indicated by: (1) RC (P601-21A-H2, H3, G3), (2) RCIC st (P601-21A-C1,D1), (3) PDS EP-4 O E31N602B on 1H13P642.	s of a steam leak in the CIC area temp high alarms team line high ΔP alarms
				SAT / UNSAT



Step	12: 02-S-01-	27 Ops Philosophy 6.1.1b	
□*	Close E51-F063 or E51-F064, RCIC Steam Supply Isolation Valves to isolate the steam leak in the RCIC room.		
	Standard:	Closes E51-F063 and E51-F064, observing red lights off and green lights on.	
	<u>Cue</u> :		
	<u>Notes:</u>	This completes the JPM. Depressing RCIC MAN ISOL pushbutton will not isolate RCIC steam supply and is not functional unless RCIC has been manually or automatically initiated.	
		SAT / UNSAT	

Task Standard(s):

RCIC was started IAW SOI 04-1-01-E51-1. RCIC steam supply line was isolated by closing E51F063 or E51F064 to isolate the steam leak in the RCIC room.



Task: RCIC Manual Startup

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- SSW A is in service.
- Another operator is monitoring Suppression Pool temperature per 06-OP-1M24-V-0001.
- All prerequisites are met.

Initiating Cue(s):	
The CRS directs you to	do a controlled manual startup of RCIC in the
CST-to-CST mode, with	n the following parameters:
o 800 gpm flow	
\circ 300 psig dischar	ge pressure
• This task is not time cri	tical.



ENTERGY NUCLEAR Number: GJPM-OPS-N3201

JOB PERFORMANCE MEASURE

 Number: GJPM-OPS-N3201

 Revision: 0

 Page: 1 of 12

 Rtype: ______

 QA Record

 Number of pages

 Date ______ Initials ______

TRAINING PROGRAM:					
	NRC Operating Exam				
	JPM-CR3				
Time Critical	Alternate Path Validation Time: 10 min				
TITLE:					
Ro	tate EHC Pumps – Pump A to Pu	ump C			
New Material	Minor Revision Major Revision	Cancellation			
<u>REASON FOR REVISION</u> : New Material <u>THIS DOCUMENT REPLACES</u> : NA					
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()				
Prepared By:	Kyle Grillis	11/30/09			
	**Preparer	Date			
Ops Review ^{++:}	Keith Huff	10/3/11			
	Technical Reviewer (e.g., SME, line management)	Date			
		2			
Validated By:	Chris Laird	10/3/11			
	Training Representative	Date			
Approved By:	Kane Ryder	10/3/11			
	⁺ Discipline Training Supervisor	Date			
Approval Date:*	10/3/11				

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE	INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
TRANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



ENTERGY NUCLEAR Number: GJPM-OPS-N3201 Revision: 0 JOB PERFORMANCE MEASURE Page: 2 of 12

Task:Rotate EHC Pumps – Pump A to Pump C

Setting:	Simulator
<u>Type</u> :	RO
<u>Task</u> :	CRO-N32-006
<u>K&A</u> :	241000: A2.06 – 3.1/3.2 Generic 2.1.30: 4.4/4.0
Safety Function:	3 - Reactor Pressure Control
Time Required:	10 minutes
Time Critical:	No
Alternate Path:	Yes
Performance:	Actual
Reference(s):	04-1-01-N32-1 section 5.1
Handout(s):	None
<u># Manipulations</u> :	6
# Critical Steps:	5
Group:	2

Simulator Setup/Required Plant Conditions:

- IC-31
- o Reduce power to 95% using FCV's (87.9 mlbm/hr)
- Ensure the lead TCV is <65% open.
- Verify EHC pumps A and B are operating and EHC pump C is in standby.
- Open and play schedule file GJPM-OPS-2011CR3 - OR -
- On TRIGGER 10 insert the following instrument overrides:
 - o ior ao_1n32r612 time delay 0, ramp 30 seconds, final value 410
 - o ior ao_1n32r627 time delay 0, ramp 30 seconds, final value 150

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-N3201 Revision: 0

Page: 3 of 12

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):	I Condition(s):
-----------------------	-----------------

- The plant is at rated power.
- EHC pumps A and B are in operation.

Initiating Cue(s): The CRS has directed you to rotate from EHC pump A to EHC pump C, such that • EHC pumps B and C are left in operation, in accordance with 04-1-01-N32-1 section 5.1. An operator is at the EHC pumps standing by for instructions.



Task: Rotate EHC Pumps – Pump A to Pump C

Notes: (Notes to Evaluator)

1. All controls and indications for this task are on panel 1H13-P680.

Task Overview: (Detailed description of task)

- This task is to rotate from EHC pump A in operation to EHC pump C in operation, placing EHC pump A into standby.
- The fault in this task is the failure EHC pump C to maintain normal control fluid pressures.
- The operator will then be redirected return EHC pump A to operation and place EHC pump C into standby.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 04-1-01-N32-1 step 5.1.1 Prerequisites	
Verifies prerequisites for rotating EHC pumps are	met.
EHC FLUID PUMP C handswitch is in AUTO light lit).	on 1H13-P680-10C (white
Annunciator "CF PMP SWITCH TO AUTO", 1 <u>not</u> in Alarm.	H13-P680-10A (C-5), is
Lead turbine control valve N11-F026D to be	<65% open.
Standard: Verifies prerequisites are met.	
<u>Cue</u> :	
Notes:	
	SAT / UNSAT



Step 2: 04-1-01-N32-1 step 5.1.2a

□* <u>**PLACE**</u> STANDBY EHC Fluid pump into operation by first **DEPRESSING** CF <u>PMP A/B/C START pushbutton</u>,

(1) **THEN** DEPRESS respective Auto pushbutton.

Standard: Starts EHC pump C.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step 3: 04-1-01-N	32-1 step 5.1.2b	
approximate	hat discharge pressure on EHC Fluid ly the same as the other running pum ocal pressure indicators:	
	PMP A, 1N32-PI-R006A (low pressure 2-PI-R018A (high pressure))
	PMP B, 1N32-PI-R006B (low pressure 2-PI-R018B (high pressure)	e)
	PMP C, 1N32-PI-R006C (low pressure 2-PI-R018C (high pressure)	e)
Standard:	Directs the local operator to observe pressures.	EHC pump discharge
<u>Cue</u> :	As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha pumps A and B.	np C and are
Notes:		



		SAT / UNSAT
		1
Step 4: 04-1-01-N	32-1 step 5.1.2c	
	A and of the running ELIC Eluid number	
	/N one of the running EHC Fluid pump STOP pushbutton on 1H13-P680-100	
	oproximately 30 seconds, THEN DEP UTO pushbutton.	RESS applicable CF PMP
	VE that CF PRESS HP SIDE AND CF er than 445 psig AND 175 psig respec	
□ Clear ar	nnunciator "CF PMP SWITCH TO AU	IO," 1H13-P680-10A (C-5).
Standard:	Stops EHC pump A.	
<u>Cue</u> :	When the operator reports abnorn pressures as a result of the pump as the CRS to shift EHC pumps to running with EHC pump C in stand	shift, direct the operator EHC pumps A and B
<u>Notes:</u>	A malfunction will be inserted who stopped. This will cause pump dis to 410 psig and 150 psig.	-
	Simulator Operator Trigger Event 7 EHC pump A.	10 when the operator stops



ENTERGY NUCLEAR Number: GJPM-OPS-N3201 Revision: 0 JOB PERFORMANCE Page: 7 of 12

MEASURE

SAT / UNSAT

 Step 5: 04-1-01-N32-1 step 5.1.2a

 ^{*} PLACE STANDBY EHC Fluid pump into operation by first DEPRESSING CF PMP A/B/C START pushbutton,
 (1) THEN DEPRESS respective Auto pushbutton.

 (1) THEN DEPRESS respective Auto pushbutton.

 Standard: Starts EHC pump A.

 Cue:

 Notes: EHC pressures will return to normal.

<u>Simulator Operator</u> Trigger **Event 11** when the operator starts EHC pump A.

- OR -

manually adjust AO_1N32R612 to 577 in 30 seconds manually adjust AO_1N32R627 to 198 in 30 seconds

SAT / UNSAT



JOB PERFORMANCE MEASURE

Step 6:	04-1-01-N3	2-1 step 5.1.2b	
а	pproximatel	hat discharge pressure on EHC Fluid y the same as the other running pum cal pressure indicators:	
		PMP A, 1N32-PI-R006A (low pressure 2-PI-R018A (high pressure)	e)
		PMP B, 1N32-PI-R006B (low pressure 2-PI-R018B (high pressure)	9)
		PMP C, 1N32-PI-R006C (low pressure 2-PI-R018C (high pressure)	e)
<u>S</u>	Standard:	Directs the local operator to observe	EHC pump discharge
		pressures.	
<u><u> </u></u>	<u>Sue</u> :	As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha	np A and are
	Gue: Lotes:	As the local operator, report the lo pressures are normal for EHC pun	np A and are
		As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha	np A and are
		As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha	np A and are
		As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha	np A and are
		As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha	np A and are
		As the local operator, report the lo pressures are normal for EHC pun approximately the same as discha	np A and are



ENTERGY NUCLEAR Number: GJPM-OPS-N3201 Revision: 0 Page: 9 of 12

JOB PERFORMANCE MEASURE

SAT / UNSAT

Step 7	: 04-1-01-N3	32-1 step 5.1.2c
	 <u>PMP A/B/C :</u> WAIT ap A/B/C AI A/B/C AI OBSERV at greate 	N one of the running EHC Fluid pumps by DEPRESSING CF STOP pushbutton on 1H13-P680-10C. oproximately 30 seconds, THEN DEPRESS applicable CF PMP JTO pushbutton. VE that CF PRESS HP SIDE AND CF PRESS LP SIDE remain or than 445 psig AND 175 psig respectively on 1H13-P680-10B. nunciator "CF PMP SWITCH TO AUTO," 1H13-P680-10A (C-5).
	<u>Standard</u> :	Stops EHC pump C.
	<u>Cue</u> :	As the CRS, prompt the operator to secure EHC pump C.
	Notes:	This ends the JPM.
		SAT / UNSAT



Task Standard(s):

EHC Pump A has been placed back into operation and EHC Pump C has been returned to standby in accordance with 04-1-01-N32-1 section 5.1 after it was determined EHC Pump C would not maintain normal control fluid pressures.

SAT / UNSAT



<u>Task</u>: Rotate EHC Pumps – Pump A to Pump C


Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The plant is at rated power.
- EHC pumps A and B are in operation.

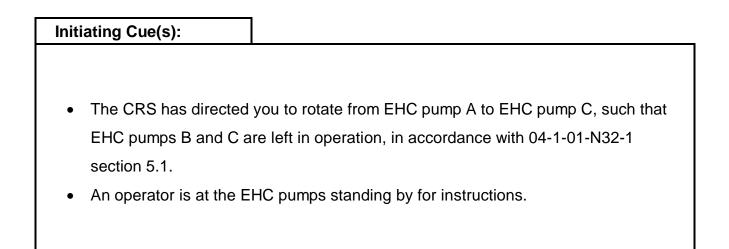



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

TRAINING PROGRAM:				
NRC Operating Exam				
	JPM-CR4			
Time Critical	Alternate Path Validation Time: 15 n	nin		
TITLE:				
	Startup Shutdown Cooling	B		
New Material	I Minor Revision Major Revision	on Cancellation		
REASON FOR RE	-	re steps added by		
THIS DOCUMEN	procedure revision. <u>T REPLACES</u> : GJPM-OPS-E1201 Rev 2			
REVIEW / APPR	OVAL (Print Name): 🗌 TEAR Approval ()		
Prepared By:	Jonathan W. Sparks	3/17/10		
	**Preparer	Date		
Ops Review ^{++:}	Keith Huff	9/28/2011		
	Technical Reviewer (e.g., SME, line management)	Date		
Validated By: Chris Laird 9/28/2011		9/28/2011		
_	Training Representative	Date		
Approved By:	Kane Ryder	9/28/2011		
	⁺ Discipline Training Supervisor	Date		
Approval Date:*_	9/28/2011			

* Indexing Information

** The requirements of the Training Material Checklist have been met.

 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

++ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	LENS ENN	Not Applicable		
DATE TRANSMITTED		CORRECTIONS	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



Task:

ENTERGY NUCLEAR Number: GJPM-OPS-E1201 Revision: 3 JOB PERFORMANCE MEASURE Page: 2 of 9

Startup Shutdown Cooling B

Setting:	Simulator
Type:	RO
Task:	CRO-E12-008
<u>K&A</u> :	205000 A4.01 - 3.7/3.7; A4.02 - 3.6/3.5; A4.03 - 3.6/3.5
Safety Function:	4
Time Required:	15 minutes
Time Critical:	No
Faulted:	No
Performance:	Actual
Reference(s):	04-1-01-E12-2 sect 4.2.2c
Handout(s):	None
<u># Manipulations:</u>	6
# Critical Steps:	6
<u>Group:</u>	1

Simulator Setup/Required Plant Conditions:

- Initialize the simulator to IC 3 Reactor in Mode 4 < 200 degrees F
- Verify/start SSW B in operation to the RHR B heat exchangers.
- Secure the RHR Shutdown Cooling lineup.
 - Stop the B RHR pump.
 - o Close/Verify Closed:
 - B21-F065A and F065B; E12- F004B; F008; F064B; F009; F053B and F006B
 - Shutdown the B RHR Jockey Pump.
- Verify/start RHR Room B Fan Coil Unit.
- Place the RHR B MOV TEST and NSSSS MOV TEST (2) switches in TEST.

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-E1201 Revision: 3

Page: 3 of 9

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- RHR B was previously in service for Shutdown Cooling but was secured.
- Radiation Protection and Chemistry personnel have been notified of the startup of RHR 'B' Shutdown Cooling.
- RHR B has been flushed, warmed up and is ready to be placed in Shutdown Cooling.
- SSW B is in operation.
- ADHR is not in operation.
- RHR Room B Fan Coil Unit is running.
- The B RHR Jockey Pump has been secured.
- The RHR B MOV TEST switch in TEST.
- Both NSSSS MOV TEST switches are in TEST.

Initiating Cue(s):

- The CRS directs you to place RHR B in Shutdown Cooling through E12-F053B, starting at Step 4.2.2c(12) of SOI 04-1-01-E12-2.
- Establish RHR flow with E12-F003B closed and E12-F048B open.



Task: Startup Shutdown Cooling B

Notes: (Notes to Evaluator)

- 1. All controls will be from panels P601 and P680 in the Main Control Room.
- 2. Unless otherwise indicated, all valves are in the "E12" system.

Task Overview: (Detailed description of task)

This task places the RHR system in service for Shutdown Cooling using the normal (E12-F053B) flow path. This is a Tech Spec Decay Heat Removal method. Throttling of RHR Shutdown Cooling flow caused damage to RHR Instrumentation piping during RF12.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)



Otop	1: 04-1-01-E	E12-2 step 4.2.2c(12)	
□*	OPEN OR	CHECK OPEN the following valves:	
	🗌 F010 (Concurrent Verification Required)	
	□* <u>F008</u>		
	□* <u>F009</u>		
	□* <u>F006B</u>		
	□ F047B		
	□ F048B		
	Standard:	Open or Check open valves, observin lights off. For E12-F048B observe valv 100%.	
		100%.	
	Cue:	If asked, concurrent verification of I	E12-F010 was performed.



ENTERGY NUCLEAR Number: GJPM-OPS-E1201 Revision: 3 JOB PERFORMANCE MEASURE Page: 6 of 9

Step 2: 04-1-01-E12-2 step 4.2.2c(13)

□* <u>CLOSE F003B, RHR HX B OUTL VLV</u>.

Standard: Close valve, observing valve position indication moves to 0%.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step 3: 04-1-01-E12-2 step 4.2.2c(14)

CLOSE OR CHECK CLOSED B21-F065B, FW INL SHUTOFF VLV.			
	<u>Standard</u> :	See Cue and Notes below. Check valve closed, observing red light off and green light on.	
	<u>Cue</u> :	Inform the operator as the ACRO that B21-F065B is closed.	
	<u>Notes:</u>	Be mindful of other JPMs occurring in the simulator not to compromise exam security.	
		SAT / UNSAT	



Step 4: 04-1-01-E	12-2 step 4.2.2c(17)			
Step 4: 04-1-01-L12-2 step 4.2.20(17)				
Standard:	Starts RHR pump and opens E12-F053B, observing red lights on and green lights off.			
<u>Cue</u> :	This completes the JPM.			
<u>Notes:</u>	This step offers three valves to open. E12-F037B and E12-F042B are the wrong valves and should not be operated. Steps 4.2.2c(15-16) are NA since the operator will be using option 1 from the note prior to 4.2.2c(15).			
	SAT / UNSAT			

Task Standard(s):

Shutdown Cooling B is started IAW SOI 04-1-01-E12-2.

SAT / UNSAT



Task: Startup Shutdown Cooling B

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- RHR B was previously in service for Shutdown Cooling but was secured.
- Radiation Protection and Chemistry personnel have been notified of the startup of RHR 'B' Shutdown Cooling.
- RHR B has been flushed, warmed up and is ready to be placed in Shutdown Cooling.
- SSW B is in operation.
- ADHR is not in operation.
- RHR Room B Fan Coil Unit is running.
- The B RHR Jockey Pump has been secured.
- The RHR B MOV TEST switch in TEST.
- Both NSSSS MOV TEST switches are in TEST.

Initiating Cue(s):

- The CRS directs you to place RHR B in Shutdown Cooling through E12-F053B, starting at Step 4.2.2c(12) of SOI 04-1-01-E12-2.
- Establish RHR flow with E12-F003B closed and E12-F048B open.



ENTERGY NUCLEAR JOB PERFORMANCE

MEASURE

 Number: GJPM-OPS-E3013

 Revision: 1

 Page: 1 of 9

 Rtype: ______

 QA Record

 Number of pages ______

 Date ______ Initials ______

TRAINING PROGRAM:				
NRC Operating Exam				
	JPM-CR5			
Time Critical Alternate Path Validation Time: 5 min				
TITLE:				
Man	ually Initiate Suppression Poo	ol Make Up		
New Material	Minor Revision Major Revis	sion Cancellation		
REASON FOR RE	VISION: Remove Generic Instructions Sheet S-2-18	. This was removed from 14-		
THIS DOCUMENT	<u>S-2-18</u> <u>I REPLACES</u> : GJPM-OPS-E3013 Rev 0			
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()		
Prepared By:	Jonathan W. Sparks	11/24/09		
· · _	**Preparer	Date		
Ops Review ^{++:}	Keith Huff	9/28/2011		
	Technical Reviewer (e.g., SME, line management)	Date		
Validated By: Chris Laird		9/28/2011		
	Training Representative	Date		
Approved By:	Kane Ryder	9/28/2011		
	⁺ Discipline Training Supervisor	Date		
Approval Date:*	9/28/2011			

* Indexing Information

** The requirements of the Training Material Checklist have been met.

 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	LENS ENN	Not Applicable		
DATE TRANSMITTED		CORRECTIONS	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



Task:

JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR

Number: GJPM-OPS-E3013

Revision: 1 Page: 2 of 9

Manually Initiate Suppression Pool Make Up

Simulator Setting: Type: RO Task: CRO-E30-003 <u>K&A</u>: 223001 A2.11: 3.6/3.8 295030 EA1.04: 4.0/4.0 Safety Function: 5 Time Required: 5 minutes Time Critical: No Faulted: No Performance: Actual Reference(s): 04-1-01-E30-1 Attachment V Handout(s): None # Manipulations: 4 # Critical Steps: 4 Group #: 1

Simulator Setup/Required Plant Conditions:

- Reset to any IC other than Refuel (IC 3)
- Lower Suppression Pool Level to 18.1 feet.
- Set the following annunciators to card pulled:
 - o P680-4A2-A-6
 - o P680-4A2-C-7
 - o P680-4A2-D-6
 - P601-16A-C-5
 - o P601-21A-C-5

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-E3013 Revision: 1 Page: 3 of 9

JOB PERFORMANCE MEASURE

Name:	_ Time Start:	Time Stop:

Initial Condition(s):	
 Suppression Pool Level a leak in the RHR A Pu Repairs to the leaking 	
	EP-3 has been entered.

Initiating Cue(s):
 The CRS directs you to manually initiate both divisions of Suppression Pool Make
 Up to raise Suppression Pool Water Level.



Task: Manually Initiate Suppression Pool Make Up

Notes: (Notes to Evaluator)

1. All Control Room operations will be on panel P870.

Task Overview: (Detailed description of task)

This task is to manually initiate Suppression Pool Make Up per directions from EOP-2 Containment Control. This is done per 04-1-01-E30-1 Attachment V from the Control Room to raise Suppression Pool Water Level.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)



Step 1: 04-1-01-E30-1 Att. V Division 1

□ Place the SPMU MODE SEL handswitch to AUTO

Standard: Verifies that the mode switch is in AUTO.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step 2: 04-1-01-E30-1 Att. V Division 1

□* Place the SPMU DUMP TEST handswitch to TEST.

<u>Standard</u>: Place switch in test, observing amber light above switch on.

<u>Cue</u>:

Notes:

SAT / UNSAT

 Step 3: 04-1-01-E30-1 Att. V Division 1

 * Simultaneously depress both SPMU MAN INIT pushbuttons.

 Standard:
 Place switch in test, observing amber light above switch on.

 Cue:
 Notes:

 Notes:
 SAT / UNSAT



Step 1: 04-1-01-E30-1 Att. V Division 2

□ Place the SPMU MODE SEL handswitch to AUTO

<u>Standard</u>: Verifies that the mode switch is in AUTO.

<u>Cue</u>:

Notes:

SAT / UNSAT

Step 2: 04-1-01-E30-1 Att. V Division 2

□* Place the SPMU DUMP TEST handswitch to TEST.

Standard: Place switch in test, observing amber light above switch on.

<u>Cue</u>:

Notes:

SAT / UNSAT



Step 3:	04-1-01-E30-1 Att.	V Division 2

□* Simultaneously depress both SPMU MAN INIT pushbuttons.

Standard: Place switch in test, observing amber light above switch on.

<u>Cue</u>: This ends the task.

Notes:

SAT / UNSAT

Task Standard(s):

Suppression Pool Make Up Valves E30-F001A & B and E30-F002A & B are open in accordance with 04-1-01-E12-2 attachment V.

SAT / UNSAT



Task:Manually Initiate Suppression Pool Make Up

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):	
- Suppression Deal Low	al bas drapped to 19.12 fact and is continuing to lower due to
	el has dropped to 18.13 feet and is continuing to lower due to
a leak in the RHR A Pu	ump Room.
 Repairs to the leaking 	pipe are in progress.
Emergency Procedure	EP-3 has been entered.

Initiating Cue(s):	
 The CRS directs you to	o manually initiate both divisions of Suppression Pool Make
Up to raise Suppression	on Pool Water Level.



JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR Number: GJPM-OPS-C7105 **Revision: 0** Page: 1 of 10 **Rtype:** QA Record Number of pages Date _____ Initials _____

TRAINING PROGRA	AM:		
NRC Operating Exam			
	JPM-CR6		
Time Critical	Alternate Path Validation Time: 15 mi	n	
TITLE:			
	Reactor Manual Scram Switch	Test	
New Material	Minor Revision Major Revision	n Cancellation	
<u>REASON FOR REVISION</u> : <u>THIS DOCUMENT REPLACES</u> :			
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()		
Prepared By:	Mark Pait	5/24/2011	
	**Preparer	Date	
Ops Review ^{++:}	Chris Laird	9/26/2011	
	Technical Reviewer (e.g., SME, line management)	Date	
Validated By:	Keith Huff	9/27/2011	
• _	Training Representative	Date	
Approved By:	Kane Ryder	9/28/2011	
· · · _	⁺ Discipline Training Supervisor	Date	
Approval Date:*	9/28/2011		

* Indexing Information

** The requirements of the Training Material Checklist have been met.

+ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	Not Applicable		
DATE TRANSMITTED TO RM	INITIAL RECEIPT BY RM (DATE/INITIAL)	RETURNED FOR CORRECTIONS (DATE/INITIAL)	RETURN RECEIPT (DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)

04-1-01-T42-1 Rev 28



ENTERGY NUCLEAR Number: GJPM-OPS-C7105 Revision: 0 JOB PERFORMANCE MEASURE Page: 2 of 10

Task:

Reactor Manual Scram Switch Test

Setting: Type: Task: K&A: Safety Function: Time Required: Time Critical: Faulted: Performance:	Simulator RO CRO-C71-OFFNORM-005 212000: A2.03 – 3.3/3.5 7, Instrumentation 15 minutes No Yes Actual
Safety Function:	7, Instrumentation
Time Required:	15 minutes
Time Critical:	No
Faulted:	Yes
Performance:	Actual
Reference(s):	06-OP-1C71-W-0001
Handout(s):	Copy of 06-OP-1C71-W-0001
<u># Manipulations:</u>	5
<u># Critical Steps</u> :	4
Group:	1

Simulator Setup/Required Plant Conditions:

- Load any 100% IC (prefer IC 31)
- Open and Run schedule file GJPM-OPS-2011CR7

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-C7105 Revision: 0

JOB PERFORMANCE Page: 3 of 10

MEASURE

Name:	Time Start:	Time Stop:

Initial Condition((s):
--------------------	------

• The plant is operating at rated power.

Initiating Cue(s):	
The CDC has directed	
The CRS has directed	you to perform 06-OP-1C71-W-0001.
All prerequisites are ve	rified met.
Start with Data Sheet 1	and go in order through Data Sheet 4.
• This task is not time cr	tical.



Task:Reactor Manual Scram Switch Test

Notes: (Notes to Evaluator)

• The task is complete when: Reactor core flow is lowered to 67 mlbm/hr and the operator determines the reactor is operating in the Monitored Region of the Power to Flow Map.

Task Overview: (Detailed description of task)

- The operator will perform 06-OP-1C71-W-0001 (Reactor Manual Scram Switch Test).
- When the operator depresses the first manual scram switch, two control rods (08-41 and 24-49) will scram due to a blown pilot solenoid fuse on the individual HCU units.
- The operator should recognize two scramed rods and lower core flow to 67 mlbm/hr and plot reactor power and core flow on the Power to Flow Map.

<u>Tasks</u>: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 06-OP-1C71-W-0001 step 5.1	
OBTAIN Shift Supervision's permission to start. Performer to RE Start Time on Data Package Cover Sheet.	CORD Test
Standard: Records the start time on the Surveillance Cover She	eet.
<u>Cue</u> : If the operator asks permission to begin the surve inform the operator that the CRS has given permis begin.	
<u>Notes:</u>	
	AT / UNSAT



Step 2: 06-OP-1C71-W-0001 Data Sheet 1 step 5.2	
VERIFY the following lights are ON to ensure that I present:	NO RPS trip signals are
□ RPS DIV 1 SCRAM SOL VLV 1A AND 1B light	nts ON (5C1)
□ RPS DIV 2 SCRAM SOL VLV 2A AND 2B light	nts ON (7C1)
RPS DIV 3 SCRAM SOL VLV 3A AND 3B light	nts ON (5C1)
☐ RPS DIV 4 SCRAM SOL VLV 4A AND 4B ligh	nts ON (7C1)
Standard: Observes white scram solenoid valve	lights lit.
<u>Cue</u> :	
Notes:	
	SAT / UNSAT

Step 3: 06-OP-1C71-W-0001 Data Sheet 1 step 5.3
\Box^* ARM the Div 1 MAN SCRAM Switch (5C1) by rotating the collar clockwise.
VERIFY alarm RPS MAN SWITCH PERM is received (5A-B3) RPS MAN SWITCH SCRAM PERM alarm is ON
Standard: Rotates switch collar.
<u>Cue</u> :
Notes:



ENTERGY NUCLEAR Number: GJPM-OPS-C7105 Revision: 0 JOB PERFORMANCE Page: 6 of 10

SAT / UNSAT

Step 4: 06-OP-1C	71-W-0001 Data Sheet 1 step 5.4	
□* <u>Depress the</u>	MAN SCRAM Switch which was prev	riously Armed.
Standard:	Depress MAN SCRAM Switch.	
<u>Cue</u> :		
<u>Notes:</u>	When the manual scram switch is rods will scram.	depressed, two control
		SAT / UNSAT

MEASURE

Step 5: 06-OP-1C71-W-0001 Data Sheet 1 step 5.5
□ VERIFY the following:
RPS SCRAM SOL VLVs lights 1A, 3A, on (5C1) AND 2A, 4A on (7C1) are OFF
RPS SCRAM SOL VLVs lights 1B, 3B, on (5C1) <u>AND</u> 2B, 4B on (7C1) are ON
RX SCRAM TRIP alarm is received (7A-A2)
RX MAN SCRAM TRIP alarm is received (7A-A3)



ENTERGY NUCLEAR Number: GJPM-OPS-C7105 Revision: 0 JOB PERFORMANCE MEASURE Page: 7 of 10

Standard:	Observes indications listed.
<u>Cue</u> :	
Notes:	
	SAT / UNSAT

Step 6: 06-OP-10	C71-W-0001 Data Sheet 1 step 5.5.4	
Depress pushbutton SCRAM VLV (6C) AND VERIFY that NO scram valves are Open, as indicated by a green LED being OFF for all CRD/HCUs on the rod display map (6D) that are NOT tagged out.		
<u>Standard</u> :	Determines that two Control have scramed.	
<u>Cue</u> :		
Notes: Control Rods 08-41 and 24-49 have scramed. Once the operator determines that rods have scramed the operator should enter the Control Rod/Drive Malfunctions ONEP.		
	SAT / UNSAT	

Step 7: Control R 2.4	od/Drive Malfunctions ONEP step
⊡* <u>Reduce Re</u>	eactor core flow to 67 mlbm/hr.
<u>Standard</u> :	Lowers core flow using both Recirc flow control valves in fast detent to 67 mlbm/hr (02-S-01-27 6.5.6).
<u>Cue</u> :	



ENTERGY NUCLEAR Number: GJPM-OPS-C7105 Revision: 0 JOB PERFORMANCE Page: 8 of 10

Notes:

SAT / UNSAT

Step 8:	Operation's Philosophy step 6.6.7	
	Plot reactor power and core flow on the Power to	Flow Map.
	Standard: Plots power and flow.	
	Cue: This completes the task.	
	Notes:	
		SAT / UNSAT

MEASURE

Task Standard(s): Reactor core flow is lowered to 67 mlbm/hr and the operator determines the reactor is operating in the Monitored Region of the Power to Flow Map per 05-1-02-IV-1.



Task:Reactor Manual Scram Switch Test

Follow-Up Questions & Answers:

Comments:

Give this page to the student

• The plant is operating at rated power.

Initiating Cue(s):	
The CDC has diverted	
The CRS has directed	you to perform 06-OP-1C71-W-0001.
All prerequisites are ve	rified met.
Start with Data Sheet 1	and go in order through Data Sheet 4.
• This task is not time cri	tical.



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

 Number: GJPM-OPS-P4271

 Revision: 2

 Page: 1 of 8

 Rtype: ______

 QA Record

 Number of pages ______

 Date ______ Initials ______

TRAINING PROGRAM:						
NRC Operating Exam						
	JPM-CR7					
Time Critical						
TITLE:						
	Rotate CCW Pumps					
New Material Minor Revision Major Revision Cancellation						
REASON FOR RE	VISION: Remove Generic Instructions Sheet. 14-S-2-18.	This was removed from				
THIS DOCUMEN	<u>T REPLACES</u> : GJPM-OPS-P4271 Rev. 1					
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()				
Prepared By: Jonathan W. Sparks		12/7/09				
	**Preparer	Date				
Ops Review ^{++:}	Chris Laird	10/4/11				
• <u>-</u>	Technical Reviewer (e.g., SME, line management)	Date				
Validated By:	Keith Huff	10/4/11				
Training Representative Date						
Approved By:	Kane Ryder	10/4/11				
⁺ Discipline Training Supervisor Date						
Approval Date:* 10/4/11						

* Indexing Information

** The requirements of the Training Material Checklist have been met.

 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

++ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	ENS ENN	X Not Applicable		
DATE TRANSMITTED TO RM	BY RM		(DATE/INITIAL)	FINAL ACCEPTANCE BY RM (DATE/INITIALS)
	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)

04-1-01-P42-1 Rev 47



ENTERGY NUCLEAR Number: GJPM-OPS-P4271 Revision: 2 Page: 2 of 8 MEASURE

<u>Task</u>:

Rotate CCW Pumps

Setting:	Simulator
<u>Type</u> :	RO
<u>Task</u> :	CRO-P42-007; CRO-P42-004
<u>K&A:</u>	400000 2.1.30: 3.9/3.4; 2.1.31: 4.2/3.9; A4.01: 3.1/3.0; A2.01: 3.3/3.4
	295018 AK3.04: 3.3/3.3; AA1.01: 3.3/3.4
Safety Function:	Plant Service Systems (8)
Time Required:	10 minutes
Time Critical:	No
Faulted:	YES
Performance:	Perform
Reference(s):	SOI 04-1-01-P42-1 section 5.2; ONEP 05-1-02-V-1 section 3.1.1
Handout(s):	SOI 04-1-01-P42-1; ONEP 05-1-02-V-1
<u># Manipulations</u> :	4
# Critical Steps:	4
<u>Group #</u> :	2

Simulator Setup/Required Plant Conditions:

- Initialize the simulator to any IC (IC-43).
- Insert Malfunction **p42151c** CCW Pump C Trip on a unique trigger number (event 1).
- Ensure CCW Pumps 'A' and 'C' are operating with CCW Pump 'B' in Standby.

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-P4271 Revision: 2


Page: 3 of 8

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- Electrical Maintenance has requested Component Cooling Water (CCW) Pump A be secured in preparation for preventive maintenance.
- CCW Pumps A and C are currently in operation.

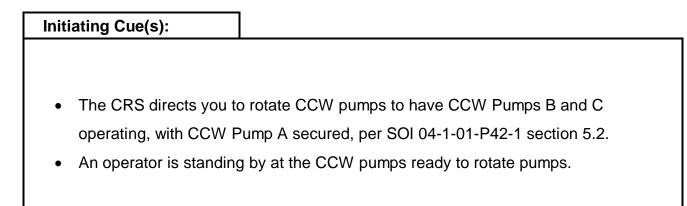



Task: Rotate CCW Pumps

Notes: (Notes to Evaluator)

<u>Task Overview:</u> (Detailed description of task)

This task is to rotate CCW Pumps per SOI. During the evolution, a trip will occur on one of the operating CCW pumps requiring the restart of the non-operating CCW pump per the Loss of CCW ONEP. This is an Alternate Path JPM. This is a task that is coordinated from the control room.

<u>Tasks</u>: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 04-1-01-P42	-1 step 5.2.2a	
	by pump from STANDBY by PLACI d below to STOP.	NG respective pump
<u>Standard</u> : Pla	aces CCW pump B HS to STOP.	
<u>Cue</u> :		
<u>Notes:</u> Ste	ep 5.2.1 prerequisites are met.	
		SAT / UNSAT

Step 2: 04-1-01-P42-1 step 5.2.2b

□* **AFTER** white STANDBY light for pump goes out, <u>START CCW pump using its</u> <u>respective handswitch listed in Step 5.2.2a.</u>

Standard: Starts CCW pump B.

<u>Cue</u>: If asked to perform pre-start pump checks, report that prestart pump check is performed sat.



ENTERGY NUCLEAR Number: GJPM-OPS-P4271 Revision: 2 JOB PERFORMANCE MEASURE Page: 5 of 8

Notes:

Step 3: 04-1-01-	P42-1 step 5.2.2c	
CLOSE disc	harge valve for pump to be shut down.	
<u>Standard</u> :	Contacts local operator to close P42-F discharge valve.	F016A CCW pump A
<u>Cue</u> :	Report as local operator P42-F016A	is closed.
<u>Notes:</u>		
		SAT / UNSAT

Step 4: 04-1-01-	P42-1 step 5.2.2d	
□* <u>STOP</u> CCW listed in Step	pump to be placed in STANDBY using 5.2.2a.	its respective handswitch
Standard:	Stops CCW pump A.	
<u>Cue</u> :	After the trip annunciator comes into operator as the local operator that a is spraying from the CCW C pump s are getting wet.	a small amount of water
	The CRS directs you to take Immed actions per the loss of CCW ONEP.	•
	If the operator attempts to go to the operator that another operator will P680.	-



Notes: When the operator stops CCW pump A, CCW pump C will trip causing a partial loss of CCW flow.

Simulator Operator, Trip CCW pump C when the CCW pump A has been secured.

Step	5 05-1-02-	V-1 Loss of CCW ONEP step 3.1.1
		local operator to open P42-F016A CCW Pump 'A' discharge valve.
	<u>Standard</u> :	Contacts local operator to open P42-F016A.
	<u>Cue</u> :	CCW Pump 'A' discharge valve P42-F016A is open.
	<u>Notes:</u>	There are no required immediate actions for the Loss of CCW ONEP. Do <u>NOT</u> allow the operator to scram the reactor! This task is not critical if P42-F016A was not previously
		closed. Step 5 &6 can be done in either order.

Step 6: 05-1-02-	V-1 Loss of CCW ONEP step 3.1.1
□* <u>START CC</u> V	<u>V pump A.</u>
Standard:	Start CCW pump A.
<u>Cue</u> :	Terminate the JPM
<u>Notes:</u>	Once the operator moves beyond step 3.1.1 "Verify standby CCW pump starts or start manually" end the JPM.



ENTERGY NUCLEAR Number: GJPM-OPS-P4271 Revision: 2 JOB PERFORMANCE MEASURE Page: 7 of 8

SAT / UNSAT

Task Standard(s):

CCW Pumps 'A' and 'B' are operating with discharge valves open per 05-1-02-V-1.



Task: Rotate CCW Pumps

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- Electrical Maintenance has requested Component Cooling Water (CCW) Pump A be secured in preparation for preventive maintenance.
- CCW Pumps A and C are currently in operation.

Initiating Cue(s):
The CRS directs you to rotate CCW pumps to have CCW Pumps B and C operating, with CCW Pump A secured, per SOI 04-1-01-P42-1 section 5.2.
An operator is standing by at the CCW pumps ready to rotate pumps.



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-T4803
Revision: 0
Page: 1 of 12
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRA	AM:	
	NRC Operating Exam	
	JPM-CR8	
Time Critical	Alternate Path Validation Time: 20 m	n
TITLE:		
Secure SG	TS with One Train in Standby 1	Mode following
	Automatic Initiation	
New Material	Minor Revision Major Revision	n Cancellation
<u>REASON FOR REVISION</u> : THIS DOCUMENT REPLACES:		
REVIEW / APPROVAL (Print Name): TEAR Approval ()		
Prepared By:	Kyle Grillis	12/7/09
	**Preparer	Date
Ops Review ^{++:}	Mark Goodwin	10/4/11
	Technical Reviewer (e.g., SME, line management)	Date
Validated By:	Keith Huff	10/4/11
	Training Representative	Date
Approved By:	Kane Ryder	10/4/11
· -	⁺ Discipline Training Supervisor	Date
Approval Date:*_	10/4/11	

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet				
DATE	INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
TRANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



ENTERGY NUCLEAR Number: GJPM-OPS-T4803 Revision: 0 JOB PERFORMANCE MEASURE

Task:Secure SGTS with One Train in Standby Mode
following Automatic Initiation

Simulator
RO
CRO-T48-004
261000 A4.03: 3.0/3.0; Generic 2.1.30: 4.4/4.0
9 – Radioactivity Release
20 minutes
No
No
Actual
04-1-01-T48-1 section 5.3
None
18
16
1

Simulator Setup/Required Plant Conditions:

- Reset to any IC with **<u>no</u>** SGTS initiation signal
- Insert Malfunction **rm1570** and **rm157n**, once actions have gone to completion delete the malfunctions.
- Perform the following on P870-2B, 2C to place SGTS A in Standby Mode:
 - PLACE SGTS DIV 1 MODE SEL handswitch on (P870-2B) to STBY position.
 - **TURN** SGTS DIV 1 MAN INIT RESET key-locked handswitch to RESET position and back to NORM, to reset automatic or manual initiation signal.
 - **PLACE** handswitch for ENCL BLDG RECIRC FAN A(B) to STOP.
 - **PLACE** handswitch for SGTS FLTR TR A(B) EXH FAN to STOP.
- Silence and acknowledge alarms after annunciator SGTS DIV 2 OPER (P870-8A-A3) has alarmed.

Safety Concerns:

• None



ENTERGY NUCLEAR Number: GJPM-OPS-T4803 Revision: 0 Page: 3 of 12

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:
		-

Initial Condition(s):

- The plant is at rated power.
- Standby Gas Treatment Systems A and B automatically initiated due to a momentary spike of Fuel Pool Sweep Exhaust Radiation monitors during movement of spent LPRMs on the refuel floor.
- The initiating condition is now clear, Fuel Pool Sweep Exhaust Radiation levels are normal.
- SGTS A has been placed in Standby Mode using its mode selector switch in accordance with 04-1-01-T48-1 step 5.2.2e.
- SGTS B is operating.
- Jumpers have <u>not</u> been installed to enable restarting Auxiliary Building fan coil units.

Initiating Cue(s):

- The SRO with the Command Function has directed you to shutdown the system, returning SGTS A and B to normal alignment, in accordance with 04-1-01-T48-1 section 5.3.
- Another operator will pick up at step 5.3.2p and restart normal ventilation system fans.



Task:Secure SGTS with One Train in Standby Mode
following Automatic Initiation

Notes: (Notes to Evaluator)

1. All controls will be from panel P870.

Task Overview: (Detailed description of task)

• This task secures SGTS B following automatic initiation and reopens ventilation system isolation valves. SGTS A has already been secured to Standby Mode as an initial condition.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 04-1-01-	T48-1 step 5.3.2b	
D PLACE SG	TS DIV 1(2) MOV TEST switch (P870-2	B) in TEST.
	annunciator "SGTS DIV 1(2) MOVS IN	TEST MODE" is Alarmed.
	SGTS D1(D2) MOV IN TEST STATUS	light is on.
Standard:	Place SGTS Div 2 MOV TEST switch	in TEST.
<u>Cue</u> :		
Notes:	Step 5.3.1 prerequisites are met and	1 5.3.2a is NA.
		SAT / UNSAT



Step 2: 04-1-01-T48-1 step 5.3.2c		
PLACE the following handswitches to STOP on 1H13P842:		
<u>Standard</u> :	Request the following handswitches be placed in STOP on 1H13P842:	
	 T42C002A FHA EXH FAN A T42C004A POOL SWP EXH FAN A T42C002A FHA EXH FAN B T42C004B POOL SWP EXH FAN B T42C001A FHA SPLY FAN A T42C003A FP SWP SPLY FAN A T42C001B FHA SPLY FAN B T42C003B FP SWP SPLY FAN B 	
<u>Cue</u> :	Another operator has placed the handswitches in STOP.	
<u>Notes:</u>	The P842 is not modeled in the simulator.	
	SAT / UNSAT	

Step 3: 04-1-01-T48-1 step 5.3.2d
\Box^* IF one SGTS train is in standby, THEN PERFORM the follow:
PLACE SGTS DIV 1(2) MODE SEL key locked handswitch for Standby <u>filter train to AUTO position.</u>
□ VERIFY SGTS DIV 1(2) MODE SEL handswitch white light is lit.
VERIFY SGTS DIV 1(2) IN STBY MODE annunciator clears.
Standard: Place SSTS Div 2 MODE SEL switch in AUTO.
<u>Cue</u> :



ENTERGY NUCLEAR Number: GJPM-OPS-T4803 Revision: 0 JOB PERFORMANCE Page: 6 of 12

Notes:

SAT / UNSAT

Step 4: 04-1-01-T48-1 step 5.3.2e-f

Turn SGTS DIV 1(2) MAN INIT RESET key locked handswitch to RESET position and back to NORM, to reset automatic or manual initiation signal.

MEASURE

□ **VERIFY** annunciator "SGTS DIV 1(2) OPER" clears.

Standard: Resets SGTS Div 2 initiation logic.

Cue:

Notes:

Step 5: 04-1-01-T48-1 step 5.3.2g	
\Box^* Place handswitch for SGTS FLTR TR A(B) EXH FA	<u>N to STOP.</u>
Standard: Stops SGTS B filter train exhaust fan.	
<u>Cue</u> :	



Notes:

SAT / UNSAT

Step 6: 04-1-01-	T48-1 step 5.3.2h	
□* <i>Place</i> hand	switch for ENCL BLDG RECIRC FAN A	(<u>B) to STOP.</u>
Standard:	Stops SGTS B enclosure building reci	rc fan.
<u>Cue</u> :		
<u>Notes:</u>		
		SAT / UNSAT

Step 7: 04-1-01-T48-1 step 5.3.2i

□ **OBSERVE** filter train chart recorders deenergize and Enclosure Building pressure chart recorders transfer to slow speed.

Standard: Verify chart recorders operate correctly.

Cue:

Notes:

SAT / UNSAT

Step 8: 04-1-01-T48-1 step 5.3.2j



□ VERIFY that all SGTS A(B) dampers on 1H13-P870-2C(8C), are CLOSED.

<u>Standard</u>: Verify SGTS Div 2 dampers close.

<u>Cue</u>:

Notes: Damper numbers: T48-F002,3,5,8,10,12,14,16,18,20, and 22.

SAT / UNSAT

Ston	Q٠	04-1-01-T48-1	eton	532k
Step	9.	04-1-01-T48-1	step	0.3.ZK


U VERIFY "FLTR TR A(B) EXH FAN INL VANE" on 1H13-P870-2C(8C) is OPEN.

Standard: Verify SGTS Div 2 exhaust fan inlet vane opens.

<u>Cue</u>:

Notes:

Step 10: 04-1-01-T48-1 step 5.3.2I	
RECORD stop time(s) in the Accumulative Log Book.	
Standard:	
<u>Cue</u> : Another operator will complete log book e	ntry.

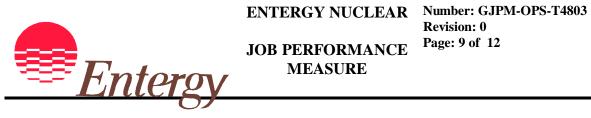

Notes: Accumulative Log Book is kept at SM desk in the control room and is not modeled in the simulator.

Step 11: 04-1-01-T48-1 step 5.3.2m	
PLACE SGTS DIV 1(2) MOV TEST switch in NC	RM.
VERIFY annunciator "SGTS DIV 1(2) MOVS	IN TEST MODE" is clear.
U VERIFY SGTS D1(D2) MOV IN TEST STAT	JS light is off.
Standard: Place MOV TEST switch to NORM	
<u>Cue</u> :	
Notes:	
	SAT / UNSAT
	_
Step 12: 04-1-01-T48-1 step 5.3.2n	
\Box^* IF SGTS A was secured, THEN OPEN the follow	ing dampers:
□* <u>1T42F011</u> □* <u>1T42F019</u> □* <u>1</u>	<u>T42F004</u>
□* <u>1M41F008</u> □* <u>1M41F036</u> □* <u>1</u>	<u>T42F007</u>



ENTERGY NUCLEAR Number: GJPM-OPS-T4803 Revision: 0 JOB PERFORMANCE MEASURE Page: 10 of 12

<u>Standard</u> :	Open dampers.	
<u>Cue</u> :		
Notes:	Dampers located on P870-2C	
		SAT / UNSAT


Step 13: 04-1-01	-T48-1 s	tep 5.3.2o			
□*	vas secu	red, THEN OPEN th	e following	<u>ı dampers:</u>	
□* <u>1T4</u> 2	<u>2F012</u>	□* <u>1T42F020</u>	□* <u>1T4</u>	2F003	
□* <u>1M4</u>	<u>1F007</u>	□* <u>1M41F037</u>	□* <u>1T4</u>	<u>2F006</u>	
Standard:	Open d	ampers.			
<u>Cue</u> :	When o	complete, End of JF	PM.		
Notes:	Dampe	rs located on P870	-8C		
					SAT / UNSAT



ENTERGY NUCLEARNumber: GJPM-OPS-T4803
Revision: 0JOB PERFORMANCE
MEASUREPage: 11 of 12

Task Standard(s):

Standby Gas Treatment Systems A and B are shutdown and have been placed in normal standby alignment and normal ventilation isolation dampers have been reopened IAW 04-1-01-T48-1 section 5.3.

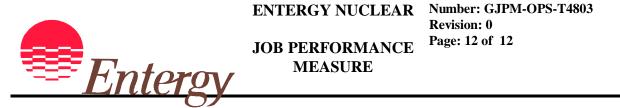

Task:Secure SGTS with One Train in Standby Mode
following Automatic Initiation

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The plant is at rated power.
- Standby Gas Treatment Systems A and B automatically initiated due to a momentary spike of Fuel Pool Sweep Exhaust Radiation monitors during movement of spent LPRMs on the refuel floor.
- The initiating condition is now clear, Fuel Pool Sweep Exhaust Radiation levels are normal.
- SGTS A has been placed in Standby Mode using its mode selector switch in accordance with 04-1-01-T48-1 step 5.2.2e.
- SGTS B is operating.
- Jumpers have <u>not</u> been installed to enable restarting Auxiliary Building fan coil units.

Initiating Cue(s):

- The SRO with the Command Function has directed you to shutdown the system, returning SGTS A and B to normal alignment, in accordance with 04-1-01-T48-1 section 5.3.
- Another operator will pick up at step 5.3.2p and restart normal ventilation system fans.



JOB PERFORMANCE

MEASURE

Number: GJPM-OPS-EOP23 ENTERGY NUCLEAR **Revision: 1** Page: 1 of 8 **Rtype: QA Record** Number of pages Date _____ Initials _____

TRAINING PROGRA	AM:	
	NRC Operating Exam	
	JPM-PS1	
Time Critical	Alternate Path Validation Time: 20	min
TITLE:		** 1
Ν	anually Vent the SCRAM Air	Header
New Material	Minor Revision Dajor Revis	ion Cancellation
REASON FOR RE	VISION: Remove Generic Instructions Sheet. S-2-18. Γ REPLACES: GJPM-OPS-EOP023 Rev 0	This was removed from 14-
	OVAL (Print Name):)
Prepared By:	Jonathan W. Sparks	11/25/09
	**Preparer	Date
Ops Review ^{++:}	Keith Huff	9/26/2011
	Technical Reviewer (e.g., SME, line management)	Date
Validated By:	Chris Laird	9/26/2011
_	Training Representative	Date
Approved By:	Kane Ryder	9/28/2011
	⁺ Discipline Training Supervisor	Date
Approval Date:*	9/28/2011	

* Indexing Information

** The requirements of the Training Material Checklist have been met.

+ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

++ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

L	_ Fleet _	ENS ENN	X Not Applicable	
	DATE TRANSMITTED	BY RM	CORRECTIONS	 FINAL ACCEPTANCE BY RM
	TO RM	(DATE/INITIAL)	(DATE/INITIAL)	(DATE/INITIALS)

04-1-01-P42-1 Rev 47



JOB PERFORMANCE MEASURE

ENTERGY NUCLEAR Number: GJPM-OPS-EOP023

Revision: 1 Page: 2 of 8

<u>Task</u>:

Manually Vent the SCRAM Air Header

Setting:	Plant (Inside CAA)
<u>Type</u> :	NLO
<u>Task</u> :	AON-EP-004
<u>K&A</u> :	295015 AA1.01: 3.8/3.9
Safety Function:	1 – Reactivity Control
Time Required:	20 minutes
Time Critical:	No
Faulted:	No
Performance:	Simulate
Reference(s):	05-S-01-EP-1/Att. 23
Handout(s):	Copy of EOP Att. 23
<u># Manipulations</u> :	5
# Critical Steps:	6
<u>Group #</u> :	1

Simulator Setup/Required Plant Conditions:

• Containment HCU floor at Area 11, 135' is accessible

Safety Concerns:

- Wear appropriate personal protective equipment.
- Don't forget ALARA
- No climbing. Point up or down while you explain what you are going to do.



ENTERGY NUCLEAR Number: GJPM-OPS-EOP023 Revision: 1

Page: 3 of 8

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:
Initial Condition(s):		

Initiating Cue(s):	
• The CRS directs you to p	erform steps 2.1 through 2.4 of EP Attachment 23.
• Another operator will con	plete the remaining steps of this attachment when directed.



Task:Manually Vent the SCRAM Air Header

Notes: (Notes to Evaluator)

- 1. This task is performed on the HCU floor in Containment, El. 135'.
- 2. The valves and pipe plugs are located just south and west of the Hydraulic Control Station, near the Backup Scram Valves.

Task Overview: (Detailed description of task)

• This task provides an alternate method of venting the scram air header to allow control rod insertion. The task consists of physically removing of pipe plugs located on the scram air header using a hack saw, allowing the scram air header to depressurize. The scram pilot valves would fail open due to a loss of air pressure, allowing the control rods to insert into the reactor.

<u>Tasks</u>: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: EOP Att.	23 step 2.1			
□* OBTAIN tools from the Control Room emergency locker.				
<u>Standard</u> :	Standard: Verbalizes that the EP kit for Att. 23 is in the Control Room.			
<u>Cue</u> :	You have the hacksaw from the EP	Att. 23 kit.		
<u>Notes:</u>	In order to meet the critical task, the verbalize that he has/would obtain a			
		SAT / UNSAT		



Step 2: EOP Att. 23 step 2.2

□* CLOSE 1C11-F095, SCRAM VLV PILOT AIR HDR ISOL (Containment Elev 135 ft, to right of Backup Scram valves).

Standard: Simulate turning CW to close.

<u>Cue</u>: Resistance is felt in the CW direction.

Notes:

SAT / UNSAT

Step 3: EOP Att. 23 step 2.3

□*	CUT OFF test connection of	cap downstream of 1C11-F307, PI-R013 test
	connection (above AND to	left of Backup Scram valves).

Standard: Simulate cutting off test connection.

<u>Cue</u>: Test connection cap is cut off.

Notes:

Step 4: EOP Att.	23 step 2.3.1	
□*	<u>-F307</u>	
Standard:	Simulate turning CCW to open.	
<u>Cue</u> :	Resistance is felt in the CCW direct	ion.
Notes:		



SAT / UNSAT

Step 5: EOP Att. 23 step 2.4

□* **CUT OFF** test connection cap downstream of 1C11-F309, PT-N052 test connection (above AND to left of Backup Scram valves).

<u>Standard</u>: Simulate cutting off test connection.

<u>Cue</u>: Test connection cap is cut off.

Notes:

SAT / UNSAT

Step 6: EOP Att. 23 step 2.4.1

□* OPEN 1C11-F309				
Standard:	Simulate turning CCW to open.			
<u>Cue</u> :	Resistance is felt in the CCW direction.			
<u>Notes:</u>				
		SAT / UNSAT		

Task Standard(s):

Steps 2.1 through 2.4 of EOP Att. 23 are completed in accordance with the procedure.



Task:Manually Vent the SCRAM Air Header

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):		
• EOP's have been entered.		

Initiating Cue(s):	
• The CRS directs you to p	erform steps 2.1 through 2.4 of EP Attachment 23.
• Another operator will cor	nplete the remaining steps of this attachment when directed.



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-C6101
Revision: 2
Page: 1 of 10
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRAM:						
NRC Operating Exam						
	JPM	[-PS2				
Time Critical	Alternate Path Va	lidation Time: 20 min				
TITLE:						
Startup	RHR in Suppress	ion Pool Cooling	g From the			
	Remote Shu	tdown Panel				
New Material	☐ New Material					
REASON FOR REV	VISION: Remove Generic	Instructions Sheet. This	was removed from 14-			
THIS DOCUMENT	S-2-18. <u>CREPLACES</u> : GJPM-OF	PS-C6101 Rev 1				
REVIEW / APPRO	DVAL (Print Name): 🗌 T	EAR Approval ()				
Prepared By:	Jonathan W. S	parks	11/16/09			
	**Preparer		Date			
Ops Review ^{++:}	Keith Huff		9/26/2011			
	Technical Reviewer (e.g., SME	, line management)	Date			
Validated By:	Chris Laird		9/26/2011			
Training Representative		itative	Date			
Approved By:	Kane Ryde		9/28/2011			
	⁺ Discipline Training S	Supervisor	Date			
Approval Date:*	9/28/2011					

* Indexing Information

** The requirements of the Training Material Checklist have been met.

 ⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

⁺⁺ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Fleet	JENS LENN	Not Applicable		
DATE	INITIAL RECEIPT	RETURNED FOR	RETURN RECEIPT	FINAL ACCEPTANCE
TRANSMITTED	BY RM	CORRECTIONS	(DATE/INITIAL)	BY RM
TO RM	(DATE/INITIAL)	(DATE/INITIAL)		(DATE/INITIALS)



<u>Task</u>:Startup RHR in Suppression Pool Cooling from the
Remote Shutdown Panels

Setting:	Plant (Outside CAA)
<u>Type</u> :	RO
<u>Task</u> :	CRO-C61-001; CRO-C61-009; CRO-E12-019; CRO-P41-001
K&A:	295016 2.1.30: 3.9/3.4; AA1.07: 4.2/4.3; AK2.01: 4.4/4.5; AK3.03:
	3.5/3.7; 295013 AA1.01: 3.9/3.9; 295026 EA1.01: 4.1/4.1
	219000 A4.01: 3.8/3.7; A4.02: 3.7/3.5; A4.05: 3.4/3.4
Safety Function:	Instrumentation (7) & Containment (5)
Time Required:	15 minutes
Time Critical:	No
Alternate Path:	No
Performance:	Simulate
<u>Reference(s)</u> :	ONEP 05-1-02-II-1 Attachment VIII or IX
Handout(s):	ONEP 05-1-02-II-1 Attachment VIII or IX
<u># Manipulations:</u>	10
# Critical Steps:	3
<u>Group #</u> :	2

Simulator Setup/Required Plant Conditions:

• Area is accessible.

Safety Concerns:

- Do NOT operate plant equipment.
- For Protected Train concerns, use either RHR A or B using Attachment VIII or IX.
- Write in on the Initial Conditions Page which RHR and Attachment is to be used.



ENTERGY NUCLEAR Number: GJPM-OPS-C6101 Revision: 2

Page: 3 of 10

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:

Initial Condition(s):

- The Control Room has been evacuated due to noxious fumes.
- Control of the plant has been established at the Remote Shutdown Panels.
- An SRO is controlling operations at the remote shutdown panel.
- Another operator is assigned for radio communications and is monitoring reactor level and pressure.
- A Plant Shutdown Operator is stationed in the Auxiliary Building if needed.
- The RSD room cabinet at the remote shutdown panel is unlocked.
- The reactor is shutdown
- RPV water level is within band of +30 to -30" on wide range level.
- RPV pressure is within band of 900 to 1000 psig.
- RHR Transfer switches have been placed in EMERG position per step 3.6 of the Shutdown from the Remote Shutdown Panel ONEP.
- Standby Service Water A and B are not running and are in Standby lineup per the P41 SOI.
- RCIC will be started after RHR A or B is placed in suppression pool cooling mode.

Initiating Cue(s):	
 You have been 	directed to place RHR in Suppression Pool Cooling per
Attachment	of the Shutdown from the Remote Shutdown Panel ONEP.
 Establish maxir 	num cooling.



Task:Startup RHR in Suppression Pool Cooling from the
Remote Shutdown Panels

Notes: (Notes to Evaluator)

- 1. Remote Shutdown Panels are located on the 111' elevation of the Control Building.
- 2. Division 1 Remote Shutdown Panel is H22-P150.
- 3. Division 2 Remote Shutdown Panel is H22-P151.
- 4. This JPM may be performed using RHR A or B for protected train concerns.
- 5. Be sure a non-protected train ESF inverter is selected and recorded on the initiating cues page.

Task Overview: (Detailed description of task)

This task is to startup RHR A or B in Suppression Pool Cooling from the Remote Shutdown Panels per the ONEP. This includes starting up SSW A or B.

<u>Tasks</u>: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 05-1-02	2-II1 3.9.1(2)a1
SSW A is <u>N</u> follows:	SSW System A(B) in operation, supplying RHR A heat exchangers. <u>IF</u> NOT supplying RHR A heat exchangers, <u>THEN</u> START SSW A [SSD] as K OPEN/OPEN P41-F068A(B) SSW OUTL FM RHR HX A(B) VLV.
<u>Standard</u> :	Checks open P41-F068A(B)
<u>Cue</u> :	Red light on, green light off.
<u>Notes:</u>	If step 3.9.1(2)a is not performed, the SSW system will automatically startup and lineup when the RHR pump is started.
	SAT / UNSAT



Step 2: 05-1-02-II1 3.9.1(2)a2

START P41-C001A(B), SSW PMP A(B).

Standard: Starts SSW pump

<u>Cue</u>: Red light on, green light off.

Notes:

SAT / UNSAT

Step 3: 05-1-02-II1 3.9.1(2)a3

OPEN P41-F001A(B) SSW PMP A(B) DISCH VLV.

Standard: Open valve.

<u>Cue</u>: Red light on, green light off.

Notes:

Ste	o 4: 05-1-02	2-II1 3.9.1(2)a4	
	OPEN P41-	F014A(B) SSW INL TO RHR HX A(B) VLV.	
	<u>Standard</u> :	Open valve.	
	<u>Cue</u> :	Red light on, green light off.	
	<u>Cue</u> : <u>Notes:</u>	Red light on, green light off.	
		Red light on, green light off.	



 Step 5: 05-1-02-II1 3.9.1(2)a5

 OPEN P41-F005A(B) SSW Loop A(B) RTN TO CLG TWR A(B).

 Standard:
 Open valve.

 Cue:
 Red light on, green light off.

 Notes:
 SAT / UNSAT

Step 6: 05-1-02-II1 3.9.1(2)a6

□ VERIFY CLOSED/CLOSE P41-F006A(B) SSW Loop A(B) RECIRC VLV.

Standard: Verify closed valve.

<u>Cue</u>: Green light on, red light off.

Notes:

Step 7: 05-1-02-II1 3.9.1(2)a7		
START P41-C003A(C), SSW CLG TWR FAN A(C) AND P41-C003B(D) SSW CLG TWR FAN B(D)		
light off.		
SAT / UNSAT		



Step 8: 05-1-02-II1 3.9.1(2)b

OPEN <u>OR</u> CHECK OPEN the following valves:

E12-F004A(B) RHR PUMP A(B) SUCT FM SUPP POOL

E12-F047A(B) RHR HX A(B) INL VLV

E12-F003A(B) RHR HX A(B) OUTL VLV

Standard: Checks valves open.

<u>Cue</u>: For all valves, Red light on, green light off.

Notes:

SAT / UNSAT

Step 9: 05-1-02-II1 3.9.1(2)c

□* CLOSE E12-F048A(B) RHR HX A(B) BYP VLV

Standard: Close valve.

Cue:Green light on, red light off.Notes:Throttle valve, takes 1-2 minutes to stroke. To maintain
maximum cooling (as discussed in initiating cues) this valve
must remain shut; therefore, 3.9.1(2)f and 3.9.1(2)g are NA.



Step 10: 05-1-02-II1 3.9.1(2)d

□* START E12-C002A(B), RHR PMP A(B)

Standard: Start pump.

<u>Cue</u>: Red light on, Green light off.

Notes:

SAT / UNSAT

Step 11: 05-1-02-II1 3.9.1(2)e

□* OPEN E12-F024A(B) RHR A(B) TEST RTN TO SUPP POOL


Standard: Open valve.

<u>Cue</u>: Red light on, Green light off. This completes the task. Notes:

SAT / UNSAT

Task Standard(s):

RHR A(B) is operating in Suppression Pool Cooling with E12-F048 A(B) full closed and E12-F003 A(B) full open and SSW A(B) in service to the RHR A(B) Heat Exchangers.

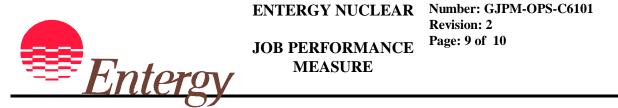

<u>Task</u>:Startup RHR in Suppression Pool Cooling from the
Remote Shutdown Panels

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):

- The Control Room has been evacuated due to noxious fumes.
- Control of the plant has been established at the Remote Shutdown Panels.
- An SRO is controlling operations at the remote shutdown panel.
- Another operator is assigned for radio communications and is monitoring reactor level and pressure.
- A Plant Shutdown Operator is stationed in the Auxiliary Building if needed.
- The RSD room cabinet at the remote shutdown panel is unlocked.
- The reactor is shutdown
- RPV water level is within band of +30 to -30" on wide range level.
- RPV pressure is within band of 900 to 1000 psig.
- RHR Transfer switches have been placed in EMERG position per step 3.6 of the Shutdown from the Remote Shutdown Panel ONEP.
- Standby Service Water A and B are not running and are in Standby lineup per the P41 SOI.
- RCIC will be started after RHR A or B is placed in suppression pool cooling mode.

Initiating Cue(s):

- You have been directed to place RHR _____ in Suppression Pool Cooling per Attachment _____ of the Shutdown from the Remote Shutdown Panel ONEP.
- Establish maximum cooling.



ENTERGY NUCLEAR

JOB PERFORMANCE MEASURE

Number: GJPM-OPS-L62-3
Revision: 1
Page: 1 of 9
Rtype:
QA Record
Number of pages
Date Initials

TRAINING PROGRAM:			
NRC Operating Exam			
	JPM-PS3		
Time Critical	Alternate Path Validation Time: 15 mi	n	
TITLE:			
Startup an ESF Static Inverter (1Y87, 1Y88, 1Y95, 1Y96)			
New Material	Minor Revision Major Revision	n Cancellation	
REASON FOR RE	REASON FOR REVISION:		
THIS DOCUMEN	<u>T REPLACES</u> :		
REVIEW / APPR	OVAL (Print Name): TEAR Approval ()		
Prepared By:	Mark Pait	6/13/11	
	**Preparer	Date	
Ops Review ^{++:}	Keith Huff	9/26/2011	
· _	Technical Reviewer (e.g., SME, line management)	Date	
Validated By:	Chris Laird	9/26/2011	
• _	Training Representative	Date	
	V D I	0/00/0011	
Approved By:	Kane Ryder ⁺ Discipline Training Supervisor	<u>9/28/2011</u> Date	
۸		Dait	
Approval Date:*_	9/28/2011		

* Indexing Information

** The requirements of the Training Material Checklist have been met.

⁺ Indicates that the LP has been reviewed by the Training Supervisor for inclusion of Management Expectations and items referenced on TQJA-201- DD06, Training Material Checklist.

++ Indicates that Operations has reviewed and approved this material for exam use.

FLEET/REGIONAL PROGRAM CONCURRENCE:

Not Applicable Fleet ENS **ENN** DATE INITIAL RECEIPT **RETURNED FOR RETURN RECEIPT** FINAL ACCEPTANCE TRANSMITTED BY RM CORRECTIONS (DATE/INITIAL) BY RM TO RM (DATE/INITIAL) (DATE/INITIAL) (DATE/INITIALS)



Number: GJPM-OPS-L62-3 ENTERGY NUCLEAR **Revision: 1** Page: 2 of 10 **JOB PERFORMANCE**

MEASURE

Startup an ESF Static Inverter Task:

Setting:	Plant (Outside CAA)
<u>Type</u> :	NLO
<u>Task</u> :	AON-L62-002
<u>K&A</u> :	262002 A4.01 (2.8/3.1)
Safety Function:	6 - Electrical
Time Required:	15 minutes
Time Critical:	No
Faulted:	No
Performance:	Simulate
Reference(s):	04-1-01-L62-1, Static Inverter SOI
Handout(s):	04-1-01-L62-1, Static Inverter SOI including Attachment III
<u># Manipulations:</u>	4
# Critical Steps:	4
<u>Group #</u> :	1

Simulator Setup/Required Plant Conditions:

- Area 25A, elevation 111' is accessible
- Shift Manager/CRS permission to conduct JPM's.
- Write in on the Initial Conditions Page which INVERTER is to be started.

Safety Concerns:

- Wear appropriate personal protective equipment.
- Do NOT operate plant equipment.
- This JPM can be performed on any of 4 ESF inverters, ensure the inverter chosen for this JPM is not part of the protected train.



ENTERGY NUCLEAR Number: GJPM-OPS-L62-3 Revision: 1

Page: 3 of 10

JOB PERFORMANCE MEASURE

Name:	Time Start:	Time Stop:
Initial Condition(s):		

All of the following conditions apply to inverter 1Y_____

- Inverter is shutdown with both Battery Input Breaker CB1 and Inverter Output Breaker CB2 Open.
- The Heater breaker is off.
- The Alternate Source is supplying loads (Alternate Source Breaker Closed).
- DC Bus is energized with the inverter battery feeder breaker closed.
- The Manual Bypass Switch is selected to Alternate Source to Load.

Initiating Cue(s):

• The CRS directs you to startup Inverter 1Y_____ and transfer the loads to the normal source per SOI 04-1-01-L62-1 section 4.2.



Task: Startup an ESF Static Inverter

Notes: (Notes to Evaluator)


1. Be sure a non-protected train ESF inverter is selected and recorded on the initiating cues page.

Task Overview: (Detailed description of task)

This task is to startup an ESF Static Inverter and transfer loads to the inverter per the SOI.

Tasks: Critical tasks are underlined, italicized, and denoted by an (*)

Step 1: 04-1-01-L62-1 Step 4.2.2d
CLOSE BATTERY INPUT circuit breaker on 1Y87 (1Y88, 1Y95, 1Y96) AND CHECK the following:
DC input voltmeter reads approximately 105 to 140 volts.
Inverter AC output frequency is reading 60 hertz \pm 0.1 hertz.
INVERTER OUTPUT UNDERVOLTAGE Red indicating light is Off.
INVERTER CURRENT LIMIT Red indicating light is Off.
INVERTER OVERHEATING Red indicating light is Off.
IN SYNC Amber indicating light is On (delayed).
FAN FAILURE Red indicating light is On.
Standard: Close CB1, Battery input breaker.
<u>Cue</u> : DC input voltage and AC frequency are as indicated on the inverter, all other indications are as indicated by the procedure.

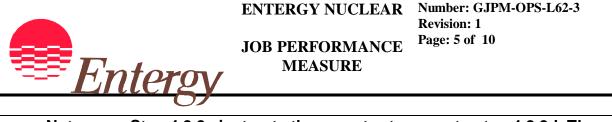

<u>Notes:</u> Step 4.2.2a instructs the operator to move to step 4.2.2d. The inverter will remain in Alternate Supplying Load until the last step where the Inverter to Load pushbutton is depressed.

SAT / UNSAT

Step 2: 04-1-01-L62-1 Step 4.2.2e

□* **CLOSE** Inverter Output circuit breaker on 1Y87 (1Y88, 1Y95, 1Y96).

Standard: Close CB2, Inverter output breaker.

<u>Cue</u>:

Notes:	Closing this breaker does not change indications on the
	inverter.

SAT / UNSAT

 Step 3: 04-1-01-L62-1 Step 4.2.2f

 CHECK IN SYNC light is On; IF OUT OF SYNC light is On, THEN CONTACT

 Electrical and DO NOT proceed until IN SYNC light is On. There is some time delay to achieve the IN SYNC light.

 Standard:
 Checks IN SYNC light lit.

 Cue:
 IN SYNC light is on.

 Notes:
 Votes:



Step 4: 04-1-01-L62-1 St	ep 4.2.2g	
□* IF IN SYNC light is On	, Perform the following:	
□* <u>TRANSFER Manu</u>	al Bypass switch to NORMAL OF	PERATION position
ALTERNATE SOL	JRCE AVAILABLE (Amber) - On	
ALTERNATE SOL	JRCE POWERING LOAD (Red) -	On
Standard: Places N	anual Bypass switch to NORM	AL OPERATION
Cue: Alternate	e source available and power	ing load lights are on.
Notes:		
		SAT / UNSAT



Step 5: 04-1-01	I-L62-1 Step 4.2.2h	
□* <u>DEPRESS</u>	INVERTER TO LOAD pushbutton AND CHE	CK following indications:
	TER POWERING LOAD Amber light is On.	
□ BATTE	RY NEAR EXHAUSTION light - Off	
	TER CURRENT LIMIT light – Off	
🗌 FAN FA	AILURE - Off	
	TER OVERHEATING light - Off	
	TER OUTPUT UNDERVOLTAGE light – Off	
	TER POWERING LOAD light - On	
🗌 In SYN	C light - On	
□ System	n AC output (volts) - approximately 120 Vac <u>-</u>	<u>+</u> 5 volts
	r AC output (hertz) - 60 hertz <u>+</u> 0.1 hertz	
Standard:	Depress inverter to load pushbutton.	
<u>Cue</u> :	If the inverter is already supplying the are as seen on the inverter.	e load, then indications
	Otherwise, system AC output is 120 V indications as indicated by the proce	
	This completes the JPM.	
<u>Notes:</u>		
		SAT / UNSAT

Task Standard(s):

Inverter is started and supplying the load per 04-1-01-L62-1 section 4.2.



JOB PERFORMANCE

ENTERGY NUCLEAR

Number: GJPM-OPS-L62-3 Revision: 1 Page: 8 of 10



<u>Task</u>: Startup an ESF Static Inverter

Follow-Up Questions & Answers:

Comments:

Give this page to the student

Initial Condition(s):	
All of the following conditions	s apply to inverter 1Y
Open.The Heater breaker is off.The Alternate Source is suDC Bus is energized with	both Battery Input Breaker CB1 and Inverter Output Breaker CB2 applying loads (Alternate Source Breaker Closed). the inverter battery feeder breaker closed. h is selected to Alternate Source to Load.

Initiating Cue(s):

• The CRS directs you to startup Inverter 1Y_____ and transfer the loads to the normal source per SOI 04-1-01-L62-1 section 4.2.

Scenario Outline

Form ES-D-1

|--|

Page 1 of 3

Facility: Grand Gulf Nuclear Station Scenario No.: 1 Op-Test No.: 12/11
Examiners: Operators:
Objectives: To evaluate the condidates' ability to encrete the facility in response to the
Objectives: To evaluate the candidates' ability to operate the facility in response to the following evolutions:
1. Inoperable Primary Containment Air Lock
 Rotate CRD Pumps. Respond to a CRD Pump Trip.
4. Lower reactor power using Recirc Flow Control.
 Respond to a Recirc Pump Trip. Respond to ST-11 and 15AA lockout.
7. Take actions for RPS fails to scram.
 Take actions for an ATWS. Respond to a FW Line A Break in the Drywell.
Initial Conditions: Operating at 100% power.
initial Conditions. Operating at 100% power.
Inoperable Equipment: None
Turnover:
The plant is at rated power. Rotate CRD pumps in accordance with the C11-1 SOI in preparation for
CRD pump "A" maintenance. There is no out of service equipment and EOOS is GREEN. It is a division 1 work week.
Scenario Notes:
This scenario was written from lesson plan GSMS-RO-EP033 revision 6. Attributes have been altered
in order to meet the requirements of NUREG 1021 ES-301 section D.5.b, and is considered significantly modified.
Validation Time: 60 minutes

Appendix D

Form ES-D-1

Scenario 1

Page 2 of 3

Event No.	Malf. No.	Event Type [†]	Event Description
1		TS (CRS)	Primary Containment Air Lock seal fails to inflate (TS 3.6.1.2)
2		N (BOP)	Rotate CRD pumps (SOI 04-1-01-C11-1 section 5.5)
3	C11028b	C (BOP) A (CREW)	CRD pump Trip (CRD Malfunctions (05-1-02-IV-1) ONEP section 2.1.2)
4		N (BOP) R (ACRO)	Lower generator load by 200 MWe using FCV's (IOI 03-1-01-2 Attachment VIII)
5	rr012a	C (ACRO) R (BOP) A (CREW) TS (CRS)	Recirc Pump Trip (Reduction in Recirc Flow (05-1-02-III-3) ONEP, TS 3.4.1, TR 3.4.1)
6	r21133a r21139e	M (CRS, BOP)	Service Transformer 11 and ESF 15AA bus lockout (Loss of AC Power (05-1-02-I-4) ONEP)
7	c71076	I (ACRO)	 RPS fails to scram the reactor when the second Recirc pump trips and the Exclusion Region of the power to flow map is entered (Reduction in Recirc Flow (05-1-02-III-3) ONEP) * Second Recirculation pump trips. Crew inserts manual reactor scram as observed by control rods inserted and scram annunciators received. Criterion is to give the highest priority to insert a manual scram.

Appendix D	Scenario Outline	Form ES-D-1

8	c11164 e51044	M (All)	 When EP- terminates RCIC per ECCS syst evidenced highest pr RCIC unti Reactor pr slowly rais Table 5 sy greater that 	oower with reduced feed capability (EP-2A) 2A requires Emergency Depressurization, G 5 and prevents all injection except boron, Cl 02-S-01-27 Operations Philosophy. Feedwa tem alignments prevent injection into the Rl by available instrumentation. Criterion is to iority to prevent all injection except boron, il reaching MSCP. ressure decreases to MSCP. Crew comments ses injection utilizing available EP-2A Table stems with RPV level restored and maintain an -191". Criterion is to give the highest pr PV level greater than -191".	RD, and atter and PV as to give the CRD, and ces and t 4 and/or ned to
9	fw171a rr063a	M (ACRO)	Feedwater Lir	ne A rupture inside the Drywell.	
		eactivity, (l)nstru As defined in NU		ponent, (M)ajor, (A)bnormal (TS) Tech s pendix D)	Spec
		Qua	Intitative A	ttributes Table	
Normal E	vents		2	Abnormal Events	2
Reactivity	Manipulations		2	Total Malfunctions	6
Instrumer	t/Component F	ailures	3	EP Entries (Requiring substantive action)	1
Major Tra	nsients		3	EP Contingencies	1
Tech Spe	c Calls		2	Critical Tasks	3

Scenario 1

Page 1 of 21

Simulator Setup:

- A. Initialization
 - 1. Log off all simulator PDS and SPDS computers (PDS and SPDS must come up after the simulator load for proper operation).
 - 2. Startup the simulator using Simulator Instructor's Job Aid section 6.3.

Note: **Prior to running the Schedule File, ensure no Event Files are Open.** If an existing Event File is Open prior to running the Schedule File, then any associated Event Files will not automatically load.

3. Open Schedule.exe and Director.exe by clicking on the Icon in the Thunder Bar.




- 4. Set the Simulator to **IC-31** and perform switch check (Using Quick Reset in Director).
- Click on "Open" in the Schedule window and Open Schedule File "2011 NRC Scenario 1.sch" (in the Schedule Directory)

	edule					
File Ec	lit View	Help	_			00:00:00[00]
New	<u>O</u> pen	<u>S</u> ave	<u>D</u> elete 9	Stopped	Frozen	
		@Time	Event	Action	Description	

6. In Schedule window, click on the **"Stopped**" red block. The red block will change to a green arrow and indicate the scenario is active ("**Running**").

7. Click the Summary tab in the Director window. Verify the schedule files are loaded and opened per Section B below. (Note: Any actions in the schedule file without a specific time will not load into the director until triggered.)

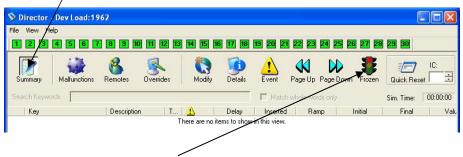

- 8. Take the simulator out of freeze.
- 9. Log on to all simulator PDS and SPDS computers.
- 10. Verify or perform the following:
 - IC-31
 - APRM's are turned on (4,1,2,3)
 - Ensure the correct rod movement sequence available at the P680.
 - Advance all chart recorders and ensure all pens inking properly.
 - Clear any graphs and trends off of SPDS.
- 11. Run through any alarms and ensure alarms are on. (Note: On T-Rex, to verify alarms are ON, the indicator will indicate "Alarms On").
- 12. Place the simulator in Freeze.
- B. File loaded verification:

Required Operator Actions

Form ES-D-2

Scenario 1

Page 3 of 21

New	Dpen	Save .	D elete F	Running	00:00:00[0
Insert	Pause	@Time	Event	Action	Description
				^NRC EXAM GGN 2011 Senario 1	
1	Г			^CRD pump B Trip	
-	Γ	00:00:00		create event 5 zlo4(951) == 1	
			5	Insert malfunction c11028b after 120 on event 5	CRD Hydraulic Pump B Trip
	Γ				
	1			^Recirc Pump A Trip	
~	Γ	00:00:00		create event 8 xcr4n41r789_c88 < 1275	
	Ē		8	Insert malfunction rr012a on event 8	Reactor Recirculation Pump Trip (CB5A)
	Г				1
	Γ			^ST11 lockout/15AA lockout	
	Γ		10	Insert malfunction r21133a on event 10	Service Transformer 11 Lockout
			10	Insert malfunction r21139e after 5 on event 10	4160 V Bus 15AA Overcurrent Trip
_	Γ				· · · · · · · · · · · · · · · · · · ·
			11	Insert remote r21353 to RESET on event 11 delete in 2	12HE BUV LOR
	Г		11	Insert remote r21355 to RESET on event 11 delete in 2	13AD BUV LOR
	Γ				
	Γ			^FW Line A break	
~	Г	00:00:00		create event 12 xcr4n41n785 < 100	
	Γ		12	Insert malfunction fw171a after 420 to 40 on event 12	Feedwater Line A ruptures inside Drywell
			12	Insert malfunction rr063a after 420 to 0.01 in 200 on event 12	
_	Ē				
	-			^Begining Scenario Malfunctions	
-	Г	00:00:00		Set xrr1fw207 = 1	Reset CST Level
~	Г	00:00:00		Insert malfunction c71076	Fail to Scram (Manual Scram Operable) At
~	Γ	00:00:00		Insert malfunction c11164 to 10	CRD HYDRAULIC BLOCK
~		00:00:00		Insert malfunction e51044 to 0.00000	RCIC Turbine Speed Control Failure (VAR
					
	Γ				
<				III.	>
•		Ifunction e510	MA No 0.000		

Appendix D

Required Operator Actions

Form ES-D-2

Scenario 1

Page 4 of 21

Afunctions Remotes Overrides Description Fail to Scram (Manual Scram Op CRD HYDRAULIC BLOCK RCIC Turbine Speed Control Fail.		Delay 00:00:00 00:00:00 00:00:00	Event Match	Page Up Page Dowr whole words only Ramp 00:00:00 00:00:00 00:00:00	Final Active 10 0	Quick Reset	00:00:
Fail to Scram (Manual Scram Op CRD HYDRAULIC BLOCK	. 🖓 	00:00:00 00:00:00		Ramp 00:00:00 00:00:00	Active 10	Value InActive O	
Fail to Scram (Manual Scram Op CRD HYDRAULIC BLOCK	. 🖓 	00:00:00 00:00:00	Inserted	00:00:00 00:00:00	Active 10	InActive 0	8
CRD HYDRAULIC BLOCK		00:00:00		00:00:00	10	0	8
RCIC Turbine Speed Control Fail		00:00:00		00:00:00	0	0	

Scenario 1

Page 5 of 21

Crew Turnover:

- A. Assign the candidates crew positions.
- B. Turnover the following conditions:

Power	100%
Pressure	1025 psig
BOC	
EOOS	GREEN

Planned Evolutions this shift:

- Mechanical will be performing maintenance on CRD pump "A" later this shift. Rotate CRD pumps per the C11-1 SOI when you take the shift.
- Note that an independent Reactivity Management SRO per Operations Philosophy 6.8.1 will not be provided for this scenario.
- C. Allow the crew to perform pre-shift brief and review procedures for planned evolutions.
- D. Bring the crew into the Simulator, place the simulator is in RUN.
- E. Allow the crew to walk down panels.
- F. When the crew assumes the shift begin Scenario Activities.

Scenario 1

Page 6 of 21

SCENARIO ACTIVITIES:

A. Start SBT report and any other required recording devices (Video recording not allowed for NRC exams).

Rotate CRD Pumps (Normal)/Containment door seal failure(tech spec call only):

- B. The crew will start CRD pump B and stop CRD pump A using 04-1-01-C11-1, Control Rod Drive Hydraulic System SOI.
 - 1. When directed by the Control Room to perform pre-pump start checks:
 - a. Report that CRD pump "B" oil sump, motor and gearbox oil levels are normal and pre-pump start check is complete.
 - 2. When directed by the Control Room to CLOSE C11-F217B:
 - a. Wait 30 seconds then report to the Control Room "C11-F217B is closed."
 - 3. When directed to vent CRD pump "B" by opening then closing C11-F109B:
 - a. Wait 30 seconds then report "C11-F109B was cycled open then shut. CRD pump B is vented."
 - 4. When directed by the Control Room to OPEN C11-F217B:
 - a. Wait 45 seconds then report to the Control Room "C11-F217B is open."
 - b. Call the Control Room and report as the Aux Building Rover that you were unable to get the seal to inflate for the Aux Building door Air Lock on 119' elevation.
 - c. The CRS will enter TS 3.6.1.2 condition A.
 - *d.* If directed by the CRS, report that Containment door in the 119' elevation Air Lock is closed with the seal inflated.
 - 5. When directed by the Control Room to CLOSE C11-F217A:
 - a. Wait 30 seconds then report to the Control Room "C11-F217A is closed."
 - 6. When directed by the Control Room to OPEN C11-F217A:
 - a. Wait 45 seconds then report to the Control Room "C11-F217A is open."
 - 7. When directed by the Control Room to Check CRD purge flows are 1.5 to 2.5 gpm on C11-FI-R020A & B:
 - a. Report to the Control Room that CRD purge flows are 2 gpm on both CRD pumps.

CRD Pump Trip (Control Rod/Drive Malfunctions ONEP):

NRC

- C. CRD pump "B" will trip 2 minutes after CRD pump "A" is stopped (Auto Event 5).
- D. The crew will take Immediate Operator Action per CRD malfunctions ONEP to restart CRD pump A.
- E. If asked as the local operator to investigate the pump trip, wait 3 minutes and report back to the Control Room that CRD pump "B" breaker 152-1605 tripped on over current. If sent to the pump to investigate, report that CRD pump "B" is hotter than normal and is not running.
- F. Give the crew time to allow them to perform a transient brief before moving to the next step.

Reduce reactor power using FCVs (Normal/Reactivity):

- G. Call the control room as the Shift Manager and direct the CRS to lower generator output by 200 MWe for a temporary down power requested by the Load Dispatcher. All notifications have been made.
 - 1. The crew will lower power using 03-1-01-2, Power Operations IOI, Attachment VIII.

<u>Recirc Pump Trip (Reduction in Recirc ONEP):</u>

- H. When generator output is below 1275 MWe, Auto Event 8 will cause Recirc Pump "A" to trip.
 - 1. The crew will take actions for Reduction in Recirc Flow Rate ONEP (THI watch, one Recirc pump stopped, and Exit Restricted Region).
 - 2. The CRS will determine that TR 3.4.1 requires setpoints of TR 3.3.2.1 to be implemented. This must be completed in 12 hours. The CRS will contact Reactor Engineering or I&C to implement the new setpoints.

SCRAM/FW Line Rupture/ATWS:

- I. When the Restricted Region is exited and the CRS has determined the need to implement single loop setpoints, and the lead evaluator is ready to move on, trigger Event 10 to insert malfunctions r2133a and r21139e to cause a lockout on Service Transformer 11 and 15AA. (Install EP Attachments as directed).
 - 1. With no Recirc Pumps running, the reactor will enter the Exclusion Region of the power to flow map. An automatic scrams are disabled; therefore, the ACRO must manually insert a scram.
 - 2. The BOP will reenergize 12HE and 13AD with the Alternate Feeder Breakers.

- 3. When directed by the control room, trigger **EVENT 11** to reset Under Voltage Lockouts on 12HE and 13AD. Wait 3 minutes to report that the lockouts were reset.
- 4. When the ACRO inserts a scram, the leak on the "A" FW line (fw171a) will be inserted after a 7 minute delay. This will prevent using Feed and Condensate to feed the reactor.
- 5. When the CRS directs Attachment 12 to be installed, install attachment 12 as "Done." Wait until reactor level is below -160" and then take the attachment paperwork to the CRS and report that attachment 12 is installed with the exception of B21-F065A being closed.

Termination:

- J. Once emergency depressurization has been conducted and reactor water level is stabilized above TAF, using RHR B E12-F053B, or as directed by Lead Evaluator:
 - Take the simulator to Freeze and turn horns off.
 - Stop and save the SBT report and any other recording devices.
 - Instruct the crew to not erase any markings or talk about the scenario until after follow-up questions are asked.

Critical Tasks:

- Second Recirculation pump trips. Crew inserts manual reactor scram as observed by control rods inserted and scram annunciators received. Criterion is to give the highest priority to insert a manual scram.
- When EP-2A requires Emergency Depressurization, Crew terminates and prevents all injection except boron, CRD, and RCIC per 02-S-01-27 Operations Philosophy. Feedwater and ECCS system alignments prevent injection into the RPV as evidenced by available instrumentation. Criterion is to give the highest priority to prevent all injection except boron, CRD, and RCIC until reaching MSCP.
- Reactor pressure decreases to MSCP. Crew commences and slowly raises injection utilizing available EP-2A Table 4 and/or Table 5 systems with RPV level restored and maintained to greater than -191". Criterion is to give the highest priority to restore RPV level greater than -191".

Emergency Classification:

Site Area Emergency on SS3 and FS1

Form ES-D-2

Scenario 1

Page 9 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: <u>1</u> Event No: <u>1</u>	
Event Desc	Event Description: Inoperable Primary Containment Air Lock		
TIME	TIME Position Applicant's Actions or Behavior		
	CRS	When the Auxiliary Building Rover reports that the Containment air lock on the 119' elevation fails to inflate:Declares Primary Containment Air Lock on 199' elevation INOPERABLE and enters TS 3.6.1.2 Condition A.	

Appendix D

Required Operator Actions

Form ES-D-2

Scenario 1

Page 10 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: <u>1</u>	Event No: <u>2</u>
Event Description: Rotate CRD Pumps			
TIME	Position	Applicant's Actions or Behavior	
	CRS	Directs the BOP to Rotate CRD pumps in accordance with SOI 04-1-0	01-C11-1.
		Rotates CRD pumps using SOI 04-1-01-C11-1 section 5.5:	
		• Notifies the local operator to perform pump pre-start checks.	
		• Notifies the local operator to CLOSE C11-F217B. (step 5.5.2	2a)
		• Notifies the local operator to cycle OPEN and SHUT C11-F1 pump B. (step 5.5.2b)	109B to vent CRD
		• Starts CRD pump B. (The BOP should alert the ACRO that h CRD B pump)	ne is starting the
		• Notifies the local operator to SLOWLY OPEN C11-F217B.	
	BOP	• Check CRD system flow has stabilized between 54 to 66 gpr	n.
		• Notifies the local operator to CLOSE C11-F217A.	
		• Stops CRD pump A.	
		• Notifies the local operator to OPEN C11-F217A.	
		• Check CRD system flow is between 54 to 66 gpm.	
		 Notifies the local operator to check CRD purge flows are 1.5 C11-FI-R020A & B. 	to 2.5 gpm on
		Check that Reactor Recirculation Seal pressure has not change	ged.

Required Operator Actions

Form ES-D-2

Scenario 1

Page 11 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 1 Event No: 3	
Event Desc	Event Description: <u>CRD Pump Trip</u>		
TIME	Position	Applicant's Actions or Behavior	
	BOP	 Recognizes and reports that CRD Pump B has tripped off. As indicated by annunciator P601-22A-C-3, CRD PMP A/B AUTO TRIP and P601-22A-A-3, CRD CHRG WTR PRESS LO. 	
	CRS	Enters the CRD Malfunctions ONEP. Ensures immediate actions for CRD pump trip are performed.	
	ACRO	Monitor for HCU faults.	
	BOP	 Take immediate operator actions per CRD malfunctions ONEP (from memory). Place CRD SYS FLO CONT (C11-R600 on P601-22B) in MANUAL and REDUCE output to zero. Start CRD pump A. Slowly adjust CRD SYS FLO CONT to 54-66 gpm after charging pressure returns to normal. (~1700 psig) Return CRD SYS FLO CONT to AUTO with tapeset at 54-66 gpm. THERE ARE NO REQUIRED SUBSEQUENT ACTIONS FOR THIS EVENT 	
	CREW	Ensure that an operator or electrician is sent to investigate the cause of the pump trip.	

Form ES-D-2

Scenario 1

Page 12 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 1 Event No: 4	
Event Desc	Event Description: Lower Generator Output 200 MWe		
TIME	Position	Applicant's Actions or Behavior	
	CRS	Conducts reactivity brief for the planned power reduction. Power Reduction is per IOI-2 attachment VIII. Directs the ACRO to lower reactor power using the Recirc FCV's in slow detent. Directs the BOP to maintain Load Demand +/- 25 MW of Load Demand Limited.	
	ACRO	Lowers power by closing the Recirc FCVs A & B using loop flow controllers B33K603A & B in slow detent on P680-3B (IOI-2 attachment VIII step 12.3).	
	ВОР	Lowers Load Demand as power is reduced by depressing EHC LOAD REF DEMAND LOWER pushbutton (P680-9C) to maintain generator actual load within +/- 25 MW of the load demand limited value during power reduction (IOI-2 attachment VIII step 12.2).	

Form ES-D-2

Scenario 1

Page 13 of 21

Op-Test N	o: <u>12/11</u>	Scenario No: <u>1</u> Event No: <u>5</u>
Event Des	cription: <u>Rec</u>	irc Pump Trip
TIME	Position	Applicant's Actions or Behavior
	ACRO	 Recognizes and reports that Recirc Pump A has tripped off. As indicated by annunciator P680-3A-B-4, RECIRC PMP A OVERLD/TRIP
	CRS	Enters the Reduction in Recirculation ONEP.
	ACRO	Reports Entry into the Restricted Region of the power to flow map. Establishes THI watch without concurrent duties.
	CRS	Directs the BOP to Close the B33-F067A (Recirc Pump A discharge valve).
	BOP	Shuts B33-F067A (P680-3C).
	CRS	Initiate actions to exit the Restricted Region by either opening Recirc FCV B or inserting CRAM rods. Conducts reactivity brief for unplanned power change.
	BOP	Exits the Restricted Region by either opening Recirc FCV B or inserting CRAM rods as directed by the CRS.
	ACRO	Peer checks the BOP if CRAM rods are inserted.
	CRS	 Once the Restricted Region is exited, direct the following actions (per the Reduction in Recirc ONEP subsequent actions): Ensure the operating Recirc Loop flow is <44,600gpm. Re-open B33-F067A after it is closed for 5 minutes. Open the Recirc "A" FCV to the maximum position. Per TS 3.4.1, TR 3.4.1 and Reduction in Recirc ONEP, determine and inform the Reactor Engineer or I&C that Single Loop setpoints must to be established within 12 hours from the time single loop operation was entered and surveillance 06-RE-1J11-V-001 must be performed. The CRS will not have time to address each of these actions since the scenario will move forward once the Restricted Region is exited and need for single loop setpoints is identified per the requirements of TR 3.4.1.

Scenario 1

Op-Test No	p: <u>12/11</u>	Scenario No: _1_ Event No: _6	
Event Desc	Event Description: Lockout on ST11 and 15AA		
TIME	Position	Applicant's Actions or Behavior	
		Recognizes and reports to the CRS a lockout on ST11.	
		As indicated by annunciators P807-2A-A-4/5, SVC XFMR 11 PRI/SEC LOCKOUT TRIP.	
		The ST11 lockout will cause a loss of the remaining Recirc pump	
	BOP	Takes Immediate Actions for Loss of AC Power.	
		 Re-energizes the 12HE and 13AD busses using the Alternate Feeders (P807- 1C/2C). 	
		• Directs the local operator to RESET under voltage lockouts on 13AD and 12HE busses.	
	CRS / BOP	Ensure that Electrical Maintenance is dispatched to recover the 15AA bus.	
		Enters the Loss of AC Power ONEP.	
	CRS	Ensures immediate actions for Loss of AC Power ONEP are performed.	
		• Ensure 12HE and 13AD are reenergized.	

Required Operator Actions

Form ES-D-2

Scenario 1

Page 15 of 21

Op-Test No: <u>12/11</u> Scenario No: <u>1</u> Event No							
Event Description: Failure of RPS to Scram							
TIME	Position	Applicant's Actions or Behavior					
		* Second Recirculation pump trips. Crew inserts manual reactor scram as observed by control rods inserted and scram annunciators received. Criterion is to give the highest priority to insert a manual scram. (The RPS automatic scram has been disabled)					
		Report to CRS that he is placing the Mode SW in SHUTDOWN.					
		Place the Mode SW to SHUTDOWN.					
		Provides a scram report:					
	ACRO	• Reactor Mode SW in SHUTDOWN.					
		• All Rods are NOT Inserted (Hyd Block ATWS).					
		• Reactor power is below 4%.					
		• Reactor water level and trend.					
		• Reactor pressure and trend.					
		• Feedwater is recoverable (but will be lost when the MSIV's close on loss of air to containment).					
		• Bypass valves are available.					

Scenario 1

Page 16 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: <u>1</u> Event No: <u>8</u>				
Event Desc	Event Description: <u>ATWS</u>					
TIME	ME Position Applicant's Actions or Behavior					
TIVIL	TOSITION	Enter the SCRAM ONEP and the Turbine and Generator Trips ONEP.				
	CRS	Enter EP-2, when ATWS is discovered Enter EP-2A.				
		Direct actions of EP-2A steps 1 - 4:				
		• Directs ACRO to Verify Recirc Pumps transferred to LFMG.				
	CRS	• Directs ACRO to Verify ARI/RPT initiation.				
		• Directs BOP to inhibit ADS.				
		Directs BOP to Override HPCS injection.				
		Verify Recirc Pumps transferred to LFMG.				
	ACRO	Verify/Initiate ARI/RPT.				
		Inhibits ADS.				
		• Place ADS "A" and ADS "B" keylock switches to "INHIBIT"				
	BOP	Override HPCS injection.				
		• Place the HPCS pump handswitch to the "STOP" position.				
		 Place the E22-F004, HPCS injection valve, handswitch to the "CLOSE" position. 				
	CRS	Direct the ACRO or BOP to verify Division 3 generator running with cooling water and that Isolations for Reactor Level 2 are completed.				
		Verify Division 3 Diesel Generator is running with cooling water.				
	ACRO / BOP	Isolations for Reactor Level 2 are completed.				
		r				
		Enter EP-2A step L-6 or L-7 and direct the ACRO to establish level band -70 to -130" (The CRS may initially establish a band of 11.4 to 53.5", but since the ATWS is producing significant heat, he should opt to lower level to lower power and may override Low Pressure ECCS systems).				
	CRS	Enter EP-2A step P-4 and direct the BOP to establish a pressure band $800 - 1060$ psig using IPC and BCV Manual Jack (The CRS may establish a pressure band of $450 - 600$ psig when the MSIV's close and the Feed pumps subsequently trip).				
		Call for EP Attachments 8, 12, 18, 19, 20, and 28 (only attachment 12b and 28 will be useful, the CRS may opt to only call for these attachments).				

Required Operator Actions

Form ES-D-2

Scenario 1

Page 17 of 21

Op-Test No: <u>12/11</u>	Scenario No: <u>1</u>	Event No: <u>8 cont</u>
Event Description: <u>AT</u>	<u>ws</u>	
BOP	If directed by the CRS, Reduce reactor pressure using IPC (by depressing the " BCV Manual Jack (by depressing the "MAN BYP ON/ BYP CONT LOWER" PB) to pressure band 450 – 600	/OFF" PB and then the "MAN
ACRO	 Line up Feed and Condensate systems for Startup Leve If two Feed pumps are running, trip one. Close N21-F009A and N21-F009B. Open N21-F001, N21-F010A and N21-F010B Verify Closed N21-F513, N21-F510, N21-F04 If no Feed pumps are in operation, start one. Ensure RFPT A(B) controls "Manual Verify AC lube oil pump is running Open N21-F014A(B) Depress the TRIP RESET pushbuttor Depress the RAISE pushbutton to est pressure above reactor pressure by ap Open/Verify Open N21-F014A or N21-F014E Maintain reactor level in Auto or Manual usin Manually using N21-F040 or N21-F009A(B). Feed the reactor using the Startup Level Controller to m set level band (11.4 to 53.5" or -70 to -130"). 	 3. 40. 1" pushbutton is backlit. n tablish Feed pump discharge pprox. 250 psig. 3 g the Startup level controller or

Required Operator Actions

Form ES-D-2

Scenario 1

Page 18 of 21

Op-Test No: <u>12/11</u>		Scenario No: <u>1</u>	Event No: <u>9</u>				
Event Desc	Event Description: Feedwater Line A rupture in the Drywell						
TIME	Position	Applicant's Actions or Behavior					
	ACRO	 Recognize symptoms of a FW Line A rupture in the Drywell. As indicated by uneven feed flow to the reactor between water lines. Also indicated by rising DW pressure and temperature. Report the Feed water leak to the CRS. Trip all condensate pumps. (This is necessary to stop the leak in th feed water line isolations to the reactor have lost power, N21-F065 	e drywell since the				

Scenario 1

Page 19 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 1 Event No: 8 cont.
Event Desc	cription: AT	<u>ws</u>
TIME	Position	Applicant's Actions or Behavior
	ACRO	Keep CRS updated with reactor level as it trends down (following the loss of feed).
	CRS	 When EP Attachment 12 is installed or reactor level reaches -191", Exit Level and Pressure Legs of EP-2A and Enter Emergency Depressurization. * When EP-2A requires Emergency Depressurization, Crew terminates and prevents all injection except boron, CRD, and RCIC per 02-S-01-27 Operations Philosophy. Feedwater and ECCS system alignments prevent injection into the RPV as evidenced by available instrumentation. Criterion is to give the highest priority to prevent all injection except boron, CRD, and RCIC until reaching MSCP.
	CRS	Verify SP level is above 10.5 ft. Direct the BOP or ACRO operator to verify/perform Terminate and Prevent injection into the RPV by overriding low pressure systems (LPCS/LPCI) Direct BOP to Open 8 ADS valves.
	ACRO / BOP	 When directed, Terminate and Prevent injection into the RPV. Verify HPCS is initiated with annunciators P601-16A-B-5, HPCS MTR CONT MAN OVERRD, and P601-16A-D-5, HPCS INJ VLV F004 MAN OVERRD in. Verify/perform low pressure ECCS systems overridden by ensuring division 2 ECCS initiation signal is present and placing the LPCI B and C pump hand switches to off and placing the E12-F042B and C handswitches to CLOSE. This is verified by annunciators P601-17A-B-1, RHR INJ VLV F042B MAN OVERRD, P601-17A-C-2, RHR PMP B MAN OVERRD, P601-17A-B-4, RHR INJ VLV F042C MAN OVERRD, and P601-17A-C-5, RHR PMP C MAN OVERRD in.
	BOP	Opens at least 7 ADS valves.

Required Operator Actions

Form ES-D-2

Scenario 1

Page 20 of 21

Op-Test No	o: <u>12/11</u>	Scenario No: <u>1</u>	Event No: <u>9 cont.</u>			
Event Desc	ription: <u>ATV</u>	<u>vs</u>				
	CRS	Enter EP-2A step L-10 (following the Emergency De Establish reactor pressure as critical parameter for the	step L-10 (following the Emergency Depressurization). ctor pressure as critical parameter for the ACRO.			
	ACRO	Keep CRS updated with reactor pressure as it trends of	down.			
	CRS	 When reactor pressure is below MSCP (219 psig) direction using RHR B via the E12-F053B with 4000 gpm and until reactor level begins to trend up. * Reactor pressure decreases to MSCP. Crew consistent of the constraint of the sector of the constraint of the constrai	then at intervals of 1000 gpm mmences and slowly raises for Table 5 systems with RPV 191". Criterion is to give the an -191".			
	CRS	Enter EP-3 on Suppression Pool Temperature and Dry substantial operator actions are expected for this entry				

Scenario 1

Page 21 of 21

Give this page to the CRS

Turnover the following conditions:

Power	100%
Pressure	1025 psig
BOC	
EOOS	GREEN

Planned Evolutions this shift:

- Mechanical will be performing maintenance on CRD pump "A" later this shift. Rotate CRD pumps per the C11-1 SOI when you take the shift.
- <u>Note that an independent Reactivity Management SRO per Operations Philosophy</u> <u>6.8.1 will not be provided for this scenario.</u>

Appendix E)
------------	---

Scenario Outline

Form ES-D-1

Sc	ena	ario	2

Page 1 of 3

Facility: Grand Gulf Nuclear Station Scenario No.: 2 Op-Test No.: 12/11
Examiners: Operators:
 <u>Objectives:</u> To evaluate the candidates' ability to operate the facility in response to the following evolutions: Place SSW "A" in STANDBY. Raise reactor power using Recirc Flow Control. RPS "A" MG failure. Electric Power Monitoring Assembly INOPERABLE. Two APRM channel failures. Fuel cladding leak. RCIC fails to start on initiation. RCIC room unisolable steam leak.
Initial Conditions: Operating at 85% power.
Inoperable Equipment: APRM "F" is failed downscale and bypassed.
Turnover:
A plant startup is in progress with all steps complete up to step 6.8 of Attachment II in 03-1-01-2 (Power Ascension From 60% to Full Power). The crew will place SSW "A" in STANDBY upon assuming the shift. When SSW "A" is in STANDBY, raise reactor power to 100% of rated.
Scenario Notes:
This scenario was written from lesson plan GSMS-RO-EP015 rev. 8. Attributes have been altered in order to meet the requirements of NUREG 1021 ES-301 section D.5.b, but is <u>not</u> considered significantly modified.
Validation Time: 50 minutes

Form ES-D-1

Scenario 2

Page 2 of 3

Event No.	Malf. No.	Event Type	Event Description		
1	p41f005a_i	C (BOP)	Place SSW "A" in Standby (SOI 04-1-01-P41-1 section 4.6)		
2		N (BOP) R (ACRO)	Raise Reactor power using FCV's (IOI 03-1-01-2 Att. 2 step 6.8)		
3	c71077a	C (BOP) A (CREW)	RPS "A" MG failure (Loss of One or Both RPS Buses (05-1-02-III-2) ONEP)		
4		TS (CRS)	Electric Power Monitoring Assembly INOPERABLE (TS 3.3.8.2)		
5	c51010f c51010d	I (ACRO) TS (CRS) A (CREW)	Two APRM channel failures (ARI/TS 3.3.1.1)		
6	rr071 rm157a rrd21k648a_d rrd21k648b_d rrd21k648c_d rrd21k648d_d	M (CREW) R (ACRO)	 Fuel cladding leak (Off-Gas Activity High (05-1-02-II-2) and SCRAM (05-1-02-I-1) ONEP) * Fuel failure is occurring and main steam line radiation is greater than 3 times normal full power background as indicated by MSL B / MSL C RAD HI-HI or MSL A / MSL D RAD HI-Hi alarms, the crew closes MSIVs and MSL drains per EP-4. The crew closes the MSIVs and MSL drains and observes valve position indications and lowering pressure trend downstream of the MSIVs. Criterion is to give the highest priority to close the four inboard MSIVs or the four outboard MSIVs and MSL drains when MSL radiation is greater than 3 times normal full power background. 		
7	e51043 DI_1E51M625D	I (ACRO / BOP)	RCIC fails to start on initiation (SOI 04-1-01-E51-1)		

Appendix D		Scenari	Scenario Outline Fo			
				ario 2	Page 3 of 3	
8	8e51187a e51187b rrd21k603 rrd21k613M (CREW)RCIC room unisolable steam leak (EP-4)8e51187b rrd21k603 rrd21k613M (CREW)* A primary system is discharging outside primary containment and area temperatures, radiation levels, or water levels are above their max safe values in two or more areas. The crew opens 8 ADS/SRVs and observes lowering pressure trend and valve position indications (tailpipe pressure indication lamps or solenoid valve energized). Criterion is to give the highest priority to open at least seven SRVs when area temperatures, radiation levels, or water levels are above their maximum safe values in two or more areas.					
† *	(N)ormal, (R)ea Critical Task (A	activity, (I)nstrui		nponent, (M)ajor, (A)bnormal (TS) Teo pendix D)	ch Spec	
				ttributes Table		
Normal Events			1	Abnormal Events	3	
Reactivity Manipulations		2	Total Malfunctions	5		
Instrument/Component Failures			4	EP Entries (Requiring substantive action)	2	
Major Transients			2	EP Contingencies	1	
Tech Spec Calls			2	Critical Tasks	2	

Scenario 2

Page 1 of 21

Simulator Setup:

- A. Initialization
 - 1. Log off all simulator PDS and SPDS computers (PDS and SPDS must come up after the simulator load for proper operation).
 - 2. Startup the simulator using Simulator Instructor's Job Aid section 6.3.

Note: **Prior to running the Schedule File, ensure no Event Files are Open.** If an existing Event File is Open prior to running the Schedule File, then any associated Event Files will not automatically load.

3. Open Schedule.exe and Director.exe by clicking on the Icon in the Thunder Bar.




- 4. Set the Simulator to IC-33 and perform switch check (Using Quick Reset in Director).
- Click on "Open" in the Schedule window and Open Schedule File "2011 NRC Scenario 2.sch" (in the Schedule Directory)

~				100 C C C C C C C C C C C C C C C C C C	
Open	Save	Delete 9			00:00:00[00]
ause	@Time	Event	Action	Description	
				<u>Open Save Delete Stopped</u>	

6. In Schedule window, click on the **"Stopped**" red block. The red block will change to a green arrow and indicate the scenario is active ("**Running**").

7. Click the Summary tab in the Director window. Verify the schedule files are loaded and opened per Section B below. (Note: Any actions in the schedule file without a specific time will not load into the director until triggered.)

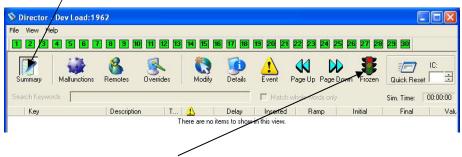

- 8. Take the simulator out of freeze.
- 9. Log on to all simulator PDS and SPDS computers.
- 10. Verify or perform the following:
 - IC-33
 - SSW "A" started normally.
 - After SSW "A" is running, trigger event 30 to setup malfunction p41f005a_c (thermal ol/49 device)
 - APRM "F" is bypassed and caution tagged
 - APRM's are turned on (4,1,2,3)
 - Ensure the correct rod movement sequence available at the P680.
 - Advance all chart recorders and ensure all pens inking properly.
 - Clear any graphs and trends off of SPDS.
- 11. Run through any alarms and ensure alarms are on. (Note: On T-Rex, to verify alarms are ON, the indicator will indicate "Alarms On").
- 12. Place the simulator in Freeze.
- B. File loaded verification:

Form ES-D-2

Scenario 2

Page 3 of 21

2	<u>O</u> pen	Save	Delete (Stopped	00:00:00
rt	Pause	@Time	Event	Action	Description
	Γ			^NRC EXAM GGN 2011 Senario 2	
1	<u> </u>			^RPS A MG EPA breaker S003A Trip	
-	1	00:00:00		Create event 1 xcr4c51na051 > 90.0	RPS MG Set A Failure
	-		1	Insert malfunction c71077a on event 1	RPS MG Set A Failure
-	-			^APRM D fails upscale	
	Γ		2	Insert malfunction c51009d on event 2	APRM Channel D Full-scale
li .					
				^Fuel cladding leak	
			3	Insert malfunction rr071 to 0.1000 on event 3	Fuel Cladding Leak
_		00:00:00		create event 4 xcr4b33k612 < 68.5	
-	<u> </u>	1	4	Insert malfunction rr071 to 2,00000 in 430 on event 4	Fuel Cladding Leak
-	-			^Scram Actions	
-	Γ	00:00:00		create event 5 zdi1(645) = 1	Mode Sw to SD
	Γ		5	Insert malfunction p680_2a_e_9 after 15 to ON on event 5	CNDSR HTWL LVL LO
			5	Insert malfunction fw115a after 15 on event 5	Condensate Pump A Trip
			5	Insert malfunction fw115b after 15 on event 5	Condensate Pump B Trip
1			5	Insert malfunction fw115c after 15 on event 5	Condensate Pump C Trip
_	<u></u>		5	Insert malfunction rrd21k648a_d to 55.00000 in 330 on event 5	override (variable failure) drywell hi-range
_	<u> </u>		5	Insert malfunction rrd21k648b_d to 5,30000 in 300 on event 5	override (variable failure) ontmt hi-range
	-		5	Insert malfunction rrd21k648c_d to 5.20000 in 300 on event 5 Insert malfunction rrd21k648d_d to 55.00000 in 330 on event 5	override (variable failure) cntmt hi-range override (variable failure) drywell hi-range
-	<u> </u>				overhae (valiable railare) a yweir in range
	Ē		1	^RCIC, CTMT, DW and SBGT Rad Hi	
Ť.		00:00:00		create event 6 e51vf045 > 0.75	E51-F045 open
			6	Insert malfunction rrd21k603_d in 240 on event 6	override (variable failure) rcic room acty
_			6	Insert malfunction rrd21k613_d after 30 in 500 on event 6	override (variable failure) sgts filter train
_					
_			6	^RCIC steam leak Insert malfunction e51050 to 40.00000 on event 6	DCTC Stoom Look (VAD) Lingtroom of EE1 E04E
_	<u> </u>		0	Insert mairunction estoso to 40.00000 on event 6	RCIC Steam Leak (VAR) Upstream of E51-F045
_	È			^E51F064 Failure to look like motor pinion key failure	
	Ē	00:00:00		create event 7 zlo4(643) < 1	E51-F063 red light off
			7	Insert override LO_1E51M610_G to TRUE on event 7	P601/21C STM SPLY OUTBD ISOLATION:E51-F064 - DF
			7	Insert override LO_1E51M610_R to TRUE on event 7	P601/21C RCIC STM SPLY OUTBD ISOLATION:E51-F064 - DF
			7	Insert override LO_1E51F064_G to TRUE on event 7	P858 SE) F064 - GREEN
_			7	Insert override LO_1E51F064_R to TRUE on event 7	P858 N) F064 - RED
_			7	Insert malfunction e51187b on event 7	E51F064 POWER LOSS ON STROKE SIGNAL
_			7	Set e51vf064 = 0.5 on event 7	
-				^MSL Rad Monitor Alarms	
			5	Insert malfunction rm157a to 40.00000 in 300 on event 5	PRM Main Steam Line D17K610A-D High Radiation
				^Clear MSL Rad Monitors after MSL Isolation	
		00:00:00		create event 8 zlo4(836) == 0	
_			8	Insert malfunction rm157a after 30 to 15.00000 in 120 on event 8	PRM Main Steam Line D17K610A-D High Radiation
_				ARadining Sconsvin Malfrendier	
_		00:00:00		^Begining Scenario Malfunctions Insert malfunction e51187a	E51F063 POWER LOSS ON STROKE SIGNAL
		00:00:00		Insert malfunction c51010f	APRM Channel F Downscale
	Ĺ –	00:00:00		Insert malfunction e51043	RCIC Auto Start Failure
		00:00:00		Insert override DI_1E51M625D to NORM	P601/21B RCIC MAN INIT DEPRS
		00:00:00		create event 29 et_array(30) == 1 & zlo3(596) == 1	
			29	Insert malfunction p41f005a_c after 10 on event 29	override (thermal ol/49 device)
				ш	

Required Operator Actions

Form ES-D-2

Scenario 2

Page 4 of 21

Director - De	v Load:1962								×
<u>File V</u> iew <u>H</u> elp									
1234	56789	10 11 12 13	14 15 1	6 17 18	19 20 21	22 23 24 25	26 27 28	29 30	
Summary Malfu	inctions Remotes	S Overrides	Nodify	Jo Details	<u> </u>	ye Up Page Down	Frozen Q	IC: uick Reset	÷
earch Keywords 🛛 🗍					🗖 Match who	le words only	Sin	n. Time: 00:00:	00
Key	Description		T	Delay	Inserted	Ramp	Final	Value	1
e51187a	E51F063 POWER	LOSS ON STR	-	00:00:00		00:00:00	Active	InActive	
c51010f	APRM Channel F	Downscale		00:00:00		00:00:00	Active	InActive	
e51043	RCIC Auto Start F	ailure	W	00:00:00		00:00:00	Active	InActive	
DI_1E5	P601/21B RCIC M	IAN INIT DEPRS	-	00:00:00		00:00:00	NORM	NORM	
4									
									E

Scenario 2

Page 5 of 21

Crew Turnover:

A. Assign the candidates crew positions.

B. Turnover the following conditions:

Power	85%
Pressure	1010 psig
BOC	
EOOS	GREEN

- A reactor startup is in progress with all steps complete up to step 6.8, Attachment II of 03-1-01-2 (Power Ascension from 60% to full power)
- SSW "A" is in service.
- APRM "F" has failed downscale and is in BYPASS (a tracking LCO was written).
- Note that an independent Reactivity Management SRO per Operations Philosophy 6.8.1.b will not be provided for this scenario.

Planned Evolutions this shift:

- Place SSW "A" in STANDBY using 04-1-01-P41-1 SSW SOI.
- Once SSW "A" is in STANDBY, continue with plant startup and raise reactor power to 100%. Ramp rates are not required until reactor power reaches 95%.
- C. Allow the crew to perform pre-shift brief and review procedures for planned evolutions.
- D. Bring the crew into the Simulator, place the simulator is in RUN.
- E. Allow the crew to walk down panels.
- F. When the crew assumes the shift begin Scenario Activities.

Scenario 2

Page 6 of 21

SCENARIO ACTIVITIES:

A. Start SBT report and any other required recording devices (Video recording not allowed for NRC exams).

Place SSW "A" in STANDBY

- B. The crew will place SSW "A" in STANDBY.
 - 1. When the operator attempts to close P41-F005A, it will not shut due to tripped thermal device.
 - 2. If directed by the control room to manually shut P41-F005A, wait 3 minutes and report that the valve is stuck and the motor is hot to the touch.
 - 3. If asked to check the breaker, report that the breaker is tripped and you will submit a work request to further determine the cause.
 - 4. When the lead evaluator is satisfied with the crew response, call the CRS (2374) and prompt the crew to go ahead and raise power.

Raise reactor power to 100%:

- C. The crew will raise reactor power to 100% using FCVs.
 - 1. No operations outside the control room are required.
 - 2. When APRM "A" reaches 90% power, RPS "A" MG will Trip (Auto Event 1).

<u>RPS</u> "A" MG set failure

- D. The crew will enter the Loss of One or Both RPS Buses ONEP and:
 - 1. Re-energize RPS "A" by placing the MG Set "A" transfer switch to Alternate "A".
 - 2. Reset the Half-Scram
 - 3. Ensure MSIVs are open.
 - a. When the BOP comes to the booth and asks the status of the pilot solenoids amperage on the back panels, reply that all MSIVs indicate normally.
- E. When asked to investigate the cause of the bus trip, when the half-scram is reset, inform the control room that:
 - 1. the RPS "A" MG EPA breaker C71S003A and C71S003C (located on the Control Building, 189' el.) are tripped and the undervoltage flags are tripped. The motor-generator is operating normally.

Page 7 of 21

Scenario 2

2. you have also noted that the <u>alternate feeder</u> EPA breaker C71S003G underfrequency flag is tripped, but the breaker is still closed (**ensure that the CRS understands that this is the breaker currently powering the RPS "A" Bus**).

APRM "D" fails upscale

- F. When the CRS enters LCO 3.3.8.2 Condition "A," insert malfunction c51009d by triggering **Event 2** to cause APRM "D" to fail full scale.
 - 1. Since APRM "F" is already in bypass, no operator action is required for this situation; however, the CRS may opt to place APRM "F" in service and bypass APRM "D" in order to clear the Half-Scram.
 - 2. When the CRS enters LCO 3.3.1.1 Condition "A," insert malfunction rr071 by triggering **Event 3** to insert a Fuel Cladding Leak.

Fuel Cladding Leak

- G. When the OG PRE-TREAT RAD HI annunciator alarms, the crew will enter the Off-Gas Activity High ONEP.
 - 1. If asked as RP to report local Pre-treat rad levels, report them as above normal and trending up.
 - 2. Prior to Pre-treat radiation levels reaching 1,400 mR/hr, the CRS will direct the ACRO to lower core flow to 67 mlbm/hr.
 - 3. When core flow is below 68.5 mlbm/hr, Auto Event 4 will trigger causing the Fuel Cladding Leak to worsen.
 - a. The crew will enter the Reduction in Recirc Flow ONEP and the ACRO will become the THI watch with concurrent duties.
 - 4. When the crew determines that Pre-treat radiation levels cannot be maintained below 14,000 mR/hr, the crew will manually scram the reactor and enter the Reactor Scram and Turbine Trip ONEPs and EP-2. **Insert EP Attachments as directed** by the Control Room.
 - 5. 15 seconds after the scram Auto Event 5 will trigger causing Condensate Pumps to trip on low condenser level (due to failed trip unit, this is unrecoverable)
 - 6. 2 minutes after the scram, MSL RAD HI annunciator will alarm and the CRS will enter EP-4.
 - 7. 4 ¹/₂ minutes after the scram, MSL A-D HI-HI annunciators will alarm. The CRS will direct the BOP operator to close all MSIVs per EP-4 step 1.

NKC

NKC

Scenario 2

Unisolable steam leak RCIC room/RCIC fail to start on initiation

- H. After all MSIVs are closed the CRS will direct the ACRO/BOP operator to control reactor level using RCIC and HPCS.
 - 1. The CRS should establish a reactor pressure band of 800-1060 psig using ADS/SRV valves and a reactor level band of +30" to -30".
 - 2. Once the operating feed pump trips, RCIC will fail to initiate (when started by the operator or on low level). The operator must manually line up RCIC.
- I. When E51-F045 opens, an unisolable steam leak will occur in the RCIC room.
 - 1. The crew will receive RCIC room high temperature and radiation alarms. The E51-F063 and E51-F064 will fail to close (loss of power, motor pinion key failed respectively).
 - 2. The crew should enter the reduced pressure band 450-600 psig to reduce driving head of the steam leak.
 - 3. Five minutes after RCIC is started, report to the control room as Security that there is a plume of steam coming from the Auxiliary Building Roof.
 - 4. When 2 max safe values (Rad levels) from EP-4 Table 10 are reached, the crew will enter the emergency depressurization procedure of EP-2.

Termination:

- J. Once emergency depressurization has been conducted and reactor water level is stabilized above TAF, or as directed by Lead Evaluator:
 - Take the simulator to Freeze and turn horns off.
 - Stop and save the SBT report and any other recording devices.
 - Instruct the crew to not erase any markings or talk about the scenario until after follow-up questions are asked.

Scenario 2

Page 9 of 21

Critical Tasks:

- Fuel failure is occurring and main steam line radiation is greater than 3 times normal full power background as indicated by MSL B / MSL C RAD HI-HI or MSL A / MSL D RAD HI-Hi alarms, the crew closes MSIVs and MSL drains per EP-4. The crew closes the MSIVs and MSL drains and observes valve position indications and lowering pressure trend downstream of the MSIVs. Criterion is to give the highest priority to close the four inboard MSIVs or the four outboard MSIVs and MSL drains when MSL radiation is greater than 3 times normal full power background.
- A primary system is discharging outside primary containment and area temperatures, radiation levels, or water levels are above their max safe values in two or more areas. The crew opens 8 ADS/SRVs and observes lowering pressure trend and valve position indications (tailpipe pressure indication lamps or solenoid valve energized). Criterion is to give the highest priority to open at least seven SRVs when area temperatures, radiation levels, or water levels are above their maximum safe values in two or more areas.

Emergency Classification:

Site Area Emergency FS1

Scenario 2

Page 10 of 21

Op-Test No	o: <u>12/11</u>	Scenario No: _2 Event No: _1
Event Desc	ription: Plac	ee SSW "A" in Standby
TIME	Position	Applicant's Actions or Behavior
	CRS	Directs the BOP operator to place SSW "A" in standby.
	ВОР	 Places SSW "A" in Standby using SOI 04-1-01-P41-1 section 4.6: Verifies all prerequisites are met N/A's steps 4.6.2a – 4.6.2h. Places the SSW "A" MOV test switch to TEST Open/check open P41-F006A. Close P41-F005A – P41-F005A will fail to close As indicated by annunciator P870-1A-C2, SSW DIV 1 OOSVC SSW D1 MOV OVERLD PWR LOSS status light turns on The operator refers to ARI for P870-1A-C2 and: Does not proceed with securing SSW and report that P41-F005 lost power and is still open. At this point, if the crew chooses to stop the SSW pump they will cause the SSW head tank to drain. Look in Attachment IIIA of 04-1-01-P41-1 and determine breaker number for P41-F005A (52-155112). Direct the local operator to the breaker for P41-F005A on 15B51to determine the cause of loss of power. Using ARI and control room indications, determine that the valve's breaker has tripped on overload. As indicated by the SSW D1 MOV OVERLD PWR LOSS status light lit and the valve positions indicating lights for P41-F005A on the P870 are still lit.
	CRS	Ensure an operator and/or electrical maintenance is dispatched to investigate the problem. The CRS should opt to leave SSW A running. In order to secure SSW A, P41-F005A would have to be manually closed. Without power to the valve, SSW A would have to be declared INOPERABLE. If the CRS declares SSW A INOPERABLE, enters TS 3.5.1 Condition A.

Scenario 2

Page 11 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 2	Event No: <u>2</u>
Event Desc	ription: <u>Rai</u> s	se reactor power using Recirc Flow Control	
TIME	Position	Applicant's Actions or Behavior	
	CRS	Conducts reactivity brief for the planned power change. (May be perf taking the shift) Directs the ACRO to raise reactor power to 100% using Recirc FCV'	•
	ACRO	Raises power by opening the Recirc FCVs A & B using loop flow cor B33K603A & B in slow detent on P680-3B (IOI-2 attachment VIII st	
	ВОР	Raises Load Demand as power is raised by depressing EHC LOAD R RAISE pushbutton (P680-9C) to maintain generator actual load withi the load demand limited value during power ascension (IOI-2 attachn 12.2).	n +/- 25 MW of

Scenario 2

Page 12 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 2 Event No: 3				
Event Desc	Event Description: <u>RPS</u> "<u>A</u>" <u>MG failure</u>					
TIME	Position	Applicant's Actions or Behavior				
		Recognizes and reports a half-scram with no additional annunciators and a trip of the RPS bus has occurred.				
	ACRO	• As indicated by annunciator P680-7A-A-2, RX SCRAM TRIP coupled with a ¹ / ₂ scram and no other indications for why the ¹ / ₂ scram occurred.				
		• The GENERATOR A NORMAL FEED AVAILABLE light is out on the back panel.				
		Enters the Loss of One or Both RPS Buses ONEP.				
	CRS	Direct the BOP to re-energize the A RPS bus using the alternate power source.				
	CKS	Direct the ACRO to reset the half-scram.				
		Send a local operator to investigate the cause of the RPS A MG failure.				
		When directed, Re-energize the A RPS Bus using the Alternate power source.				
	BOP	• Place the MG SET A TRANSFER switch on the CONTROL ROD TEST INSTRUMENT PANEL (P610) to ALT "A"				
		When directed, reset the half-scram.				
	ACRO	• Place the division 1 scram RESET switches to RESET on the P680.				
	CRS	Direct the BOP to ensure all MSIVs are energized.				
		When directed, ensure all MSIV solenoid lights are on and all MSIV pilot solenoids indicate amperage on the P622 and P623 panels.				
	ВОР	(This is not modeled in the simulator. The operator should go to the instructor booth behind the P807 and simulate performance by stating to the instructor his intentions to perform the step. The instructor will provide the operator with a verbal cue concerning indications the operator observes).				

Scenario 2

Page 13 of 21

Op-Test N	o: <u>12/11</u>	Scenario No: 2	Event No: <u>4</u>		
Event Description: Electric Power Monitoring Assembly INOPERABLE					
TIME	Position	Applicant's Actions or Behavior			
		Recognizes entry conditions and enters TS 3.3.8.2 Condition A.			
		There are no indications in the control room for the EPM however, the following report will be made to the control When asked to investigate the cause of the bus trip, w	l room:		
	CRS	reset, inform the control room that:	nen me nag-scram is		
	Citis	1. the RPS "A" MG EPA breaker C71S003A (locat Building, 189' el.) is tripped and the undervoltag			
		2. you have also noted that the <u>alternate feeder</u> EPA underfrequency flag is tripped, but the breaker is that the CRS understands that this is the breaker the RPS "A" Bus).	still closed (ensure		

Scenario 2

Page 14 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 2 Event No: 5
Event Desc	ription: <u>Two</u>	APRM channel failures
TIME	Position	Applicant's Actions or Behavior
	ACRO	 Recognizes and reports APRM D has failed upscale. As indicated by annunciators P680-7A-A-2, RX SCRAM TRIP, and P680-7A-B-3, NEUTRON MON SYS TRIP APRM Ch-D will be "pegged" high and will have the UPSC ALM light on. This will also cause a ½ scram.
	CRS	Recognizes entry conditions and enters TS 3.3.1.1 Condition A and TRM 3.1.5 Conditions A & B. The CRS may opt to un-bypass APRM F (failed downscale) in order to bypass APRM D (failed upscale) so that the ½ scram can be cleared. If so, the CRS will: -Direct the ACRO to un-bypass APRM F and bypass APRM D. -Direct the ACRO to reset the ½ scram.
	ACRO	If directed, Move Division 2 APRM bypass switch from CH-F to CH-D. Reset the ¹ / ₂ scram by momentarily placing the RPS DIV 2 and RPS DIV 4 SCRAM RESET switches to reset and observing that all 8 SCRAM SOL VLV lights are lit. Report completed actions to the CRS.

Scenario 2

Page 15 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 2 Event No: 6
Event Desc	ription: <u>Fue</u> l	Cladding Leak
TIME	Position	Applicant's Actions or Behavior
	ВОР	Recognizes and reports to the CRS when the OG PRE-TREAT RAD HI annunciator alarms. Directs the CRS to the Off-Gas Activity High ONEP per the OG PRE-TREAT RAD HI ARI.
	CRS	Enters the Off-Gas Activity High ONEP. Establish Off-Gas Pre-Treat Radiation Level as a critical parameter.
	ACRO / BOP	Monitor Off-Gas Pre-Treat Radiation Level. Report Off-Gas Pre-Treat Radiation Levels as directed by the CRS.
	CRS	When the CRS anticipates exceeding the limits of step 3.1 Pre-Treatment Monitor Limit (700mR/hr), directs the ACRO to lower core flow to 67 mlbm/hr in fast detent.
	ACRO	Lower core flow to 67 mlbm/hr using Recirc "A" and "B" FCV flow controllers in fast detent when directed by the CRS.
	CRS	Enters the Reduction in Recirculation Flow Rate ONEP. Ensures THI watch with concurrent duties is established.
	ACRO	Plot the power to flow map. Recognize and report to the CRS entry into the Monitored Region as determined by the power to flow map plot. Establish THI watch with concurrent duties.
	CRS	 Perform subsequent actions of the Off-Gas Activity High ONEP. Consult with the Reactor Engineer or Duty Manager for further power reductions. Activate the Emergency Plan when limits of step 3.3 are exceeded. Notify Chemistry to monitor ventilation release points.
	CRS	When the CRS determines that Off-Gas Pre-Treat Radiation Levels cannot be maintained below 14,000 mR/hr, direct the ACRO to scram the reactor. Enter the Scram ONEP, Turbine/Generator Trip ONEP, EP-2

Required Operator Actions

Form ES-D-2

Scenario 2

Page 16 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 2	Event No: <u>6 cont.</u>
Event Desc	ription: <u>Fuel</u>	l Cladding Leak	
TIME	Position	Applicant's Actions or Beha	avior
	ACRO	 Places the Reactor Mode Switch to SHUTDOWN when Provides a scram report: Reactor Mode SW in SHUTDOWN. Reactor power is 0%. Reactor water level and trend. Reactor pressure and trend. Feedwater is NOT available. Bypass valves are available. 	n directed by the CRS.
	ACRO / BOP	Start RCIC by arming and depressing the RCIC initiation to start; see event 7 on page 17).	on push button (RCIC will fail
	ВОР	Recognizes and reports EP-4 entry condition when MSI on P601-19A-D4.	L RAD HI annunciator alarms
	CRS	Enters EP-4 when any entry condition is met.	

Required Operator Actions

Form ES-D-2

Scenario 2

Page 17 of 21

Op-Test No	o: <u>12/11</u>	Scenario No: <u>2</u> Event No: <u>6 cont.</u>
Event Desc	ription: <u>Fue</u> l	Cladding Leak
	ACRO / BOP	Recognize and report when MSL A-D HI-HI radiation annunciators alarm. Close all MSIVs (per EP-4 step 1).
	CRS	 When MSL A-D HI-HI radiation annunciators alarm, direct the ACRO/BOP to close all MSIVs. *Fuel failure is occurring and main steam line radiation is greater than 3 times normal full power background as indicated by MSL B / MSL C RAD HI-HI or MSL A / MSL D RAD HI-Hi alarms, the crew closes MSIVs and MSL drains per EP-4. The crew closes the MSIVs and MSL drains and observes valve position indications and lowering pressure trend downstream of the MSIVs. Criterion is to give the highest priority to close the four inboard MSIVs or the four outboard MSIVs and MSL drains when MSL radiation is greater than 3 times normal full power background. Establish reactor pressure band of 800 – 1060 psig using ADS/SRV valves. Establish reactor level band of +30" to -30" using Feed and Condensate system (this band is established per Ops Philosophy Level Band Strategies since reactor pressure is now being controlled with ADS/SRV's).
	BOP	Maintain pressure band of 800 – 1060 psig using ADS/SRV valves (cycle open and closed as required to stay within band).
	ACRO	Maintain level band of +30" to -30" using HPCS (May use the Startup Level Controller in Auto or Manual).

Scenario 2

Page 18 of 21

Op-Test No	p: <u>12/11</u>	Scenario No: 2 Event No: 7			
Event Desc	ription: <u>RC</u>	IC fails to start on initiation			
TIME	Position	Applicant's Actions or Behavior			
	ACRO / BOP	 Recognizes that RCIC does not start when manually initiated using Initiate push button. As indicated when nothing happens after the Initiate PB is depressed. Manually starts RCIC using SOI 04-1-01-E51-1 Attachment VI. Shift RCIC Flo controller to manual and reduce output to minimum. Open E51-F046. Start Gland Seal Compressor. Open E51-F095. After 6 seconds, Open E51-F045. Raise turbine speed using flow controller in manual to develop pressure greater than reactor pressure. Open E51-F013. Adjust flow as necessary with Flo controller. Verify SSW A is running with adequate flow path. 			

Required Operator Actions

Form ES-D-2

Scenario 2

Page 19 of 21

Op-Test No	o: <u>12/11</u>	Scenario No: <u>2</u> Event No: <u>8</u>				
Event Desc	ription: <u>RCI</u>	IC room unisolable steam leak				
TIME	Position	Applicant's Actions or Behavior				
	ACRO / BOP	 Recognize and report unisolable steam leak in the RCIC room after RCIC is initiated. As indicated by annunciators P601-21A-G-3, RCIC EQUIP AREA TEMP HI, P601-21A-H-2, RCIC PIPE/EQUIP AMBIENT TEMP HI, and P601-21A-H-3, RCIC EQUIP AREA dT HI. E51-F063 loss of power and E51-F064 will not close. RCIC room temperature remains high. 				
	CRS	Enter EP-4 at 22 (will be on step 10 until 2 max safe values are reached). Direct the BOP to monitor EP-4 parameters.				
	BOP	Monitor EP-4 parameters using EP-4 table 3.Monitor for 2 Max Safe values				
	CRS	Establish a reduced pressure band of 450 – 600 psig to reduce the driving head of the steam leak in accordance with the Ops Philosophy Pressure Control Strategy. Establish a level band of +30" to -30" in accordance with Ops Philosophy Level Control Strategy.				
	BOP	Control reactor pressure in the 450 – 600 psig band using ADS/SRV valves when directed.				
	ACRO	Manually initiate HPCS to maintain reactor water level within the established band by arming and depressing the HPCS initiation pushbutton.				

Required Operator Actions

Form ES-D-2

Scenario 2

Page 20 of 21

Op-Test No	: 12/11	Scenario No: 2_	Event No: <u>8 cont</u>
Event Descr	ription: <u>RCI</u>	IC room unisolable steam leak	
	BOP / ACRO	Recognize and report to the CRS when 2 max save values of exceeded.	of EP-4 Table 10 are
		When 2 max save values of EP-4 Table 10 are exceeded, er Depressurization procedure of EP-2.	nters the Emergency
	CRS	*A primary system is discharging outside primary co temperatures, radiation levels, or water levels are ab in two or more areas. The crew opens 8 ADS/SRVs a pressure trend and valve position indications (tailpip lamps or solenoid valve energized). Criterion is to giv open at least seven SRVs when area temperatures, ra levels are above their maximum safe values in two or	ove their max safe values and observes lowering e pressure indication ve the highest priority to adiation levels, or water
		 ◆ The Two Max Safe values for this scenario are: - SGTS Rad levels of 800 mr/hr (≥8 x10² mr/hr) - RCIC Room Rad levels of 80,000 mr/hr (≥8 x)
		Verify SP level is above 10.5 ft.Direct the BOP operator to open 8 ADS valves.	
	BOP	Opens at least 7 ADS valves when directed by the CRS.	
	ACRO	Maintain reactor level band of +30" to -30" following Eme (The CRS may establish a level band of 11.4" to 53.5")	rgency Depressurization.

Scenario 2

Page 21 of 21

Give this page to the CRS

Turnover the following conditions:

Power	85%
Pressure	1010 psig
BOC	
EOOS	GREEN

- A reactor startup is in progress with all steps complete up to step 6.8, Attachment II of 03-1-01-2 (Power Ascension from 60% to full power)
- SSW "A" is in service.
- APRM "F" has failed downscale and is in BYPASS (a tracking LCO was written).
- Note that an independent Reactivity Management SRO per Operations Philosophy 6.8.1.b will not be provided for this scenario.

Planned Evolutions this shift:

- Place SSW "A" in STANDBY using 04-1-01-P41-1 SSW SOI.
- Once SSW "A" is in STANDBY, continue with plant startup and raise reactor power to 100%. Ramp rates are not required until reactor power reaches 95%.

Required Operator Actions

Form ES-D-2

Scen	ario	4

Page 1 of 3

Facility: Grand Gulf Nuclear Station Scenario No.: 4 Op-Test No.: 12/11
Examiners: Operators:
Objectives: To evaluate the candidates' ability to operate the facility in response to the
following evolutions: 1. Place Suppression Pool Cooling in service.
2. Condensate Booster Pump Trip.
 Trip of the 16BB3 electric bus. Control Rod drift.
5. Second Control Rod drift.
 Unisolable LOCA with limited injection capabilities. Division 3 Diesel Generator failure to start.
 Bivision 2 Diesel Generator running without cooling water.
9. Loss of power to E22-F004 HPCS injection valve.
Initial Conditions: Operating at 100% power.
Inoperable Equipment: None
Turnover:
A plant is operating at rated power. Suppression Pool temperature is elevated due to a weeping SRV. The Crew will start Suppression Pool Cooling on RHR B using the 04-1-01-E12-1 RHR system SOI.
Scenario Notes:
This is a new scenario.
Validation Time: 55 min

Required Operator Actions

Form ES-D-2

Scenario 4

Page 2 of 3

Event No.	Malf. No.	Event Type [†]	Event Description	
1		N (BOP) TS (CRS)	Place Suppression Pool Cooling in Service (SOI 04-1-01-E12-1 section 5.2, TS 3.5.1 Condition A)	
2	fw118a	C (ACRO) A (Crew)	Condensate Booster Pump Trip (ARI P680-1A-A4, Feedwater System Malfunctions ONEP (05-1-02-V-7))	
3	r21142z	TS (CRS) A (CREW)	Trip of the 16BB3 electric bus (480V LCC 16BB3 UNDERVOLT ARI (04-1-02-1H13-P864-2A-E3), TS 3.6.1.3 Condition A, TS 3.5.1 Condition C, TS 3.6.4.3 Condition A, TS 3.6.3.2 Condition A)	
4	z161161_24_33 z022022_24_33	R (ACRO)	Control Rod Drift (Control Rod/Drive Malfunctions (05-1-02-IV-1) ONEP)	
5	z021021_28_33	M (CREW)	Second Control Rod Drift (Control Rod/Drive Malfunctions (05-1-02-IV-1) ONEP)	
6	rr063a r21139e xml1r21191 xml1r21192 e12050c	M (Crew)	 Unisolable LOCA with limited injection capabilities (Scram (05-1-02-I-1) and Turbine Trip (05-1-02-I-2) ONEPs, EP-2, EP-3) * The crew injects HPCS to the reactor before reactor water level lowers to -191". 	
7	n41140c	C (BOP)	 Division 3 Diesel Generator failure to start (Loss of AC Power (05-1-02-I-4) ONEP) * When Division 3 Diesel Generator fails to start, the crew reenergizes the 17AC bus with an alternate feeder (ESF 12). HPCS is the only recoverable system and power to this bus is required to run the HPCS pump. 	

Form ES-D-2

Scenario 4

Page 3 of 3


8	p41f018b_i	C (BOP)	Division 2 Diesel Generator running without cooling water (02-S-01-27 Ops Philosophy section 6.1.1.c)		
				wer to E22-F004 HPCS injection valve (02-S-0 section 6.1.1.d)	1-27 Ops
9	e22159a	C (ACRO)	manual system a allow in	22-F004 loses power, the crew sends an open ly open the valve. HPCS is the only recovera and this valve must be manually opened in o jection to the reactor. Criteria is that this va prior to reactor water level reaching -191".	ble rder to
+	(N)ormal, (R)eac	tivitv. (I)nstrun	nent. (C)orr	nponent, (M)ajor, (A)bnormal (TS) Tech S	Spec
*	Critical Task (As				
				ttributes Table	
Normal Events			1	Abnormal Events	2
Reactivity Manipulations			1	Total Malfunctions	8
	nt/Component Failu	ures	4	EP Entries (Requiring substantive action) 1	
Major Tra			2	EP Contingencies 1	
Tech Spe			2	Critical Tasks	3

Scenario 4

Page 1 of 19

Simulator Setup:

- A. Initialization
 - 1. Log off all simulator PDS and SPDS computers (PDS and SPDS must come up after the simulator load for proper operation).
 - 2. Startup the simulator using Simulator Instructor's Job Aid section 6.3.

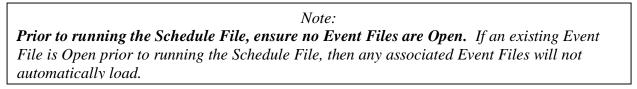

3. Open Schedule.exe and Director.exe by clicking on the Icon in the Thunder Bar.




- 4. Set the Simulator to IC-31 and perform switch check (Using Quick Reset in Director).
- Click on "Open" in the Schedule window and Open Schedule File "2011 NRC Scenario 4.sch" (in the Schedule Directory)

	t View	Help				
New	<u>O</u> pen	<mark>⊘</mark> Save	Delete S	Gtopped		00:00:00[00]
Insert	Pause	@Time	Event	Action	Description	<u>^</u>

6. In Schedule window, click on the **"Stopped**" red block. The red block will change to a green arrow and indicate the scenario is active ("**Running**").

7. Click the Summary tab in the Director window. Verify the schedule files are loaded and opened per Section B below. (Note: Any actions in the schedule file without a specific time will not load into the director until triggered.)

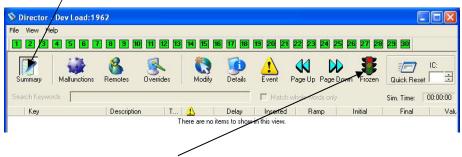

- 8. Take the simulator out of freeze.
- 9. Log on to all simulator PDS and SPDS computers.
- 10. Verify or perform the following:
 - IC-31
 - APRM's are turned on (4,1,2,3)
 - Suppression Pool Temperature is 85.6F
 - Startup SSW B normally
 - Ensure the correct rod movement sequence available at the P680.
 - Advance all chart recorders and ensure all pens inking properly.
 - Clear any graphs and trends off of SPDS.
- 11. Run through any alarms and ensure alarms are on. (Note: On T-Rex, to verify alarms are ON, the indicator will indicate "Alarms On").
- 12. Place the simulator in Freeze.

Scenario 4

Page 3 of 19

B. File loaded verification:

New	<u>0</u> pen	Save [elete F	Running Frozen	00:00:00
-		t anna	- Pierre -		
isert	Pause	@Time	Event	Action	Description
				^NRC EXAM GGN 2011 Senario 4	
-				2 2 (1995) 201 (197 79 197 79 1979)	
				^Condensate Booster Pump A Trip	
			1	Insert malfunction fw118a on event 1	Condensate Booster Pump A Trip
_			1	Insert override AO_1N21R611A to 330 in 180 on event 1	P680/02D RFP A : SUCT PRESS
			1	Insert override AO_1N21R611B to 333 in 180 on event 1	P680/02D RFP B : SUCT PRESS
~		00:00:00		create event 2 xcr4c51j807a_c88 < 95	power less than 95%
	1		2	Modify override AO_1N21R611A to 385 in 120 on event 2 delete in 10	P680/02D RFP A : SUCT PRESS
			2	Modify override AO_1N21R611B to 385 in 120 on event 2 delete in 10	P680/02D RFP B : SUCT PRESS
				^16BB3 bus trip on overcurrent	
			3	Insert malfunction r21142z	480 V Bus 16BB3 Overcurrent Trip
				^Rod Drift 24-33-FH	
			4	Insert malfunction z161161_24_33	Control Rod 24-33 Drift Out
~	_	00:00:00		create event 5 c11rpos(181) < 1800	
			5	Insert malfunction z022022_24_33	Control Rod 24-33 Stuck
			5	Insert malfunction z021021_28_33 after 240	Control Rod 28-33 Drift In
				^15AA overcurrent trip / General electrical mayhem	
~		00:00:00		create event 6 CRRODDENSITY > 90	
1	Г		6	Insert malfunction r21139e after 5	4160 V Bus 15AA Overcurrent Trip
			6	Insert malfunction n41140c	Emergency Diesel Generator C Fail to Start
	Γ		6	set xml1r21191 == true	Kill BW
	Γ		6	set xml1r21192 == true	Kill Franklin
			6	Insert malfunction e12050c	RHR PUMP C TRIP
	Γ		6	Insert malfunction e22159a to 0	MOV E22-F004 HPCS Injection Failure
	Γ		6	Delete malfunction z161161_24_33	Control Rod 24-33 Drift Out
	Ē		6	Delete malfunction z022022_24_33	Control Rod 24-33 Stuck
	Ē				
	Í.			^Save the day (HPCS solution)	
	Ê		7	Schedule Operator/Manually_OPEN_E22-F004.sch	
	Ē				
	í –			^LOCA	
_	i-		6	Insert malfunction rr063a after 60 to 2.25 in 210	Recirc Loop A Non-Isolable Suction Rupture
_	<u></u>				Redic 2000 H Non Boldble Bacdon Raptare
_				^Division 2 Diesel to Maint	
-	Ē		8	Insert remote p75058 to MAINT on event 8 delete in 2	DG DIV 2 MAINTENANCE MODE
-	-		9	Insert remote p75057 to MAINT on event 9 delete in 2	DG DIV 2 MAINTENANCE MODE
	<u> </u>		7	anser remote procer to mean of event 9 delete in 2	
-	-			ABegining Scenario Malfunctions	
-	-	00:00:00	-	^Begining Scenario Malfunctions Set xrr1ct101 = 1	
-	-	00:00:00		Set xrr/ct101 = 1 Set xrr/ct100 = 85.57	
-	-	00:00:00			
-		00:00:01		Set xal1ismbutton = 5	
÷	_	00:00:00		Insert malfunction p41f018b_i	override (loss of power when stroke)
1.1	-	00:00:00		Insert override LO_1P41M623B_G to TRUE	P870/07C SSW INL TO DG 12 WTR CLR:P41-F
<u>~</u>	-	00:00:00	_	Set xrr1fw207 = 1	Reset CST level
	1				
<					

Appendix D	Ap	pen	dix	D
------------	----	-----	-----	---

Form ES-D-2

Scenario 4

Page 4 of 19

	- Dev Load:19	167								
jle ⊻iew <u>H</u>										
1 2 3		7 8 9 10	11 12 13	14 15	16 17 18	19 20 21	22 23 24 25	26 27 28	3 29 30	
Summary	Malfunctions	Remotes		Nodify	Details	Event I	Page Up Page D	own Frozen	Quick Rese	IC: t 31 ÷
Search Keyw	vords					🗖 Match v	vhole words only		Sim. Time:	00:00:00
Key	50	Description	T	A	Delay	Inserted	Ramp	Initial	Final	Value
p41f01	18b_i	override (l			00:00:00		00:00:00		Active	InActive
LO_1F	P41M623B_G	P870/07C			00:00:00		00:00:00		TRUE	TRUE
ady										NUM

Scenario 4

Page 5 of 19

Crew Turnover:

- A. Assign the candidates crew positions.
- B. Turnover the following conditions:

Power	100%
Pressure	1030 psig
BOC	
EOOS	GREEN

- SSW B is in service.
- Suppression Pool temperature is elevated because of a weeping SRV.

Planned Evolutions this shift:

- The Crew will place Suppression Pool Cooling in service on RHR B. Pre-start pump checks are complete for RHR B pump.
- C. Allow the crew to perform pre-shift brief and review procedures for planned evolutions.
- D. Bring the crew into the Simulator, place the simulator is in RUN.
- E. Allow the crew to walk down panels.
- F. When the crew assumes the shift begin Scenario Activities.

Scenario 4

Page 6 of 19

NKC

NKC

NKC

SCENARIO ACTIVITIES:

A. Start SBT report and any other required recording devices (Video recording not allowed for NRC exams).

Place Suppression Pool Cooling in service on RHR B

- B. The crew will place Suppression Pool Cooling in service on RHR B using 04-1-01-E12-1.
 - 1. If asked to perform pre-start pump checks, wait 2 minutes and report back to the Control Room that pre-start pump checks are complete.
 - 2. No actions outside the Control Room are required for this evolution.

Condensate Booster Pump "A" Trip

- C. When suppression pool cooling is in service, trigger **Event 1** to insert malfunction fw118a. This will cause the 'A' Condensate Booster Pump to trip (and RFPT suction pressures to lower to 330 psig)
 - 1. The Crew will enter the Feedwater System Malfunctions ONEP and respond per the Condensate Booster Pump "A" ARI.
 - 2. If asked as the local operator to investigate the pump trip, wait 3 minutes and report back to the Control Room that the Pump Breaker is tripped.

Trip of the 16BB3 electric bus

- D. When the Crew lowers reactor power and RFPT suction pressure has returned to normal, trigger **Event 3** to insert malfunction r21142z. This will cause 16BB3 to trip on over current.
 - 1. When directed by the Control Room to investigate breaker 52-16301, wait 2 minutes and report that the breaker has tripped on over current.
 - 2. When the CRS enters TS 3.6.1.3 Condition A, TS 3.5.1 Condition C, and TS 3.6.4.3 Condition A, trigger **Event 4** to insert malfunction z161161_24_33. This will cause control rod 24-33 to drift out.

Control Rod Drift

- E. The CRS will enter the Control Rod/Drive Malfunctions ONEP
 - 1. When control rod 24-33 FH is inserted below position 8 it will become stuck (Auto trigger 5) and core flow will be lowered to 67 mlbm/hr.

- 2. If sent as the Aux Building Operator to isolate rod 24-33 FH by closing the 103 and 105 valve, wait 45 seconds and report that rod 24-33 FH is isolated.
- 3. Four minutes later, control rod 28-33 GH will begin to drift inward (Auto trigger 5). The ACRO will scram the reactor.

Unisolable LOCA with limited injection capabilities

- F. When the reactor is scramed, Auto trigger 6 will cause the following to occur:
 - 1. Electric bus 15AA will trip on over current.
 - a. This bus is not recoverable. When the control room sends an operator and/or an electrician to investigate, report back after 3 minutes that the bus is damaged.
 - b. If directed to place the Division 1 diesel in Maintenance Mode, coordinate with the control room and trigger **Event 9** when directed to place in maintenance mode.
 - 2. Division 3 Diesel Generator will fail to start.
 - 3. The 500KV switchyard will be lost.
 - 4. RHR C pump will trip.
 - a. This pump is not recoverable. When the control room sends an operator and/or an electrician to investigate breaker 152-1609, wait 3 minutes and report the beaker is tripped on thermal device.
 - b. If sent to the pump, report that it is very hot and that the motor casing is discolored.
 - 5. P41-F018B (SSW to Div 2 DG) will lose power on stroke.
 - a. When directed by the control room to place division 2 diesel in MAINT, coordinate with the control room and trigger **Event 8** to place the diesel in MAINT.
 - 6. E22-F004 (HPCS injection valve) will lose power on stroke. This valve CAN be manually opened if an operator is sent to open it.
 - a. When the control room sends an operator to open this valve, wait until RPV water level is -100" wide range, then trigger **Event 7** to manually open E22-F004. Do <u>not</u> report the opening of E22-F004 to the Control Room.
- G. Insert EP Attachments as requested by the Control Room.

Scenario 4

Page 8 of 19

Termination:

- H. When reactor water level is stabilized in the -30 to 30" level band using HPCS, or as directed by Lead Evaluator:
 - Take the simulator to Freeze and turn horns off.
 - Stop and save the SBT report and any other recording devices.
 - Instruct the crew to not erase any markings or talk about the scenario until after follow-up questions are asked.

Critical Tasks:

- When Division 3 Diesel Generator fails to start, the crew re-energizes the 17AC bus with an alternate feeder (ESF 12). HPCS is the only recoverable system and power to this bus is required to run the HPCS pump.
- The crew injects HPCS to the reactor before reactor water level lowers to -191".
- When E22-F004 loses power, the crew sends an operator to manually open the valve. HPCS is the only recoverable system and this valve must be manually opened in order to allow injection to the reactor. Criteria is that this valve is opened prior to reactor water level reaching -191".

Emergency Classification:

SA1 Alert

Form ES-D-2

Scenario 4

Page 9 of 19

Op-Test No	p: <u>12/11</u>	Scenario No: <u>4</u> Event No: <u>1</u>	
Event Desc	ription: Plac	e Suppression Pool Cooling in Service	
TIME	Position Applicant's Actions or Behavior		
	CRS	Directs the BOP operator to place Suppression Pool Cooling "B" in service per SOI 04-1-01-E12-1 section 5.2.2.b.	
	BOP	 Place Suppression Pool Cooling "B" in service using SOI 04-1-01-E12-1 section 5.2.2.b as follows: Place the RHR B MOV TEST switch to TEST Start RHR RM B FAN COIL UNIT on P870 Check open E12-F003B on P601 Start RHR B Pump Open E12-F024B (This step INOPs RHR B, TS 3.5.1) Inform the CRS of the time RHR B is INOP Close E12-F048B (optional, this is to maximize cooling) 	
	CRS	When E12-F024B is opened, Enter TS 3.5.1 Condition A.	

Required Operator Actions

Form ES-D-2

Scenario 4

Page 10 of 19

Op-Test No	o: <u>12/11</u>	Scenario No: <u>4</u> Event No: <u>2</u>
Event Desc	cription: <u>Con</u>	densate Booster Pump Trip
TIME	Position	Applicant's Actions or Behavior
	ACRO	 Recognizes and reports to the CRS that Condensate Booster Pump "A" has tripped As indicated by the P680-1A-A4, CNDS BST PMP A TRIP annunciator. Condensate Booster Pump "A" green indicating light is on and the red indicating light is off. Implement required actions from the CNDS BST PMP A TRIP annunciator ARI. Monitor Feed pump suction pressure as indicated by PI-R611A(B) on P680. Coordinate with CRS to reduce reactor power to maintain Reactor Feed Pump suction pressure > 350 psig. When directed, monitor Condensate Booster Pump suction pressure. If directed, CLOSE N19-F046A (Condensate Booster Pump A discharge valve).
	CRS	 Enters the Feedwater System Malfunctions ONEP and directs the ACRO to monitor Condensate Booster suction pressure to ensure it does not "approach" 200 psig. Ensure actions for the CNDS BST PMP A TRIP annunciator are implemented. Conducts reactivity brief to lower power. (May be performed prior to taking the shift) Directs the ACRO to lower power and the BOP to adjust load demand per IOI-2 attachment VIII. May direct the ACRO to close the discharge valve for Condensate Booster Pump A.
	ACRO	Lowers generator output by closing the Recirc FCVs A & B using loop flow controllers B33K603A & B in slow detent on P680-3B until RFPT suction pressure begins to rise above 350 psig.
	BOP	Lowers Load Demand as generator output is lowered by depressing EHC LOAD REF DEMAND LOWER pushbutton (P680-9C) to maintain generator actual load within +/-25 MW of the load demand limited (IOI-2 attachment VIII step 12.2).

Required Operator Actions

Form ES-D-2

Scenario 4

Page 11 of 19

Op-Test No	p: <u>12/11</u>		Scenario No: 4	Event No: <u>3</u>		
Event Description: Trip of the 16BB3 electric bus						
TIME	Position	Applicant's Actions or Behavior				
	ВОР	 As ind Variou Variou O Check Per the subseque 	report that 16BB3 is de-energized and that breaker 3 licated by annunciator P864-2A-E-3, 480V LCC 161 is Division 2 components will be de-energized inclu E12-F028B, E12-F042B, and E12-F053B SLC Pump B CCW Pump B Div 2 D/G Aux LO Pump (not required for opera SBGT Enclosure Building Recirc Fan The entire load list is in 04-1-01-R21-16, ESF Bu Attachment 1 pages 15-17. actions of ARI for annunciator P864-2A-E-3: 4160V ESF Bus 16AB Voltage (should still be 416 vautomatic actions occur: CCW pump B trips (already in STBY, the STBY light should be off) Enclosure building Recirc fan trips (already off, S Diesel Engine Aux Main LO Pump trips (local in concurrent annunciators that may aid in locating the tent actions of ARI for annunciator P864-2A-E-3:	BB3 UNDERVOLT. ding: bility) Is 16AB SOI, 0V). white indicating SGTS not in service) dication only).		

Required Operator Actions

Form ES-D-2

Scenario 4

Page 12 of 19

Op-Test No	p: <u>12/11</u>	Scenario No: 4 Event No: 3 cont.
Event Desc	ription: <u>Trip</u>	o of the 16BB3 electric bus
TIME	Position	Applicant's Actions or Behavior
		Enters Loss of AC Power ONEP (there are no helpful actions from this ONEP).
		Ensure actions of ARI for annunciator P864-2A-E-3 are implemented.
		Ensure the BOP operator takes actions per the ARI for 480V LCC 16BB3 UNVERVOLT annunciator.
		Directs the BOP to evaluate Control Room panels to determine what equipment is affected the loss of 16BB3 (this is directed by the alarm response instruction for the loss of 16BB3).
		Directs local operator to determine the cause for the breaker trip.
	CRS	Uses SOI 04-1-01-R21-16 to determine what equipment is affected by the loss of 16BB3.
		Enters the following Tech Specs (due to the completion time constraints and expected plant response organization to this event, only the bolded TS is required for credit in this case):
		• TS 3.6.1.3 Condition A (4 hr)
		 TS 3.6.5.3 Condition A (8 hr) TS 3.8.7 Condition A (8 hr)
		 TS 3.8.7 Condition A (8 hr) TS 3.1.7 Condition B (7 day)
		 TS 3.6.4.3 Condition A (7 day)
		• TS 3.6.3.2 Condition A (30 day)
		• TS 3.5.1 Condition A (previously entered)

Required Operator Actions

Form ES-D-2

Scenario 4

Page 13 of 19

Op-Test No: <u>12/11</u>		Scenario No: <u>4</u> Event No: <u>4</u>
Event Desc	eription: <u>Con</u>	trol Rod Drift
TIME	Position	Applicant's Actions or Behavior
	ACRO	 Recognizes and reports that Control Rod 24-33 FH is drifting out. As indicated by annunciator P680-4A2-E-4, CONT ROD DRIFT. The operator will depress the ROD DRIFT RC&IS push button to determine which rod is drifting. The operator will then select that control rod for display on the full core display and determine the direction of the rod drift. (This
		action is described in the ARI for the above annunciator) Applies a continuous insert signal for control rod 24-33 FH per the Control Rod/Drive Malfunctions ONEP immediate operator actions.
	CRS	Enters the Control Rod/Drive Malfunctions ONEP. Ensures all immediate operator actions are carried out.
	ACRO	When Control Rod 24-33 FH becomes stuck, reduces reactor core flow to 67 mlbm/hr per the Control Rod/Drive Malfunctions ONEP immediate operator actions. Reset the rod drift annunciator by depressing the rod drift reset pushbutton on RC&IS (This action is described in the ARI for the CONT ROD DRIFT annunciator and is required in order to detect a second rod drift)
	ACRO / BOP	Plot reactor power and flow on the power to flow map after the reduction in Recirc Flow and determine entry into the Monitored Region. Set THI watch with concurrent duties. Report entry into the Monitored Region of the power to flow map to the CRS.
	CRS	Enter the Reduction in Recirc Flow ONEP. Direct the ACRO to monitor for THI (set THI watch with concurrent duties).
	ACRO	 Recognize and report that a second control rod, 28-33GH, is drifting inward. This is indicated the same as the original rod drift
	CRS	Directs the ACRO to insert a manual scram (per CRD malfunctions ONEP subsequent actions). Enter Scram and Turbine Trip ONEPs.

Required Operator Actions

Form ES-D-2

Scenario 4

Page 14 of 19

Op-Test No: <u>12/11</u>	Scenario No: <u>4</u>	Event No: <u>4 Cont.</u>
Event Description: Con	trol Rod Drift	
	 When directed, inserts a manual scram by placing the Provides a scram report: Reactor Mode SW in SHUTDOWN. Reactor power is 0%. Reactor water level and trend. Reactor pressure and trend. Feedwater is available until the main turbin away and both RFPT's lose lube oil and tria. Bypass valves are not available. 	ne trips (this is when ST-11 goes
BOP / ACRO	Initiate HPCS and RCIC in anticipation of a loss of responsibility to maintain reactor water level within the responsibility of the ACRO).	· •

Form ES-D-2

Scenario 4

Page 15 of 19

Op-Test N	p: <u>12/11</u>	Scenario No: 4_ Event No: 5				
Event Desc	eription: <u>Unis</u>	solable LOCA with limited injection capabilities				
TIME	Position	Applicant's Actions or Behavior				
	ВОР	Recognize and report 15AA bus lockout as indicated by the 4.16KV BUSS 15AA TRIP annunciator and no power to the bus. The BOP should attempt to energize the bus using the ESF 12 feeder breaker.				
	CREW	Recognize and report indications of a LOCA in the Drywell as indicated by rising drywell pressure and temperature (P680-5A-C3, DRWL PRESS HI/LO; P680-5A-C2, DRWL PRESS HI HI; HPCS and ECCS initiations due to 1.39 psig in the drywell).				
	CRS	 Enter EP-2 and EP-3 Direct actions of EP-2: Verify isolations for Reactor Level 2 and Drywell Pressure 1.39 psig. Enter the Alternate Level Control procedure of EP-2. Establish a pressure band of 800 -1060 psig. Establish a level band of +30 to -30 in. Inhibit ADS Maximize CRD for flow. 				
	ACRO	 When directed, maximize CRD for flow (only CRD B pump is available). Re-energize 16B42 on P864 Start the CRD B Aux Oil Pump Start the CRD B Pump Although there are other actions per the procedure, only these listed will accomplish anything. Update the CRS with reactor water level as it continues to lower. 				
	BOP	When directed, Inhibit ADS by placing both ADS inhibit switches to INHIBIT. Dispatch operators to recover out of service water injection sources. Evaluate and deliver ECCS Status Report to the CRS (hard card).				
	ACRO	When E22-F004 HPCS injection valve is manually opened, control reactor water level in the established level band by starting and stopping the HPCS pump as required. *The crew injects HPCS to the reactor before reactor water level lowers to -191".				

Required Operator Actions

Form ES-D-2

Scenario 4

Page 16 of 19

Op-Test No	p: <u>12/11</u>	Scenario No: <u>4</u> Event No: <u>6</u>
Event Desc	cription: <u>Div</u> i	sion 3 Diesel Generator failure to start
TIME	Position	Applicant's Actions or Behavior
		Recognizes that electric bus 17AC is de-energized (HPCS diesel has failed to start and take the bus) and shuts the feeder breaker from ESF 12 transformer to re-energize the 17AC bus. *When Division 3 Diesel Generator fails to start, the crew re-energizes the 17AC bus with an alternate feeder (ESF 12). HPCS is the only recoverable system and power to this bus is required to run the HPCS pump.
	BOP	 This is indicated by many indications, but primarily the following annunciators P601-16A-H-3, HPCS SYS OOSVC
		 P601-16A-H-1, HPCS SYS NOT READY FOR AUTO START
		 P601-16A-D-3, HPCS DSL ENG TROUBLE
		 P601-16A-F-2, HPCS SYS UNDERVOLT
		Many indicating lights will be de-energized on the P601-16 section of the P601.
		Report the status of Division 3 Diesel Generator and 17AC to the CRS.
<u> </u>		

Required Operator Actions

Form ES-D-2

Scenario 4

Page 17 of 19

Op-Test No	p: <u>12/11</u>	Scenario No: <u>4</u>	Event No: <u>7</u>						
Event Desc	ription: <u>Divi</u>	sion 2 Diesel Generator running without cooling water							
TIME	Position	Applicant's Actions or Behavior							
	BOP	 Recognizes that Division 2 Diesel Generator is running without cool places the Division 2 Diesel Generator in Maintenance Mode. As indicated by P41-F018B being de-energized and a lack of P870-7A-A-2, SSW DIV 2 OPER (this annunciator is expediated initiates and all valves have repositioned to their require Re-energizes electrical bus 16AB using ESF 12 feeder breaker. Report the status of Division 2 Diesel Generator and 16AB to the CF 	of annunciator cted when SSW red position).						

Required Operator Actions

Form ES-D-2

Scenario 4

Page 18 of 19

Op-Test No	p: <u>12/11</u>	Scenario No: 4 Event No:	8
Event Desc	ription: <u>Los</u>	s of power to E22-F004 HPCS injection valve	
TIME	Position	Applicant's Actions or Behavior	
	Crew	 Ensure an operator is sent to manually open E22-F004. *When E22-F004 loses power, the crew sends an operator to manually open valve. HPCS is the only recoverable system and this valve must be manually opened in order to allow injection to the reactor. Criteria is that this valve is opened prior to reactor water level reaching -191". Ensure an operator is sent to restore electrical power to E22-F004. 	

Scenario 4

Page 19 of 19

Give this sheet to the CRS

Turnover the following conditions:

Power	100%
Pressure	1030 psig
BOC	
EOOS	GREEN

- SSW B is in service.
- Suppression Pool temperature is elevated because of a weeping SRV.

Planned Evolutions this shift:

• The Crew will place Suppression Pool Cooling in service on RHR B. Pre-start pump checks are complete for RHR B pump.

Facility:	GGNS	Date of Exam: 12/5/2011 Operating Test No.: LOT-201											-201	1			
Α	Е	Scenarios															
Р	V		1			2				Т	1	М					
P L I	E N T	CREW POSITION			CREW POSITION			CREW POSITION			CREW POSITION			O T A		I N I	
C A N T	T Y P	S R O	A T C	B O P	S R O	A T C	B O P	S R O	A T C	B O P	S R O	A T C	B O P	L	l	M U M(*) R I	
	E																
RO-1 ×	RX		1				0							1	1	1	0
SRO-I	NOR		0				2							2	1	1	1
	I/C		2				3							5	4	4	2
SRO-U	MAJ		2				2							4	2	2	1
	TS														0	2	2
RO-2	RX			1		2				0				3	1	1	0
SRO-I	NOR			2		0				1				3	1	1	1
	I/C			1		3				2				6	4	4	2
SRO-U	MAJ			2		2				2				6	2	2	1
	TS														0	2	2
RO	RX	0				2		0						2	1	1	0
SRO-I-1	NOR	2				0		1						3	1	1	1
	I/C	3				3		3						9	4	4	2
SRO-U	MAJ	3				2		2						7	2	2	1
	TS	1				0		2						3	0	2	2
RO	RX	0			0				1					1	1	1	0
SRO-I-2	NOR	2			2				0					4	1	1	1
X	I/C	3			4				2					9	4	4	2
SRO-U	MAJ	3			2				2					7	2	2	1
	TS	1			2									3	0	2	2
RO	RX		1		0									1	1	1	0
SRO-I-3	NOR		0		2									2	1	1	1
X	I/C		2		4									6	4	4	2
SRO-U	MAJ		2		2									4	2	2	1
	TS				2									2	0	2	2

Instructions:

1.

Check the applicant level and enter the operating test number and Form ES-D-1 event numbers for each event type; TS are not applicable for RO applicants. ROs must serve in both the "at-the-controls (ATC)" and "balance-of-plant (BOP)" positions; Instant SROs must serve in both the SRO and the ATC positions, including at least two instrument or component (I/C) malfunctions and one major transient, in the ATC position. If an Instant SRO additionally serves in the BOP position, one I/C malfunction can be credited toward the two I/C malfunctions required for the ATC position.

 Reactivity manipulations may be conducted under normal or *controlled* abnormal conditions (refer to Section D.5.d) but must be significant per Section C.2.a of Appendix D. (*) Reactivity and normal evolutions may be replaced with additional instrument or component malfunctions on a 1-for-1 basis.

3. Whenever practical, both instrument and component malfunctions should be included; only those that require verifiable actions that provide insight to the applicant's competence count toward the minimum requirements specified for the applicant's license level in the right-hand columns.

Competencies Checklist

Form ES-301-6

Facility: GGNS	Date of	Pate of Examination:12/5/2011 Operating Test No.: LOT-20												
					APPLICANTS									
	SF SF	RO-1 🖾 SRO-I 🗔 SRO-U 🗌				RO-2 X SRO-I A SRO-U A				RO SRO-I-1 X SRO-U				
Competencies			IARIO				IARIC)			IARIO			
	1	2	4		1	2	4		1	2	4			
Interpret/Diagnose	5,7	3,6			3,6	3,5	3,4		1,3	3,5	3,4			
Events and Conditions	8,9	7,8			8	6,7	5,6		5,6	6,7	5,6			
						8	7,8		7,8	8	7,8			
									9					
Comply With and	4,5	1,2			2,3	2,3	1,2		2,3	2,3	1,2			
Use Procedures (1)	6,7	3,6			4,6	6,7	3,4		4,5	6,7	3,4			
	8	7,8			8	8	5,6		6,7	8	5,6			
							7,8		8		7,8			
Operate Control	4,5	1,2			2,3	2,3				2,3				
Boards (2)	6,7	3,7			4,6	6,7				6,7				
	8,9	8			8	8				8				
Communicate	2,3	1,2			1,2	2,3	1,2		1,2	2,3	1,2			
and Interact	4,5	3,4			3,4	5,6	3,4		3,4	5,6	3,4			
	6,7	6,7			6,8	7,8	5,6		5,6	7,8	5,6			
	8,9	8					7,8		7,8		7,8			
									9					
Demonstrate									3,4		2,3			
Supervisory Ability (3)									5,6		4,5			
									7,8		6,7			
									9		8			
Comply With and Use Tech. Specs. (3)									1		3			

Notes:

Includes Technical Specification compliance for an RO. Optional for an SRO-U. Only applicable to SROs.

(1) (2) (3)

Instructions:

Check the applicants' license type and enter one or more event numbers that will allow the examiners to evaluate every applicable competency for every applicant.

Facility: GGNS Date of Examination:12/5/2011 Operating Test No.: LOT-2011												2011
					A	PPLI	CANT	S	1			
	SF	RO SRO-I-2 SRO-U) RO-I-3 RO-U) O-I O-U]
Competencies		SCEN	ARIC)		SCEN	ARIC)		SCEN	IARIO	1
	1	2	4		1	2	4		1	2	3	4
Interpret/Diagnose	1,3	3,4	3,4		5,7	3,4						
Events and Conditions	5,6	6,7	5,8		8,9	6,7						
	7,8	8				8						
	9											
Comply With and	2,3	1,2	2,4		4,5	1,2						
Use Procedures (1)	4,5	3,6	5,8		6,7	3,6						
	6,7	7,8			8	7,8						
	8											
Operate Control			2,4		4,5							
Boards (2)			5		6,7							
					8,9							
Communicate	1,2	1,2	2,3		2,3	1,2						
and Interact	3,4	3,4	4,5		4,5	3,4						
	5,6	5,6	8		6,7	5,6						
	7,8	7,8			8,9	7,8						
	9											
Demonstrate	3,4	2,3				2,3						
Supervisory Ability (3)	5,6	6,7				6,7						
	7,8	8				8						
	9											

Comply With and Use Tech. Specs. (3)	1	4,5				4,5							
(2) Optional for an SRO-L	J.	ation c	Notes: (1) Includes Technical Specification compliance for an RO. (2) Optional for an SRO-U.										

Instructions:

Check the applicants' license type and enter one or more event numbers that will allow the examiners to evaluate every applicable competency for every applicant.